

For the benefit and convenience of its customers, Fluke Corporation (Fluke) has reproduced this copy of a manual which is no longer in production. This manual has not been edited or updated since the revision date shown on the *lower left hand corner of the first page*. Fluke will not be liable for any claims, losses or damages of any kind incurred by any user arising from use of this manual.

8024A

Table of Contents

SECTION	TITLE	PAGE
1	INTRODUCTION AND SPECIFICATIONS	1-1
	1-1. INTRODUCTION	1-1
	1-3. SPECIFICATIONS	1-2
2	OPERATING INSTRUCTIONS	2-1
	2-1. INTRODUCTION	2-1
	2-3. PREPARING FOR OPERATION	2-1
	2-4. Unpacking	2-1
	2-7. Battery or Fuse Installation/Replacement	2-1
	2-9. PHYSICAL FEATURES	2-3
	2-11. OPERATING NOTES	2-3
	2-13. Input Overload Protection	2-3
	2-15. Input Connection to COMMON	2-7
	2-17. Fuse Check	2-7
	2-19. Fuse Replacement	2-7
	2-21. The Display	2-7
	2-26. OPERATION	2-9
	2-28. AC/DC Volts (V) Operation	2-9
	2-30. AC/DC Current (mA) Operation	2-9
	2-32. Resistance (k Ω) Operation	2-9
	2-34. Continuity Testing	2-9
	2-36. Diode Testing	2-13
	2-38. Conductance (nS) Operation	2-13
	2-40. Temperature ($^{\circ}$ C) Operation	2-13
	2-43. Level Detector Operation	2-16
	2-45. Peak Hold Operation	2-17
	2-47. INITIAL CHECK-OUT PROCEDURE	2-19
	2-49. MEASUREMENT TECHNIQUES	2-21
	2-51. Temperature Conversion	2-21
	2-53. Conductance-to-Resistance Conversion	2-24
	2-55. AC Measurements	2-24
	2-57. AC/DC/Voltage Measurements	2-24
	2-60. AC/DC Current Measurements	2-24
	2-64. Resistance Measurements	2-29
	2-67. APPLICATIONS	2-29
	2-69. Thermocouples	2-30
	2-75. Leakage Tester	2-30
3	THEORY OF OPERATION	3-1
	3-1. INTRODUCTION	3-1
	3-3. OVERALL FUNCTIONAL DESCRIPTION	3-1
	3-5. A/D Converter	3-1
	3-14. Voltage Measurement Function	3-6
	3-16. Current Measurement Function	3-6
	3-18. Temperature ($^{\circ}$ C) Measurement Function	3-6
	3-20. Resistance Measurement Function	3-6

TABLE OF CONTENTS, *continued*

SECTION	TITLE	PAGE
	3-23. Conductance Measurement Function	3-11
	3-25. Peak Hold Circuit Level	3-11
	3-27. Level Detector Circuit	3-11
4	MAINTENANCE	4-1
	4-1. INTRODUCTION	4-1
	4-3. SERVICE INFORMATION	4-1
	4-7. GENERAL INFORMATION	4-3
	4-8. Access Information	4-3
	4-13. Display Access	4-4
	4-17. Cleaning	4-5
	4-19. Battery/Backup Fuse Replacement	4-6
	4-21. PERFORMANCE TEST	4-6
	4-23. Initial Procedure	4-6
	4-25. Display Test	4-6
	4-27. Voltage Test	4-8
	4-29. Current Test	4-8
	4-31. Resistance/Conductance Test	4-8
	4-33. Peak Hold Test	4-9
	4-35. Continuity Test	4-11
	4-37. Level Detector Test	4-11
	4-39. BT Test	4-12
	4-41. Temperature Test	4-13
	4-43. CALIBRATION ADJUSTMENTS	4-14
	4-46. TROUBLESHOOTING	4-15
5	LIST OF REPLACEABLE PARTS	5-1
	5-1. INTRODUCTION	5-1
	5-4. HOW TO OBTAIN PARTS	5-2
6	ACCESSORIES INFORMATION	6-1
	6-1. INTRODUCTION	6-1
	6-3. DELUXE CARRYING CASE (C90)	6-1
	6-5. RUGGED CARRYING CASE (Y8105)	6-1
	6-7. TYPE K SHEATHED THERMOCOUPLE (Y8102)	6-1
	6-8. Introduction	6-1
	6-10. Specifications	6-4
	6-11. TYPE K BEAD THERMOCOUPLE (Y8103)	6-4
	6-12. Introduction	6-4
	6-14. Specifications	6-4
	6-15. THERMOCOUPLE TERMINATION (Y8104)	6-5
	6-16. Introduction	6-5
	6-18. Specifications	6-5
	6-19. TEMPERATURE PROBES (80T-150C and 80T-150F)	6-5
	6-20. Introduction	6-5
	6-22. Specifications	6-5
	6-23. HIGH VOLTAGE PROBE (80K-40)	6-6
	6-24. Introduction	6-6
	6-26. Specifications	6-6
	6-27. HIGH FREQUENCY PROBE (81RF)	6-6
	6-28. Introduction	6-6
	6-30. Specifications	6-6
	6-31. HIGH FREQUENCY PROBE (82RF)	6-7
	6-32. Introduction	6-7
	6-35. Specifications	6-7
	6-36. CURRENT TRANSFORMER (801-600)	6-7
	6-37. Introduction	6-7
	6-39. Specifications	6-8
	6-40. CURRENT SHUNT (80J-10)	6-8

TABLE OF CONTENTS, *continued*

SECTION	TITLE	PAGE
6-41.	Introduction	6-8
6-43.	Specifications	6-8
6-44.	BATTERY ELIMINATOR (A81)	6-8
6-46.	AC/DC CURRENT PROBE (Y8100)	6-9
6-47.	Introduction	6-9
6-49.	Specifications	6-9
6-50.	AC CURRENT TRANSFORMER (Y8101)	6-9
6-51.	Introduction	6-9
6-53.	Specifications	6-10
6-59.	SAFETY DESIGNED TEST LEAD SET (Y8132)	6-10
6-56.	DELUXE TEST LEAD SET (Y8134)	6-10
6-57.	Introduction	6-10
6-59.	SLIM FLEX TEST LEAD SET (Y8140)	6-10
6-60.	Introduction	6-10
7	SCHEMATIC DIAGRAMS	7-1
	APPENDIX A	A-1

List of Tables

TABLE	TITLE	PAGE
1-1.	8024A Accessories	1-2
1-2.	Specifications	1-3
2-1.	Controls, Indicators, and Connectors	2-4
2-2.	Input Overload Limits	2-6
2-3.	Centigrade-to-Fahrenheit Conversion Scale	2-22
2-4.	Voltage/Current Capability of Resistance Ranges	2-29
4-1.	Test Equipment Required	4-2
4-2.	Display Test	4-7
4-3.	Voltage Test	4-9
4-4.	Current Test	4-10
4-5.	Resistance/Conductance Test	4-11
4-6.	Troubleshooting Guide	4-16
5-1.	8024A Multimeter	5-3
5-2.	8024A Final Assembly (Interior)	5-5
5-3.	A1 Case Assembly	5-7
5-4.	A2 Main PCB Assembly	5-9
5-5.	A3 Switch Assembly	5-13
5-6.	Federal Supply Codes for Manufacturers	5-16
5-7.	Fluke Technical Service Centers (U.S. and Canada)	5-17
5-8.	Sales and Service Locations (International)	5-18

List of Illustrations

FIGURE	TITLE	PAGE
2-1.	Removing the Battery Cover	2-2
2-2.	Battery Removal	2-3
2-3.	Controls, Indicators, and Connectors	2-4
2-4.	Display	2-8
2-5.	Abnormal Status Indicators	2-9
2-6.	Volts Operation	2-10
2-7.	Current Operation	2-11
2-8.	Resistance Operation	2-12
2-9.	Conductance Operation	2-14
2-10.	Temperature Operation	2-15
2-11.	Level Detector Operation	2-17
2-12.	Peak Hold Operation	2-18
2-13.	Temperature Correction Factor For K-Type Thermocouples	2-21
2-14.	Conductance-to-Resistance Conversion	2-25
2-15.	Waveform Conversion	2-26
2-16.	Voltage Measurement Error Calculations	2-27
2-17.	Current Measurement Calculations	2-28
2-18.	Thermocouples	2-31
2-19.	Thermocouple Termination Unit	2-32
2-20.	Multipoint Selection	2-33
3-1.	8024A Block Diagram	3-2
3-2.	A/D Converter Functional Diagram	3-4
3-3.	Integrate Capacitor Waveform	3-5
3-4.	Voltage Measurement	3-7
3-5.	Current Measurement	3-8
3-6.	Temperature Measurement	3-9
3-7.	Resistance/Conductance Measurement	3-10
3-8.	Simplified Peak Hold Circuit	3-12
3-9.	Simplified Level Detector Circuit	3-13
4-1.	Calibration Adjustments Location	4-4
4-2.	LCD Display Assembly	4-4
4-3.	General Equipment Connection	4-7
4-4.	General Equipment Connection — Current	4-10
4-5.	BT Test	4-12
4-6.	Lag Bath	4-16
5-1.	8024A Multimeter	5-4
5-2.	8024A Final Assembly (Interior)	5-6
5-3.	A1 Case Assembly	5-8
5-4.	A2 Main PCB Assembly	5-12
5-5.	A3 Switch Assembly	5-15
6-1.	8024A Accessories	6-2
7-1.	8024A Schematic Diagram	7-3

Section 1**Introduction & Specifications****1-1. INTRODUCTION**

1-2. Your John Fluke Model 8024A is a pocket-sized digital multimeter that is ideally suited for application in the field, laboratory, shop, or home. Some of the features of your instrument are:

FUNCTIONS: All standard VOM measurement functions — ac/dc voltage, ac/dc current, resistance — plus:

Conductance: A new multimeter function that allows fast, accurate, noise-free resistance measurements up to 10,000 M Ω .

Temperature: Used with a K-type thermocouple, this function provides direct display in degrees Celsius for K-type thermocouples.

Peak-Hold: Provides short-term memory for capturing the peak value of transient ac or dc signals such as motor starting current.

Continuity: Provides an immediate visual and audible indication when continuity is detected (use for passive circuit testing).

Level Detector: Senses logic levels and other active signals less than 250V dc or ac rms. Visual and audible indications of the results are provided.

RANGE for each function has:

Full autopolarity

Overrange indication

Effective protection from overloads.

Dual slope integration measurement technique to ensure noise-free measurements.

OPERATOR CONVENIENCE:

3½ Digit Liquid-Crystal Display: A high contrast display that can be easily read from across the room. No more worries about bent needles, parallax, etc.

Long term calibration stability: 1-year. Easy calibration - few adjustments.

Lightweight: .482 kg (17 ounces).

Safety Designed Test Leads: Finger guards on the probe and shrouded contacts on connectors reduce the chance of accidental contact with circuit voltages.

POWER:

Up to 100 hours of continuous operation can be expected from a single, inexpensive, 9-volt, alkaline battery (transistor radio/calculator type).

Low battery voltage is automatically detected and displayed. The low battery indication, BT, appears in the display when about 10 hours of operation remain.

Line operation is possible using a Model A81 Battery Eliminator. (See Section 6.)

ACCESSORIES:

A full line of accessories are available to extend the range and scope of your instrument. They are listed in Table 1-1 and described in detail in Section 6.

1-3. SPECIFICATIONS

1-4. Table 1-2 lists the specifications of your 8024A.

Table 1-1. 8024A Accessories

MODEL NO.	DESCRIPTION
C90	Deluxe Carrying Case (Soft Vinyl)
Y8105	Rugged Carrying Case (Molded Plastic)
Y8102	Type K Sheathed Thermocouple
Y8103	Type K Beaded Wire Thermocouple
Y8104	Thermocouple Termination Kit
80T-150C	Temperature Probe °C
80T-150F	Temperature Probe °F
80K-40	High Voltage Probe
81RF	High Frequency Probe
82RF	High Frequency Probe

Table 1-1. 8024A Accessories (cont)

MODEL NO.	DESCRIPTION
80I-600	Current Transformer, 2" jaw opening
80J-10	Current Shunt
A81	Battery Eliminator
Y8100	AC/DC Current Probe
Y8101	Current Transformer 7/16" jaws
Y8132	Safety Designed Test Lead Set
Y8134	Deluxe Test Lead Set
Y8140	Slim Flex Test Lead Set

Table 1-2. Specifications

ELECTRICAL:

The following electrical specifications assume a 1-year calibration cycle and an operating temperature of 18°C to 28°C (64°F to 82°F) at relative humidity up to 90% unless otherwise noted.

FUNCTIONS: DC Volts, AC Volts, DC Current, AC Current, Resistance, Diode Test, Conductance, Temperature, Peak-Hold, Continuity, and Level Detection.

DC VOLTS:

RANGE	RESOLUTION	ACCURACY FOR 1 Year
±200 mV	100 μ V	±(0.1% of reading +1 digit)
±2V	1 mV	
±20V	10 mV	
±200V	100 mV	
±1000V	1V	

Response Time: Less than 1 sec.

Overvoltage Protection: 1000V dc or peak ac on all ranges, except 200 mV (15 sec max above 300V dc or rms)

Input Impedance: 10 M Ω , all ranges

Normal Mode Rejection Ratio: >60 dB at 50 Hz and 60 Hz

Common Mode Rejection Ratio (1 k Ω unbalance): >100 dB at dc, 50 Hz and 60 Hz

Table 1-2. Specifications (cont)

AC VOLTS (Average Sensing, RMS Calibrated Sinewave):

RANGE	RESOLUTION	ACCURACY		
		45 Hz to 1 kHz	1 kHz to 2 kHz	2 kHz to 5 kHz
200 mV	100 μ V	$\pm(0.75\%$ of reading +2 digits)	$\pm(1.5\%$ of reading +3 digits)	$\pm(5\%$ of reading +5 digits)
2V	1 mV			
20V	10 mV			
200V	0.1V	$\pm(1\%$ of reading +2 digits)	Not Specified	Not Specified
750V	1V			

Response Time: Less than 2 seconds

Overload Protection: 750V rms or 1000V peak continuous, except 200 mV ac ranges (15 seconds maximum above 300V rms).

Common Mode Rejection Ratio (1 k Ω unbalance): >60 dB at 50 Hz and 60 Hz

Volt-Hz Product: 10^7 max (200V at 50 kHz)

Input Impedance: 10 M Ω in parallel with <100 pF

DC CURRENT:

RANGE	RESOLUTION	ACCURACY for 1 Year	BURDEN VOLTAGE
2 mA	1 μ A	$\pm(0.75\%$ of reading +1 digit)	0.25V max
20 mA	10 μ A		
200 mA	100 μ A		
2000 mA	1 mA		0.9V max

Response Time: Less than 1 sec.

Overload Protection: 2A/250V fuse in series with 3A/600V fuse.

Table 1-2. Specifications (cont)




AC CURRENT:

RANGE	RESOLUTION	ACCURACY for 1 Year		BURDEN VOLTAGE
		45 Hz to 450 Hz	450 Hz to 1 kHz	
2 mA	1 μ A	$\pm(3\%$ of reading +2 digits)	Not Specified	0.25V rms max
20 mA	10 μ A	$\pm(1.5\%$ of reading +2 digits)		
200 mA	100 μ A			
2000 mA	1 mA			0.9V rms max

Response Time: Less than 2 seconds

Overload Protection: 2A/250V fuse in series with 3A/600V fuse.

RESISTANCE:

RANGE	RESOLUTION	ACCURACY for 1 Year	FULL-SCALE VOLTAGE	MAXIMUM TEST CURRENT
200 Ω	0.1 Ω	$\pm(0.2\%$ of reading +3 digits)	<0.25 V	.35 mA
2 k Ω 	1 Ω	$\pm(0.1\%$ of reading +1 digit)	>1.0 V	1.1 mA
20 k Ω	10 Ω		<0.25 V	13 μ A
200 k Ω 	100 Ω		>0.7 V	13 μ A
2000 k Ω	1 k Ω	$\pm(0.15\% +1$ digit)	<0.25 V	0.13 μ A
20 M Ω 	10 k Ω	$\pm(2\%$ of reading +1 digit)	$>.7$ V	0.13 μ A

Overload Protection: 500V dc/ac rms on all ranges

Open Circuit Voltage: Less than 1.5V on all ranges except 2 k Ω range is less than 3.5V.

Diode Test: The three ranges marked with a diode symbol have enough open circuit voltage to turn on silicon junctions allowing a diode test. The 2 k Ω range is preferred and is marked with the larger diode symbol. The three non-diode test ranges will not turn on silicon junctions when making in-circuit resistance measurements.

Table 1-2. Specifications (cont)

CONDUCTANCE: ***Range:** 200 nS**Equivalent Resistance Range:** 5M Ω to 10,000 M Ω **Accuracy:** $\pm(2.0\%$ of reading + 10 digits)**Resolution:** 0.05% of range (10^{-10} S)**Overload Protection:** 500V dc/ac rms**Diode Test:** Will forward bias a typical PN junction

*Conductance is the inverse of ohms ($1/\Omega$) and is expressed in Siemens (S).
A decrease in conductance is equivalent to an increase in resistance.

PEAK HOLD Use for Measuring Transient Signals

FUNCTIONS, RANGES	AC or DC, VOLTS or CURRENT ALL RANGES
AC Accuracy (48 — 450 Hz)	3% of reading + 10 digits, all ranges (except 2 mA, 6% of reading + 10 digits). Average sensing, calibrated to read highest rms value of sine wave.
Acquisition Time	150 ms**
DC Accuracy	3% of reading + 10 digits, positive pulses
Acquisition Time	10 ms** square pulse (3 ms square or 8 ms half sine typ.)
Display Decay Rate	<1 digit/sec

**Acquisition Time is the minimum duration of peak or surge for rated accuracy.
Accuracy improves for longer peak duration.

TEMPERATURE (Thermocouple accessory required)

Temperature Sensor	K-Type Thermocouple (Chromel-Alumel) See accessories
Range	-20°C to +1265°C
Resolution	1°C

Table 1-2. Specifications (cont)

TEMPERATURE (cont)

Accuracy	$\pm 3^{\circ}\text{C} \pm 1$ digit, -20° to $+300^{\circ}\text{C}$ 3% of reading, $+300^{\circ}\text{C}$ to $+1265^{\circ}\text{C}$ (Accuracy includes NBS conformity, calibration stability, zero, and reference junction but not thermocouple errors.)
Connection	Dual banana isothermal termination provided with FLUKE thermocouple accessories. Use Y8104 termination accessory for any K-Type thermocouple.
Overload Protection	2A/250V fuse in series with 3A/600V fuse.

CONTINUITY Use for Passive Circuit Testing*

Ranges	All Resistance and Conductance ranges
Indication	Open Circuit: " ▲ " Display Continuity: " ▼ " Display + 2 kHz audio tone (selectable)
Response Time (2 k Ω range)	50 μs (Minimum duration of continuity or open to toggle display or audio tone. Pulse stretcher holds display and tone for approx. 100 ms.)
Overload Protection	500V dc or rms all ranges

*See section 2 for additional information.

LEVEL DETECTOR Use for Active Circuit Testing

Reference Level	+0.8V dc nominal on 200 k Ω range
Display	" ▲ " for inputs greater than reference " ▼ " for inputs less than reference " ◆ " for inputs toggling above and below reference Audio tone coincident with " ▼ " (switch selectable)

Table 1-2. Specifications (cont)

LEVEL DETECTOR Use for Active Circuit Testing (cont)

Pulse Response (200 k Ω range)	50 μ S (Minimum width of 0 to +3V pulse required to toggle display. Pulse stretcher holds display for approx. 100 ms when short pulses are detected.)
Input Impedance	>100 k Ω in parallel with <100 pF
Overload Protection	500V dc or rms

ENVIRONMENTAL:

Temperature: 0°C to 50°C (32°F to 122°F) operating, -35 to +60°C storage

Relative Humidity: 0 to 90% from 0°C to 35°C except 0 to 80% from 0°C to 35°C on 2M Ω , 20M Ω , and 200 nS ranges; 0 to 70% from 35°C to 50°C

Temperature Coefficient: < 0.1 times the applicable accuracy specification per °C for 0°C to 18°C and 28°C to 50°C (32°F to 64.4°F and 82.4°F to 122°F), except temperature (<0.02 X accuracy per °C)

GENERAL:

Protection Class 2: (Relates solely to insulation or grounding properties defined in IEC 348)

Maximum Common Mode Voltage: 500V dc or rms

Power Requirements: Single 9V battery, NEDA 1604

Battery Life: Alkaline: 100 hours typical

Zinc carbon: 50 hours typical

Battery Indicator: "BT" in display illuminates when approximately 20% of life remains

Display: 3½ digit LCD (1,999 count), autozero, autopolarity

Size: L x W x H: 18.0 cm x 8.6 cm x 4.5 cm
(7.1 in x 3.4 in x 1.8 in)

Weight: .48 Kg, (17 oz)

Section 2

Operating Instructions

2-1. INTRODUCTION

2-2. To fully utilize the measurement capabilities of your 8024A, a basic understanding of its measurement techniques and limitations is required. This section of the manual provides that information.

2-3. PREPARING FOR OPERATION

2-4. Unpacking

2-5. Your 8024A, this manual, one 9V battery, and two test leads (one red and one black) were shipped to you in a specially designed container. Check the shipment carefully and contact the place of purchase immediately if anything is wrong. If the place of purchase fails to satisfy you, contact the nearest John Fluke Service Center. A list of these service centers is located at the end of Section 5 in this manual.

2-6. If reshipment is necessary, please use the original shipping container. If the original container is not available, a new one can be obtained from the John Fluke Mfg. Co., Inc. Please state the instrument model number when requesting a new shipping container.

2-7. Battery or Fuse Installation/Replacement

2-8. Your 8024A is designed to operate on a single, inexpensive, 9V battery of the transistor radio/calculator variety (NEDA 1604). When you receive your 8024A, the battery will not be installed in the DMM. Once the battery is installed, you can expect a typical operating life of up to 100 hours with an alkaline battery or 50 hours with a carbon-zinc battery. When the battery has exhausted about 80% of its useful life the BT indicator will appear in the upper left corner of the display. Your 8024A will operate properly for at least 10 hours on an alkaline battery after BT appears in the display. Use the following procedure to install or replace the battery or fuse:

CAUTION


To ensure operation within the accuracy specifications, the battery should be replaced when the voltage measured at the center of the battery eliminator connector falls below -3.00 volts (with respect to the COMMON input). If the battery voltage falls to a point where the "BT" is displayed and the digital display is inactive or no longer responds to a signal input, the battery should be replaced immediately to prevent damage to the LCD.

WARNING

TO AVOID ELECTRICAL SHOCK, BATTERY OR FUSE REPLACEMENT SHOULD ONLY BE PERFORMED AFTER THE INPUT SIGNAL AND TEST LEADS HAVE BEEN REMOVED FROM THE INPUT TERMINALS AND THE POWER SWITCH HAS BEEN SET TO OFF.

1. Set the 8024A POWER switch to OFF.
2. Remove test leads from external circuit connections and from the 8024A input terminals.
3. Open the battery compartment on the bottom of the 8024A as shown in Figure 2-1.
4. Tilt the battery out as shown in Figure 2-2.
5. If fuse F1 is to be replaced, use a pointed tool, such as a probe tip or small screwdriver to pry F1 from its holder. Replace the defective fuse with type AGX2.
6. Carefully pull the battery clip free from the battery terminals as shown in Figure 2-2.

USE THUMBS TO PUSH
BATTERY COVER FROM
8024A CASE. INDEX
FINGERS SHOULD BE
USED TO PREVENT
COVER FROM
FLYING AWAY.

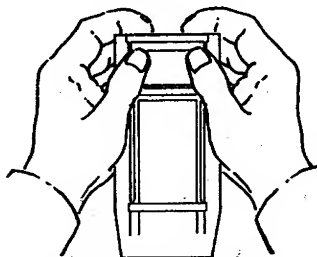

BACK SIDE OF 8024A

Figure 2-1. Removing the Battery Cover

7. Press the battery clip onto the replacement battery and return both to the battery compartment.
8. Make sure the battery and its leads are completely within the confines of the battery compartment before sliding the cover into place.

WARNING

DO NOT OPERATE THE 8024A UNTIL THE BATTERY COVER IS IN PLACE AND FULLY CLOSED.

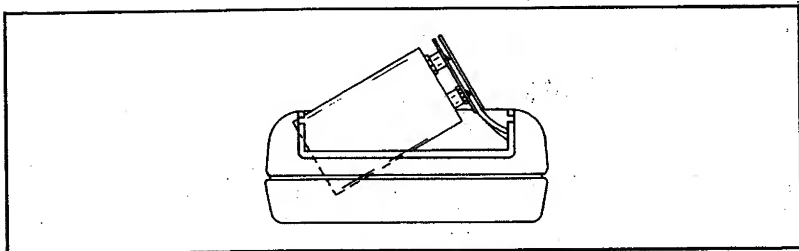


Figure 2-2. Battery Removal

2-9. PHYSICAL FEATURES

2-10. Before you try to use your 8024A, we suggest you take a few minutes to get acquainted with your instrument. All of the externally accessible physical features of your 8024A are shown in Figure 2-3 and described in Table 2-1. Locate each feature on your 8024A as you read the description.

2-11. OPERATING NOTES

2-12. The following paragraphs will familiarize you with the capabilities and limitations of your Model 8024A.

2-13. Input Overload Protection

CAUTION

Exceeding the maximum input overload limits can damage your instrument. The transient overload protection circuit is intended to protect against short duration high energy pulses. The components used limit the protection to approximately five pulses per second for 6 kV, 10 microsecond pulses, and about 0.6 watts average for lower pulses. Fast rep rate pulses as from a TV set can damage the protection components; RV1 - RV4, R1 and R2*, if replaced, use only Fluke replacement parts to maintain product safety. * R2 is a fusible resistor. Use exact replacement to insure safety.

2-14. Each measurement function and its associated ranges are equipped with input overload protection. The overload limits for each function and range are given in Table 2-2.

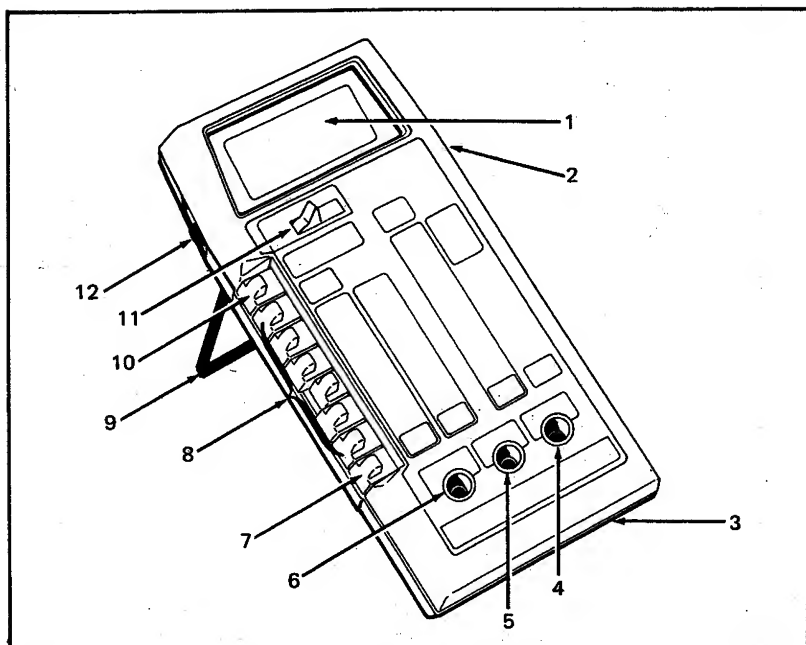


Figure 2-3. Controls, Indicators and Connectors

Table 2-1. Controls, Indicators, and Connectors

ITEM NO.	NAME	FUNCTION
1	Display	A 3½ digit display (1999 max) with decimal point and minus polarity indication. Used to indicate measured input values, overrange condition, low battery condition and level.
2	Battery Eliminator Connector	An external input power connector for use with the Model A81 Battery Eliminator accessory. (A81 is available in a variety of voltage and plug configurations. See Section 6.)
3	Battery Compartment and Cover	Cover for the 9V battery and current-protection fuse F1. The cover is removed by pushing it away from the case screw.

Table 2-1. Controls, Indicators and Connectors (cont)

ITEM NO.	NAME	FUNCTION
4	V/k Ω /nS Input Connector	Protected test lead connector used as the high input for all voltage, conductance, continuity, level detector, and resistance measurements. This connector will accept standard banana plugs.
5	COMMON Input Connector	Protected test lead connector used as the low or common input for all measurements. Will accept banana plugs.
6	mA/ $^{\circ}$ C Input Connector	Protected test lead connector used as the high input for all current and temperature.
7	Function Switch mA/ $^{\circ}$ C/V/k Ω /nS	A push-push switch (push on - push off, do not pull to select a function), which works in conjunction with the high input connectors and the TEMP $^{\circ}$ C switch to select DMM measurement function.
8	Range Switches	<p>Interlocked push-button switches for selecting ranges, i.e., pressing the desired range switch selects that range and cancels previous switch depressions. Do not pull switches to select a range.</p> <p>Voltage: 200 mV, 2V, 20V, 200V, 1000V dc/750V ac</p> <p>Current: 2 mA, 20 mA, 200 mA, 2000 mA</p> <p>Resistance: 200Ω, 2 kΩ, 20 kΩ, 200 kΩ, 2000 kΩ, 20 MΩ</p> <p>Conductance: 200 nS (S = Siemens = 1/Ω = international unit of conductance). Requires simultaneous depression of two range switches.</p> <p>Temperature: $^{\circ}$C</p>
9	Tilt Bail	A removable fold-out stand which allows the instrument to be either tilted for bench-top use or hung from a hook in the absence of a work area.

Table 2-1. Controls, Indicators and Connectors (cont)

ITEM NO.	NAME	FUNCTION
10	DC/AC/Audible Tone Switch	A push-push switch (push on - push off, do not pull). When using V or mA functions, the in position selects AC measurement functions and the out position selects the DC measurement function. When used with $k\Omega$ or nS functions, the in position enables the audible tone feature and the out position disables the audible tone feature.
11	PEAK HOLD Switch	A push-push switch (push on - push off, to the right only, do not push or pull to the left), that enables or disables the Peak-Hold function.
12	POWER Switch	A slide switch used to turn the instrument off and on.

Table 2-2. Input Overload Limits

SELECTED FUNCTION	INPUT TERMINALS	MAX. INPUT OVERLOAD
Voltage	V/ $k\Omega$ /nS and COMMON	1000V dc or peak ac on all ranges except 200 mV (15 sec max above 300V dc or rms)
Current and Temperature	mA - $^{\circ}$ C and COMMON	2A maximum, fuse protected to 600V dc/ac rms. DO NOT USE ABOVE 600V.
RESISTANCE, CONTINUITY, LEVEL DETECTOR and CONDUCTANCE	V/ $k\Omega$ /nS and COMMON	500V dc/ac rms.
ANY	COMMON	500V dc/ac rms with respect to earth ground.

2-15. Input Connection to COMMON

WARNING

TO AVOID ELECTRICAL SHOCK AND/OR INSTRUMENT DAMAGE, DO NOT CONNECT THE COMMON INPUT TERMINAL TO ANY SOURCE OF MORE THAN 500 VOLTS DC OR 500V RMS AC ABOVE EARTH GROUND.

2-16. The 8024A may be operated with the COMMON input terminal at a potential of up to 500V dc or 500V rms ac above earth ground. If this limit is exceeded, instrument damage may occur. This, in turn, may result in a safety hazard for the operator.

2-17. Fuse Check

2-18. The current (mA) function contains two fuses. Check them as follows:

1. Complete the set up steps for the RESISTANCE (Ω) function and select the 2 k Ω range.
2. Touch the red test probe to the mA input jack so that the V- Ω input and mA input are connected together.
3. If the display reads approximately .100 k Ω , both fuses are good.
4. If the display reads overrange 1 followed by blank digits, one or both fuses need replacement. See the following paragraph for replacement instructions.


2-19. Fuse Replacement

2-20. All ac and dc current ranges are fuse protected. Two series fuses are used: (1) F1, 2A/250V, replaceable at the battery compartment (see section 2 "Battery or Fuse Installation/Replacement") and (2) F2, 3A/600V backup fuse (see section 4 "Battery/Backup Fuse Replacement").

WARNING

TO AVOID ELECTRICAL SHOCK DO NOT OPERATE THE 8024A UNTIL THE BATTERY COVER IS IN PLACE AND FULLY CLOSED.

2-21. The Display

2-22. As Figure 2-4 shows, your 8024A has a 3½ digit liquid crystal display. Displayed values can range from 000 through 1999 (1999 is rounded to 2000 for ease of discussion). The decimal point position is determined by the selected range and is independent of selected function, except temperature. When the °C function is selected, the decimal point is not displayed. If the dc voltage or current measurement function is selected, the minus sign indicates that the input signal is negative with respect to the COMMON input terminal. If the °C measurement function is selected, the minus sign indicates that the input temperature is below zero. The absence of a minus sign indicates a positive reading. The minus sign is also used in conjunction with the up and  down arrows when analyzing the input signal using the level detector function.

NOTE

The minus sign (-) may flash momentarily as the 8024A comes out of an overrange condition. This will most likely be seen in the ohms mode as the open circuit test leads are applied to an in-range resistance value. If the minus sign remains on for in-range ohms readings, the circuit is live (a negative voltage is present at the input terminals due to charged capacitors, etc.) and incorrect resistance readings will be displayed.

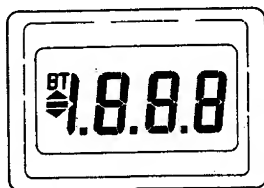


Figure 2-4. Display

2-23. The up and ∇ down arrows (above and below the minus sign) are enabled by selecting the resistance or conductance functions. These arrows are visual indicators for the continuity and level detector functions.

2-24. The display has two abnormal status indicators (Figure 2-5), low battery power and instrument overrange. A BT is displayed when approximately 20% of battery life remains (battery replacement is indicated). A 1 followed by three blanked digits is displayed (decimal point may be present) as an overrange indication. It means that the next higher range should be selected. It does not necessarily mean that the instrument is being exposed to a damaging input condition. For example, when measuring resistance an open-input will cause an overrange indication.

NOTE

When the 8024A is powered with the A-81 Battery Eliminator the "BT" indicator may come on. However, instrument operation will be normal.

2-25. The liquid crystal display used in the 8024A is a rugged and reliable unit which will give years of satisfactory service. Display life can be extended by observing the following practices:

1. Protect the display from extended exposure to bright sunlight.

2. Keep the multimeter out of high temperature, high humidity environments (such as the dash of a car on a hot, sunny day). Otherwise the display may temporarily turn black. Recovery occurs at normal operating temperature.
3. The display operation may be slowed in extremely low temperature environments. No damage will occur to the LCD, but response time is greatly increased. Recovery occurs at normal operating temperature.

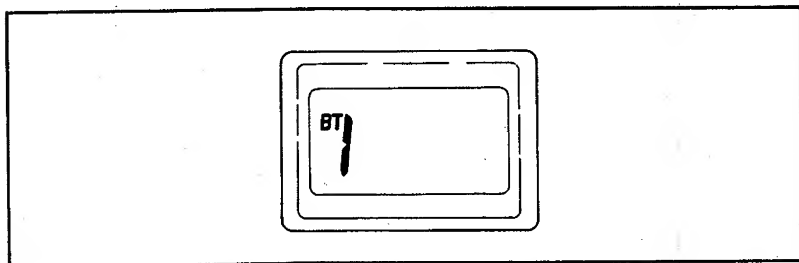


Figure 2-5. Abnormal Status Indicators

2-26. OPERATION

2-27. The following paragraphs describe how to operate your 8024A in each of its nine functions. Proceed to the description for the function you want to use.

2-28. AC/DC Volts (V) Operation

2-29. Figure 2-6 shows operation for the voltage measurement function. Perform each of the steps listed in sequence and comply with the warning.

2-30. AC/DC Current (mA) Operation


2-31. Figure 2-7 shows operation for the current measurement function. Perform each of the steps listed in sequence and comply with the warning.

2-32. Resistance (k Ω) Operation

2-33. Figure 2-8 shows operation for the resistance measurement function. To make resistance measurements, complete each of the steps listed in the figure sequentially, and comply with the warning.

2-34. Continuity Testing

2-35. The 2 k Ω range of your 8024A can be used to make fast continuity tests. Select the 2 k Ω range, k Ω function, and depress the AC/DC switch (to enable the audible alarm). The \blacktriangle up arrow will appear in the display. If continuity is measured between the test lead tips (touch the tips together momentarily), the audible tone will sound, then the \blacktriangle up arrow will disappear from the display and the \blacktriangledown down arrow will appear. Typically, 600 Ω , or less will activate the \blacktriangledown down arrow and audio tone. Comply with the k Ω warning.

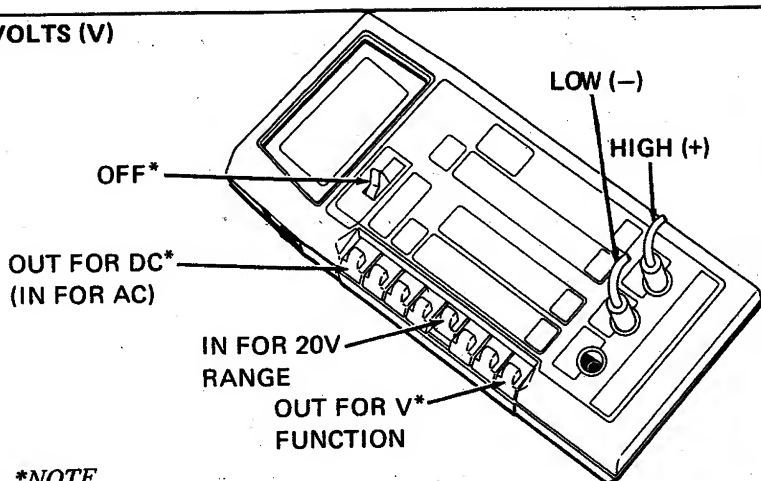VOLTS (V)***NOTE**

The PEAK-HOLD switch and Function switches are push-push type. Operate these switches by pushing to the RIGHT ► only! Do not push or pull these switches to the left (out or off) positions.

- Connect the test leads as shown above.
- Depress the grey switch beside the range desired (20V is shown selected).
- Set the AC/DC switch out for DC or in For AC (DC is shown selected).
- Insure that all other switches are at the out or OFF positions.


WARNING

TO AVOID ELECTRICAL SHOCK AND/OR INSTRUMENT DAMAGE, DO NOT CONNECT THE 8024A TERMINALS TO SOURCES THAT EXCEED THE FOLLOWING LIMITS WHEN MEASURING VOLTAGES:
COMMON: 500V DC OR AC RMS WITH RESPECT TO EARTH GROUND.

V-k Ω -nS: 1000V DC OR 750V AC RMS WITH RESPECT TO THE COMMON TERMINAL (IN THE 200mV RANGE, SOURCES GREATER THAN 300V DC OR AC RMS SHOULD NOT BE CONNECTED LONGER THAN 15 SECONDS).

- Connect the test leads to the circuit being measured.
- Read the measured value on the display. The minus sign will appear if the V-k Ω -nS terminal is negative with respect to the COMMON terminal.

Figure 2-6. Volts Operation

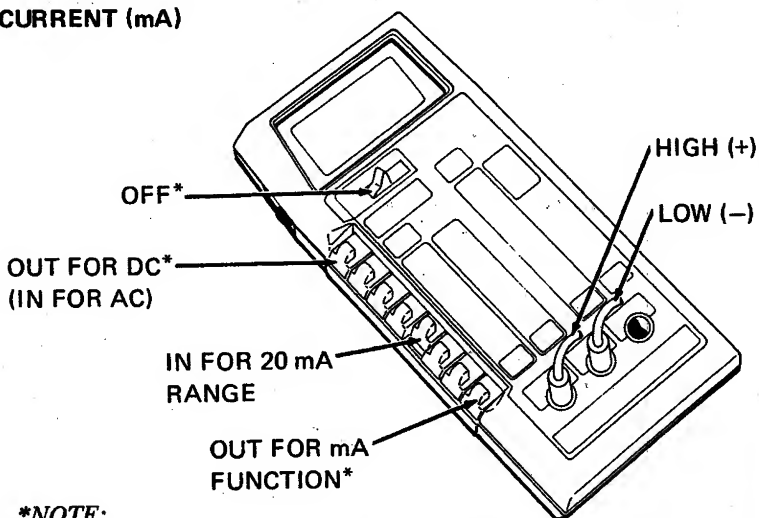CURRENT (mA)***NOTE:**

The PEAK-HOLD switch and Function switches are push-push type. Operate these switches by pushing to the RIGHT ► only! Do not push or pull these switches to the left (out or off) positions.

- Connect the test leads as shown.
- Depress the grey switch beside the range desired (20 mA range shown selected).
- Set the AC/DC switch out for DC or in for AC.
- Insure that all other switches are at the out or OFF positions.

WARNING


TO AVOID ELECTRICAL SHOCK AND/OR INSTRUMENT DAMAGE, DO NOT CONNECT THE 8024A TERMINALS TO SOURCES THAT EXCEED THE FOLLOWING LIMITS WHEN MEASURING CURRENT:

COMMON: 500V DC OR AC RMS WITH RESPECT TO EARTH GROUND.

mA-°C: CURRENT OF 2 AMPS OR OPEN CIRCUIT VOLTAGE OF 600V DC/AC RMS.

- Connect the test leads to the circuit being measured.
- Read the measured value on the display. In DC the minus sign will appear if the mA-°C terminal is negative with respect to the COMMON terminal.

Figure 2-7. Current Operation

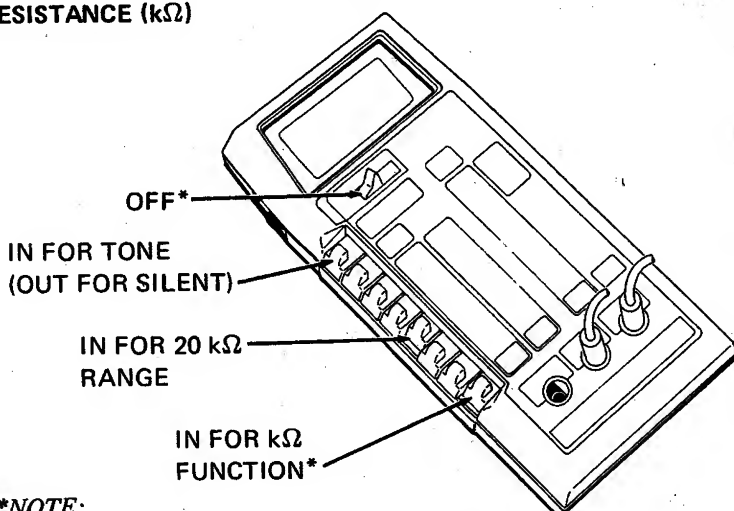RESISTANCE ($k\Omega$)***NOTE:**

The PEAK-HOLD switch and Function switches are push-push type. Operate these switches by pushing to the RIGHT ► only! Do not push or pull these switches to the left (out or off) positions.

- Connect the test leads as shown.
- Depress the mA-°C-V-k Ω -nS switch.
- Depress the grey switch beside the range desired (20k is shown selected).
- Insure that all other switches are at the out or OFF positions.
- Make sure that the device being measured contains no electrical energy.

WARNING

TO AVOID ELECTRICAL SHOCK AND/OR INSTRUMENT DAMAGE, DO NOT CONNECT THE 8024A TERMINALS TO SOURCES THAT EXCEED THE FOLLOWING LIMITS WHEN MEASURING RESISTANCE OR CONTINUITY:

COMMON: 500V DC OR AC RMS WITH RESPECT TO EARTH GROUND.

V-k Ω -nS: 500V DC OR AC RMS WITH RESPECT TO THE COMMON TERMINAL.

- Connect the test leads across the device being measured.
- Read the measured value on the display.

Figure 2-8. Resistance Operation

2-36. Diode Testing

2-37. The 2 k Ω , 200 k Ω , and 20 M Ω ranges of the k Ω function will turn on PN junctions. Each of these ranges is marked with a diode symbol on the front panel of your 8024A. The preferred 2 k Ω range has the largest symbol. The open circuit voltage is less than 3.5V on the 2 k Ω range and less than 1.5V on all other ranges. When testing diodes in conjunction with the audio tone, use the 200 k Ω range.

NOTE

The 200 Ω , 20 k Ω , and 2000 k Ω ranges can be used for in-circuit resistance measurements.

2-38. Conductance (nS) Operation

2-39. Figure 2-9 shows operation for the conductance measurement function. To make conductance measurements, complete each of the steps listed in the figure sequentially, and comply with the warning. Siemens, the displayed units, is equal to 1/ Ω . For the resistance equivalent to the displayed value, refer to the conductance-to-resistance conversion material presented later in this section under Measurement Techniques.

2-40. Temperature ($^{\circ}$ C) Operation


WARNING

TO AVOID ELECTRICAL SHOCK, DO NOT USE THE THERMOCOUPLE ACCESSORIES WHEN VOLTAGES EXCEEDING 30V AC RMS OR 60V DC ARE PRESENT. THE PROBE TIP MAY BE ELECTRICALLY CONNECTED TO THE ACCESSORY OUTPUT TERMINALS.

2-41. Figure 2-10 describes operation for the temperature measurement function with the thermocouple accessories and with the John Fluke Model 80T-150 Temperature Probe. To find the Fahrenheit equivalent of the $^{\circ}$ C display, go to the Temperature Conversion portion of the Measurement Techniques material presented later in this section.

NOTE

Thermocouple connections must be made using approved isothermal connectors (such as the Y8104) and thermocouple wire that is the same type as the thermocouple. Failure to use these materials will result in erroneous temperature measurement.

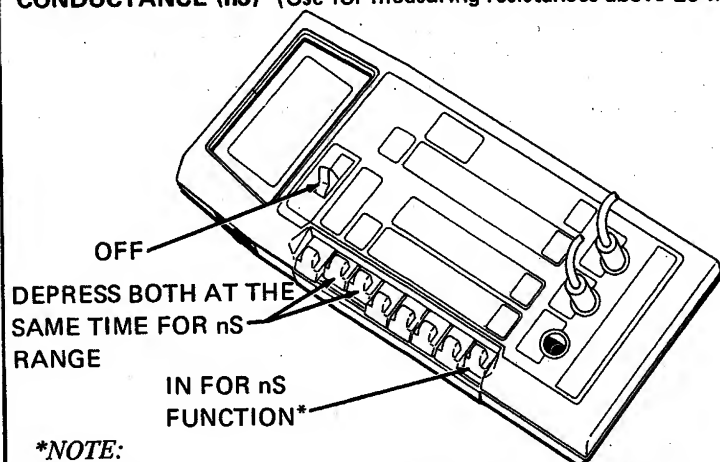CONDUCTANCE (nS) (Use for measuring resistances above 20 MΩ)***NOTE:**

The PEAK-HOLD switch and Function switches are push-push type. Operate these switches by pushing to the RIGHT ► only! Do not push or pull these switches to the left (out or off) positions.

- Connect the test leads as shown.
- Depress the mA-°C-V-kΩ-nS function switch.
- AT THE SAME TIME, depress both of the grey nS range switches.
- Insure that all other switches are at the out or OFF positions.
- Insure that the device being measured contains no electrical energy.

WARNING


TO AVOID ELECTRICAL SHOCK AND/OR INSTRUMENT DAMAGE, DO NOT CONNECT THE 8024A TERMINALS TO SOURCES THAT EXCEED THE FOLLOWING LIMITS WHEN MEASURING CONDUCTANCE:

COMMON: 500V DC OR AC RMS WITH RESPECT TO EARTH GROUND.

V-kΩ-nS: 500V DC OR AC RMS WITH RESPECT TO THE COMMON TERMINAL.

- Connect the test leads across the device being measured (connect the red test lead to the + end of polarized capacitors for leakage measurements).
- Read the measured value in the display.
- See Measurement Techniques section for Conductance-Resistance Conversion chart.

Figure 2-9. Conductance Operation

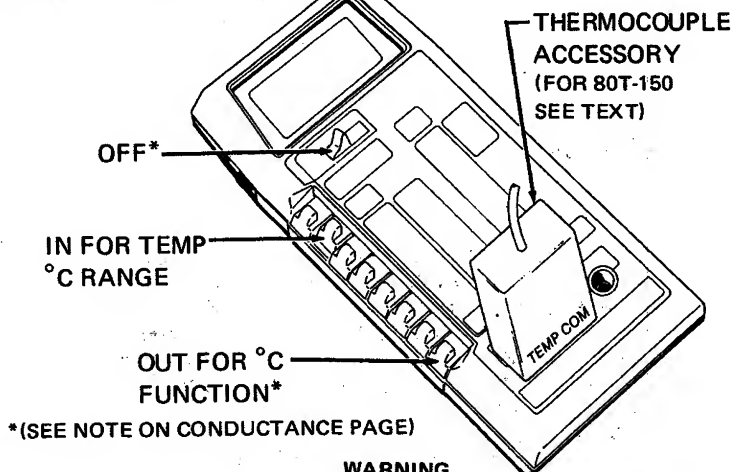TEMPERATURE (°C)**WARNING**

TO AVOID ELECTRICAL SHOCK AND/OR INSTRUMENT DAMAGE,
DO NOT EXCEED THE MAXIMUM VOLTAGE AND TEMPERATURE
LIMITS FOR THE ACCESSORY USED.

John Fluke Thermocouple ACCESSORIES

- Connect the thermocouple termination across the mA-°C and Common terminals with the TEMP side plugged into the mA-°C terminal,
- Depress the grey TEMP °C range switch.
- Insure that all other switches are at the out or OFF positions.
- Read the measured value in the display. See Measurement Technique section for °F conversion.
- If unit fails to function properly, see FUSE CHECK para. 2-17.

John Fluke 80T-150 ACCESSORY

- Connect the 80T-150 termination across the V-kΩ-nS and COMMON terminals with the HI side plugged into the V-kΩ-nS terminal.
- Select the appropriate range (200 mV or 2V).
- Insure that all other switches are at the out or OFF positions.
- Set the 80T-150 POWER switch to the ON position and read the display in units indicated on the accessory label.

Figure 2-10. Temperature Operation

2-42. Not all applications for temperature measurement use just one thermocouple. The applications material at the end of this section describes how to use your 8024A to sequentially measure different thermocouples of the same type. Your 8024A is intended for use with K-type thermocouples. If you use another type of thermocouple, the measurement will be in error. See the Temperature Measurement Techniques material presented later in this section.

2-43. Level Detector Operation

WARNING

TO AVOID ELECTRICAL SHOCK AND/OR INSTRUMENT DAMAGE, DO NOT CONNECT THE 8024A TERMINALS TO SOURCES THAT EXCEED THE FOLLOWING LIMITS WHEN USING THE LEVEL DETECTOR FUNCTION:

COMMON: 500V DC OR 500V AC RMS WITH RESPECT TO EARTH GROUND.

V/k Ω /nS: 500V DC OR 500V AC RMS WITH RESPECT TO THE COMMON TERMINAL.

2-44. Use the level detector function for sensing logic levels and other active signals less than 250V dc or ac rms in amplitude. Select the 200 k Ω range and the k Ω function. The 200 k Ω range is marked with a step function symbol (\square) on the front panel of your 8024A to indicate its use in the level detector function. The level detector compares the input signal to a +0.8V (nominal) reference. There is both audible and visual indication of the results of the comparison. The audible indication is a 2 kHz tone that can be enabled by depressing the AC/DC switch or disabled by releasing the AC/DC switch. The visual indication is an up and/or down arrow that appears on the display above and/or below the minus sign position. Figure 2-11 shows the indications for some typical input signals. Starting from left to right:

1. The level is above the +0.8V reference so the \blacktriangle up arrow appears in the display and the audible tone does not sound.
2. The input level is below the +0.8V reference, but above 0V. The audible tone sounds and the \blacktriangledown down arrow appears in the display but the minus sign is absent.
3. The input level is below both the +0.8V reference and 0V. The \blacktriangledown down arrow appears, the tone is audible, and the minus sign appears.
4. The input signal is very near 0V. The \blacktriangledown down arrow appears, the audible tone sounds, and the minus sign flickers off and on.
5. The input is a train of pulses that pass above +0.8V but whose average value is positive. Each time a pulse goes above +0.8V, the \blacktriangle up arrow appears and the audible tone is silent. Each time the pulse goes below +0.8V, the \blacktriangledown down arrow appears and the audible tone sounds. The minus sign does not appear. For a fast Pulse Train, both arrows will be on.

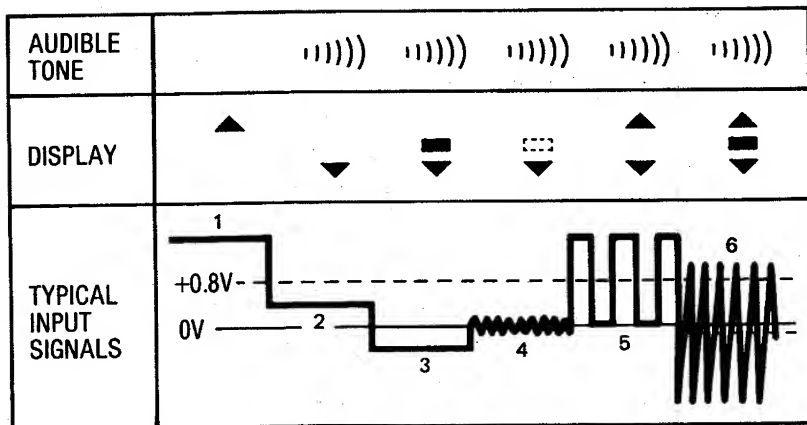


Figure 2-11. Level Detector Operation

6. The input signal is a sine wave whose positive peaks pass above $+0.8\text{V}$ but whose average value is negative. The audible tone and arrows behave as described in step 5 and the minus sign appears in the display.

7. For short pulses, your 8024A has a pulse stretcher circuit that captures and holds the pulses long enough for the display and tone to respond, typically for 100 ms. The input impedance of the level detector is $>100\text{ k}\Omega$ so as not to load logic circuits. The level detector is also usable on the $2\text{ k}\Omega$ range. On this range, the reference level is $+0.4\text{V}$ nominal. See Measurement Techniques for additional information.

2-45. Peak Hold Operation

CAUTION

The PEAK HOLD switch is a push-push type. Operate this switch by pushing to the right only. Do not push or pull the switch to the left (off).

2-46. The peak hold function provides short term memory of the most positive dc or ac rms level (Figure 2-12). The peak hold function is intended to be used for voltage and current measurements. Proceed with the steps of operation for the measurement function being used with the peak hold function. When the test leads have been connected to the circuit to be measured, set the PEAK HOLD switch to ON. For a new reading, set the PEAK HOLD switch to OFF then back to ON. To read negative peak signals, reverse the test connections. An example peak hold operation would be as follows:

1. Set the PEAK HOLD switch to OFF.
2. Select the DC, V (volts) functions.

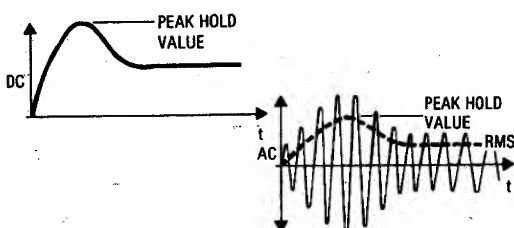


Figure 2-12. Peak Hold Operation

3. Insert the red test lead into the V/k Ω /nS input, and select the 20V range.
4. Locate the battery eliminator connector on the right side of the unit.
5. Measure the voltage on the side contact (bottom of hole) of the connector (approximately +2.90V).
6. Set the PEAK HOLD switch to ON and momentarily touch the test lead to the side contact.
7. The reading should be the same as step 5, within a few digits.
8. False readings may result if the range or function switches are changed while the PEAK HOLD switch is set to ON. To avoid these errors, reset the PEAK HOLD circuit after each range or function change.
9. Static electricity and noise pickup may cause errors when using the PEAK HOLD function. While the PEAK HOLD switch is ON, avoid touching the probe tips to fingers or other objects which may contain a static charge. The potential for noise pickup is worst whenever the test leads are open circuited. This is particularly true on the 200 mV, 2V and 2 mA ranges. Refer to AC/DC current measurement section of MEASUREMENT TECHNIQUES for additional information.

NOTE

For DC voltages and currents, the peak hold function measures the "most positive" value of the input waveform. If the "most positive" excursion of the waveform is negative with respect to common, a negative sign will be displayed; i.e., when a negative sign is displayed, the measured value is not the negative peak, but is, instead the least negative (or most positive) portion of the applied waveform.

10. PEAK HOLD accuracy may be affected by mechanical shock. If your 8024A has suffered mechanical shock during a peak measurement, reset the PEAK HOLD circuit and repeat the measurement.

2-47. INITIAL CHECK-OUT PROCEDURE

2-48. Now that you have installed the battery, and know where everything is and how it works, let's make sure that the unit is working properly. We'll run through a simple check-out procedure starting with turn-on. No equipment other than test leads will be required. If a problem is encountered, please check battery, fuse, switch setting, and test lead connection before contacting your nearest John Fluke Service Center.

NOTE

This procedure is intended to verify overall instrument operation, and is not meant as a substitute for the formal Performance Tests given in Section 4. Limits shown exceed the specifications because the procedure uses one measurement to check another.

1. Set the POWER switch to OFF and all range and function switches to the released (out) position.
2. Set the POWER switch to ON and observe the display. It should read between -00.1 and 00.1.
3. Connect the red test lead to the V/k Ω /nS input terminal. Depress k Ω function switch to select k Ω function.
4. Touch the red probe tip to the COMMON input terminal, and sequentially depress each of the six grey range switches starting at the top (20 M Ω). The display should read zero ± 1 digit and the decimal point should be positioned as follows:
 - a. 20 M Ω - 0.00
 - b. 2000 k Ω - 000
 - c. 200 k Ω - 00.0
 - d. 20 k Ω - 0.00
 - e. 2 k Ω - .000
 - f. 200 Ω - 00.0
5. Press the 20V range switch and remove the probe from the COMMON input terminal. Release function switch to select volts function.
6. Look inside of the battery eliminator connector on the right side of the 8024A and locate the connector contacts.
7. Touch the red probe to the center post of the battery eliminator connector. The display should read approximately -6.1V dc. (Note: this voltage varies with condition and type of battery.)
8. Touch the probe tip to the side contact of the battery eliminator connector located at the bottom of the hole. The display should read approximately 2.9V dc. Notice that the sum of the two readings is equal to the battery voltage (typically 8 to 10V dc). Remove the probe from the battery eliminator connector.

9. Depress the $k\Omega$ function switch and the AC/DC switch. The ▲ up arrow will appear in the display. Sequentially depress each of the six range switches. The display will indicate an overrange condition and the decimal point will change position.

10. Touch the red probe tip to the COMMON input terminal, the audible tone will sound and the ▼ down arrow will appear in the display. Sequentially depress each of the grey range switches. The display should read zero at each range setting. Lead resistance may be sufficient to cause a one or two tenths (0.1 or 0.2 Ω) indication on the 200 Ω range. Release the AC/DC switch to silence the audio tone.

11. Touch the red probe tip to the mA-°C input connector and press the 200 Ω switch. The display should read 99.0 to 101.0.

12. Press the 2 $k\Omega$ switch. The display should read .099 to .101. Remove the probe from the mA-°C input connector.

13. Simultaneously depress the two range switches to select the 200 nS range. The display should read 00.0 to 01.0 (minimum conductance, maximum resistance).

14. Touch the red probe tip to the COMMON input terminal. An overrange indication should be displayed since conductance is the reciprocal of resistance.

15. Connect the black test lead to the COMMON input connector.

16. Depress both the AC/DC switch and the 200V ac range switch. Set the function switch to the voltage (out) position. (Use 750V range for 230V line.)

WARNING

THE LOCAL LINE VOLTAGE IS MEASURED IN THE FOLLOWING STEP. BE CAREFUL NOT TO TOUCH THE PROBE TIPS WITH FINGERS, OR TO ALLOW THE PROBE TIPS TO CONTACT EACH OTHER.

17. Measure the local ac line voltage at a convenient output receptacle.

18. Set the PEAK HOLD switch to the ON position. The value of the line voltage will be locked on the display. The display value should decay no faster than 1 digit per second. Set the PEAK HOLD switch to the OFF position.

19. Remove the test leads from the line power receptacle and set PEAK HOLD to OFF, function to DC, PEAK HOLD to ON, and reinsert probes, observe 1.41 X ac voltage. (This is the instantaneous peak of a single half wave of line voltage.) Set PEAK HOLD to OFF.

20. Select the 200 $k\Omega$ range, depress the $k\Omega$ function switch (level detector), and depress the AC/DC switch (to enable the audible tone).

21. Connect the test leads to the line voltage receptacle. You will hear the audible tone modulated by the line frequency and see both arrows displayed.
22. Remove the test leads from the line power receptacle.
23. If your 8024A has responded properly to this point, it's operational and ready for use.

2-49. MEASUREMENT TECHNIQUES

2-50. The following paragraphs offer you techniques that can improve the accuracy of measurements made with your 8024A. While most of these techniques are in general use throughout the electronics industry, these paragraphs offer specific information for use with your 8024A. (Figure 2-13 presents a temperature correction factor for K-type Thermocouples.) Use this chart for accuracy enhancement above 300°C.

2-51. Temperature Conversion

2-52. The temperature measurements made with your 8024A are displayed in °C. To find the equivalent temperature in °F, either use the conversion tables in Table 2-3 or the formula: $1.8 (°C) + 32° = °F$.

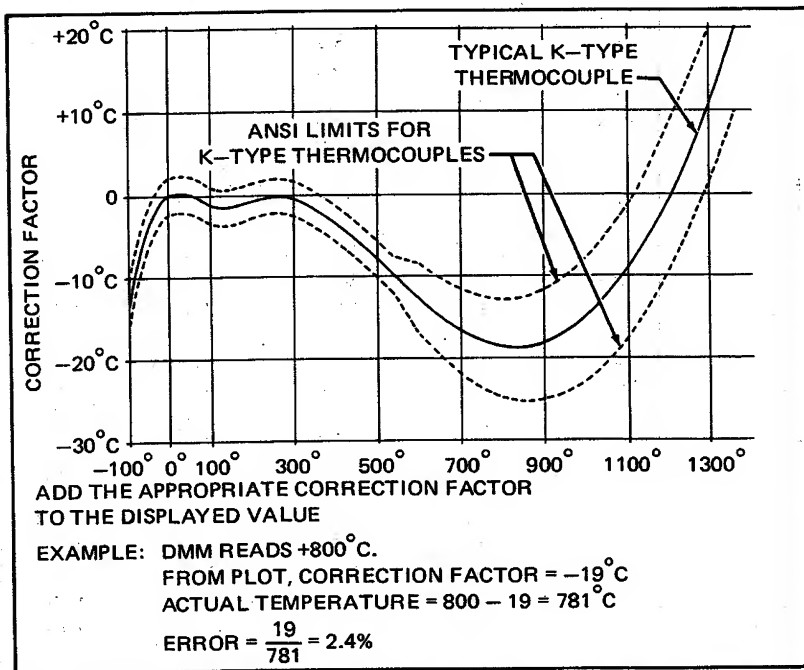


Figure 2-13. Temperature Correction Factor for K-Type Thermocouples

Table 2-3. Centigrade-to-Fahrenheit Conversion Scale

°C	°F	°C	°F	°C	°F
-40	-40.0	5	41.0	40	104.0
-38	-36.4	6	42.8	41	105.8
-36	-32.8	7	44.6	42	107.6
-34	-29.2	8	46.4	43	109.4
-32	-25.6	9	48.2	44	111.2
-30	-22.0	10	50.0	45	113.0
-28	-18.4	11	51.8	46	114.8
-26	-14.8	12	53.6	47	116.6
-24	-11.2	13	55.4	48	118.4
-22	-7.6	14	57.2	49	120.2
-20	-4.0	15	59.0	50	122.0
-19	-2.2	16	60.8	55	131.0
-18	-0.4	17	62.6	60	140.0
-17	1.4	18	64.4	65	149.0
-16	3.2	19	66.2	70	158.0
-15	5.0	20	68.0	75	167.0
-14	6.8	21	69.8	80	176.0
-13	8.6	22	71.6	85	185.0
-12	10.4	23	73.4	90	194.0
-11	12.2	24	75.2	95	203.0
-10	14.0	25	77.0	100	212.0
-9	15.8	26	78.8	105	221.0
-8	17.6	27	80.6	110	230.0
-7	19.4	28	82.4	115	239.0
-6	21.2	29	84.2	120	248.0
-5	23.0	30	86.0	125	257.0
-4	24.8	31	87.8	130	266.0
-3	26.6	32	89.6	135	275.0
-2	28.4	33	91.4	140	284.0
-1	30.2	34	93.2	145	293.0
0	32.0	35	95.0	150	302.0
1	33.8	36	96.8	155	311.0
2	35.6	37	98.6	160	320.0
3	37.4	38	100.4	165	329.0
4	39.2	39	102.2	170	338.0

Table 2-3. Centigrade-to-Fahrenheit Conversion Scale (cont)

°C	°F	°C	°F	°C	°F
175	347	350	662	750	1382
180	356	355	671	800	1472
185	365	360	680	850	1562
190	374	365	689	900	1652
195	383	370	698	950	1742
200	392	375	707		
205	401	380	716		
210	410	385	725		
215	419	390	734		
220	428	395	743		
225	437	400	752		
230	448	405	761		
235	455	410	770		
240	464	415	779		
245	473	420	788		
250	482	425	797		
255	491	430	806		
260	500	435	815		
265	509	440	824		
270	518	445	833		
275	527	450	842		
280	536	455	851		
285	545	460	860		
290	554	465	869		
295	563	470	878		
300	572	475	887		
305	581	480	896		
310	590	485	905		
315	599	490	914		
320	608	495	923		
325	617	500	932		
330	626	550	1022		
335	635	600	1112		
340	644	650	1202		
345	653	700	1292		

2-53. Conductance-to-Resistance Conversion

2-54. The conductance measurement function of your 8024A displays in siemens. To convert siemens to ohms, use either the conversion scale and interpolation table in Figure 2-14 or the formula: $\text{siemens} = 1/\Omega$.

2-55. AC Measurements

2-56. The ac ranges of the 8024A employ an average responding ac converter. This means that the unit measures the average value of the input, and displays it as an equivalent rms value for a sine wave. As a result, measurement errors are introduced when the input wave form is distorted (non-sinusoidal). The amount of error depends upon the amount of distortion. Figure 2-15 shows the relationship between sine, square, and triangular waveforms, and the required conversion factors.

2-57. AC/DC Voltage Measurements

2-58. The 8024A is equipped with five ac and five dc voltage ranges; 200 mV, 2V, 20V, 200V, 750V ac/1000V dc. All ranges present an input impedance of 10 M Ω . On the ac ranges, this is shunted by less than 100 pF. When making measurements, be careful not to exceed the overload limits given earlier in Table 2-2.

2-59. Measurement errors due to circuit loading can result when making either ac or dc voltage measurements on circuits with high source resistance. However, in most cases the error is negligible ($\leq 0.1\%$) as long as the source resistance of the measurement circuit is 10 k Ω or less. If the circuit does present a problem, the percentage of error can be calculated using the appropriate formula in Figure 2-16.


2-60. AC/DC Current Measurements

WARNING

INSTRUMENT DAMAGE AND OPERATOR INJURY MAY RESULT IF THE FUSE BLOWS WHILE CURRENT IS BEING MEASURED IN A CIRCUIT WHICH EXHIBITS AN OPEN CIRCUIT VOLTAGE GREATER THAN 600V. DO NOT ATTEMPT IN-CIRCUIT CURRENT MEASUREMENT WHERE THE POTENTIAL IS GREATER THAN 600V DC OR AC RMS.

2-61. Four ac and four dc current ranges are included on the 8024A; 2 mA, 20 mA, 200 mA, and 2000 mA. Each range is diode protected to 2 amps and fuse protected above 2 amps. If the fuse blows, refer to fuse replacement information given earlier in this section.

2-62. In high electrical noise environments (near ignition switches, fluorescent lights relay switches, etc.) unstable or erroneous readings (exceeding specifications) may occur. The effect is most obvious when measuring low level current on the 2 mA range. If an erratic or erroneous reading is suspected, temporarily jumper the V/k Ω /nS connector to the mA connector. This will ensure an accurate measurement. Remove this temporary jumper when the measurement has been completed.

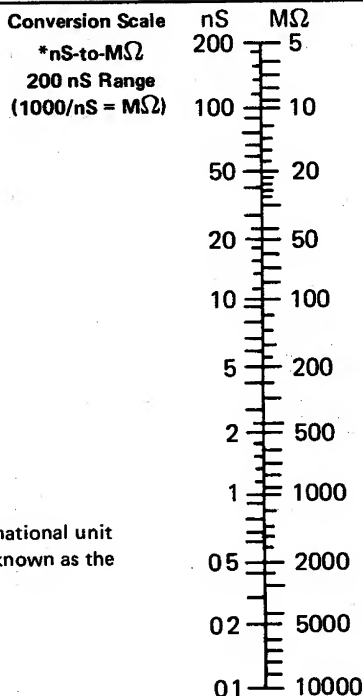

*S = siemens = $1/\Omega$ = International unit
 of conductance formerly known as the
 mho.

Find the approximate resistance value using the scale above. Then, on the table below, locate the most significant digit of the display reading on the vertical NO. column, and the next digit on the horizontal NO. row. The number at the intersecting coordinates represents the unknown resistance value. For example, a reading of 52.0 nS is equal to 19.2 M Ω . Decimal point location is determined from the scale approximation.

Interpolation Table (I/no.)

NO.	.0	.1	.2	.3	.4	.5	.6	.7	.8	.9
1	1	.909	.833	.769	.714	.667	.625	.588	.556	.526
2	.500	.476	.455	.435	.417	.400	.385	.370	.375	.345
3	.333	.323	.313	.303	.294	.286	.278	.270	.263	.256
4	.250	.244	.238	.233	.227	.222	.217	.213	.208	.204
5	.200	.196	.192	.187	.185	.182	.179	.175	.172	.169
6	.167	.164	.161	.159	.156	.154	.152	.149	.147	.145
7	.143	.141	.139	.137	.135	.133	.132	.130	.128	.127
8	.125	.123	.122	.121	.119	.118	.116	.115	.114	.112
9	.111	.110	.109	.108	.106	.105	.104	.103	.102	.101

Figure 2-14. Conductance-to-Resistance Conversion

 
 
 
 

 
 
AC-COUPLED INPUT WAVEFORM	PEAK VOLTAGES		8024A METERED VOLTAGES		AC + DC TOTAL RMS
	PK-PK	1.0-PK	AC COMPONENT ONLY	DC COMPONENT ONLY	TRUE RMS = $\sqrt{(ac)^2 + (dc)^2}$
SINE 	2.828	1.414	1.000	0.000	1.000
RECTIFIED SINE (FULL WAVE) 	1.414	1.414	0.421	0.900	1.000
RECTIFIED SINE (HALF WAVE) 	2.000	2.000	0.764	0.636	1.000
SQUARE 	2.000	1.000	1.110	0.000	1.000
RECTIFIED SQUARE 	1.414	1.414	0.785	0.707	1.000
RECTANGULAR PULSE  $D = X/Y$ $K = \sqrt{1 - D^2}$	2.000	2.000	2.22K	2D	$2\sqrt{D}$
TRIANGLE SAWTOOTH 	3.464	1.732	0.960	0.000	1.000

Figure 2-15. Waveform Conversion

1. DC VOLTAGE MEASUREMENTS

$$\text{Loading Error in \%} = 100 \times \frac{R_s}{R_s + 10^7}$$

Where: R_s = Source resistance in ohms of circuit being measured.

2. AC VOLTAGE MEASUREMENTS

First, determine input impedance, as follows:*

$$Z_{in} = \frac{10^7}{\sqrt{1 + (2\pi \cdot F \cdot R_{in} \cdot C)^2}}$$

Where: Z_{in} = effective input impedance

$R_{in} = 10^7$ ohms

$C_{in} = 100 \times 10^{-12}$ Farads

F = frequency in Hz

Then, determine source loading error as follows:*

$$\text{Loading Error in \%} = 100 \times \frac{Z_s}{Z_s + Z_{in}}$$

Where: Z_s = source impedance

Z_{in} = input impedance (calculated)


*Vector algebra required

Figure 2-16. Voltage Measurement Error Calculations

CAUTION

To avoid possible instrument damage and/or erroneous measurements, remove the temporary V/k Ω /nS-to-mA jumper before attempting voltage or resistance measurements.

2-63. Full-scale burden voltage (voltage drop across the input terminals) for all ranges except 2000 mA is less than 250 mV. The 2000 mA range has full-scale burden voltage of less than 700 mV. This voltage drop can affect the accuracy of a current measurement if the current is unregulated and the DMM resistance represents a significant portion (1/1000 or more) of the source resistance. If burden voltage does present a problem, the percentage of error can be calculated using the formula in Figure 2-17. This error can be minimized by using the highest current range that gives the necessary resolution. For example, if 20 mA is measured on the 2000 mA range the burden voltage is approximately 5 mV.

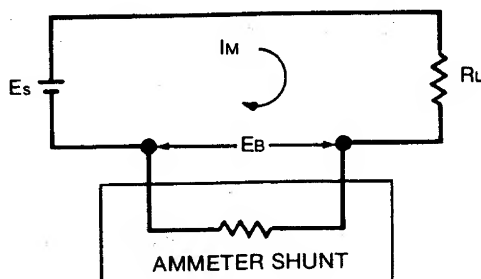

E_S = Source voltage

R_L = Load resistance + Source resistance

I_M = Measured current (display reading in mA)

E_B = Burden voltage (calculated), i.e., Display reading expressed as a % of full-scale (100 x READING FULL-SCALE) times full-scale burden voltage for selected range. See Table.

RANGE	MAXIMUM BURDEN VOLTAGE
2 mA to 200 mA	0.25V
2000 mA	0.9V

Maximum current error due to Burden Voltage

$$IN \% = 100 \times \frac{E_B}{E_S - E_B}$$

$$IN \text{ mA} = \frac{E_B \times I_M}{E_S - E_B}$$

Example: $E_S = 14V$, $R_L = 9\Omega$, $I_M = 1497 \text{ mA}$,

$$E_B = 100 \times \frac{1497}{2000} \times 0.9 \text{ (from Table)} =$$

$$74.9\% \text{ of } 0.9 = 0.674V$$

$$\text{Maximum error in \%} = 100 \frac{.674}{14 - .674} = 100 \frac{.674}{13.48} = 5.06\%$$

Increase displayed current by 5.06% to obtain true current.

$$\text{Maximum error in amps} = \frac{.524 \times 1497}{14 - .674} = \frac{784}{13.326} = 74 \text{ mA}$$

Increase displayed current by 74 mA to obtain true current.

Figure 2-17. Current Measurement Calculations

2-64. Resistance Measurements

2-65. Six direct reading resistance ranges are provided on the 8024A; 20 M Ω , 2000 k Ω , 200 k Ω , 20 k Ω , 2 k Ω , and 200 Ω . All ranges employ a two wire measurement technique. As a result, test lead resistance may influence measurement accuracy on the 200 Ω range. To determine the error, short the test leads together and read the lead resistance. Correct the measurement by subtracting the lead resistance from the unknown reading. The error is generally on the order of 0.2 to 0.3 ohms for a standard pair of test leads.

2-66. The three resistance ranges with a diode symbol above the range value have a high enough open circuit voltage to turn a silicon junction on. These ranges - 2 k Ω , 200 k Ω , and 20 M Ω - can be used to check silicon diodes and transistors. The preferred 2 k Ω range is marked with the largest diode symbol. The ranges not marked with a diode symbol can be used to make in-circuit resistance measurements. Typical full scale voltage and short circuit current for each resistance range is given in Table 2-4. All values shown are referenced to the COMMON input terminal; i.e., the V/k Ω /nS terminal is positive.

NOTE

Any changes (greater than one or two digits) in apparent resistance when test leads are reversed may indicate either the presence of a diode junction or a voltage in the circuit.




CAUTION

Turn test circuit power off and discharge all capacitors before attempting in-circuit resistance measurements.

2-67. APPLICATIONS

2-68. The test applications described in the following paragraphs are suggested useful extensions of the 8024A measurement capabilities. However, they are not intended as the equivalent of manufacturer's recommended test methods. They are intended to provide repeatable and meaningful indications which will allow the operator to make sound judgments concerning the condition of the device tested; i.e. good, marginal, or defective.

Table 2-4. Voltage/Current Capability of Resistance Ranges

RANGE	FULL-SCALE VOLTAGE (TYPICAL)	SHORT CIRCUIT CURRENT (TYPICAL)
20 M Ω 	+800 mV	+0.12 μ A
2000 k Ω	+200 mV	+0.12 μ A
200 k Ω 	+800 mV	+12 μ A
20 k Ω	+200 mV	+12 μ A
2 k Ω 	+1.1V	+1.0 mA
200 Ω	+55 mV	+0.3 mA

2-69. Thermocouples

2-70. INTRODUCTION

2-71. In 1821, Seebeck found that when two dissimilar metals are connected at two junctions and the junctions are at different temperatures, a current will flow in the loop (Figure 2-18, Part A) and will continue to flow as long as there is a difference in temperature. This principle is used by your 8024A when making temperature measurements.

2-72. The K-type thermocouple that is used with your 8024A is made from two dissimilar metals, Chromel and Alumel. As long as the same two types of metal are used throughout the loop (Figure 2-18, Part B), there are still only two junctions. The copper conductors of your 8024A are different from both the Alumel and the Chromel (Figure 2-18, Part C) which would seem to add a third junction to the loop. But, remember there is no current or voltage in a thermocouple loop if both junctions are at the same temperature. The isothermal characteristics of the special termination unit for John Fluke thermocouples insures that the two junctions at your DMM are at the same temperature. This leaves the original circuit as shown in Figure 2-18, Part A. If you are going to connect your own K-type thermocouple, use a John Fluke Model Y8104A Thermocouple Termination Unit (See Section 6 for details).

2-73. MONITORING MORE THAN ONE THERMOCOUPLE

2-74. You can use your 8024A to monitor more than one thermocouple — even thermocouples that are permanently mounted in your system. If your present K-type thermocouples are permanently mounted in a system and have individual remote reading stations, you can attach your present K-type thermocouple quick-connect to a John Fluke Model Y8104 Thermocouple Termination Unit via K-type thermocouple wire (Figure 2-19). Then plug the Y8104 into your 8024A, and carry the meter and thermocouple quick-connect assembly from station to station reading the various temperatures. If your thermocouples are routed to a centralized point (Figure 2-20), use one or more John Fluke Model 2161A Multipoint Selectors. Connect the last 2161A to your 8024A via Y8104 Thermocouple Termination Unit and select the thermocouple(s) you want to read.

2-75. Leakage Tester

2-76. The 200 nS conductance range effectively extends the resistance measurement capability of the 8024A (up to 10,000 M Ω) to the point where it can be used to provide useful leakage measurements on passive components. For example, you can detect leaky capacitors, diodes, cables, connectors, printed circuit boards (pcbs), etc. In all cases, the test voltage is <5V dc.

2-77. Leakage testing on purely resistive components such as cables and pcbs is straightforward. Select the 200 nS range, install the test leads in the V/k Ω /nS and COMMON input terminals, connect the leads to the desired test points on the unit-under-test, and read leakage conductance. If an overrange occurs, select the resistance range that provides on-scale reading.

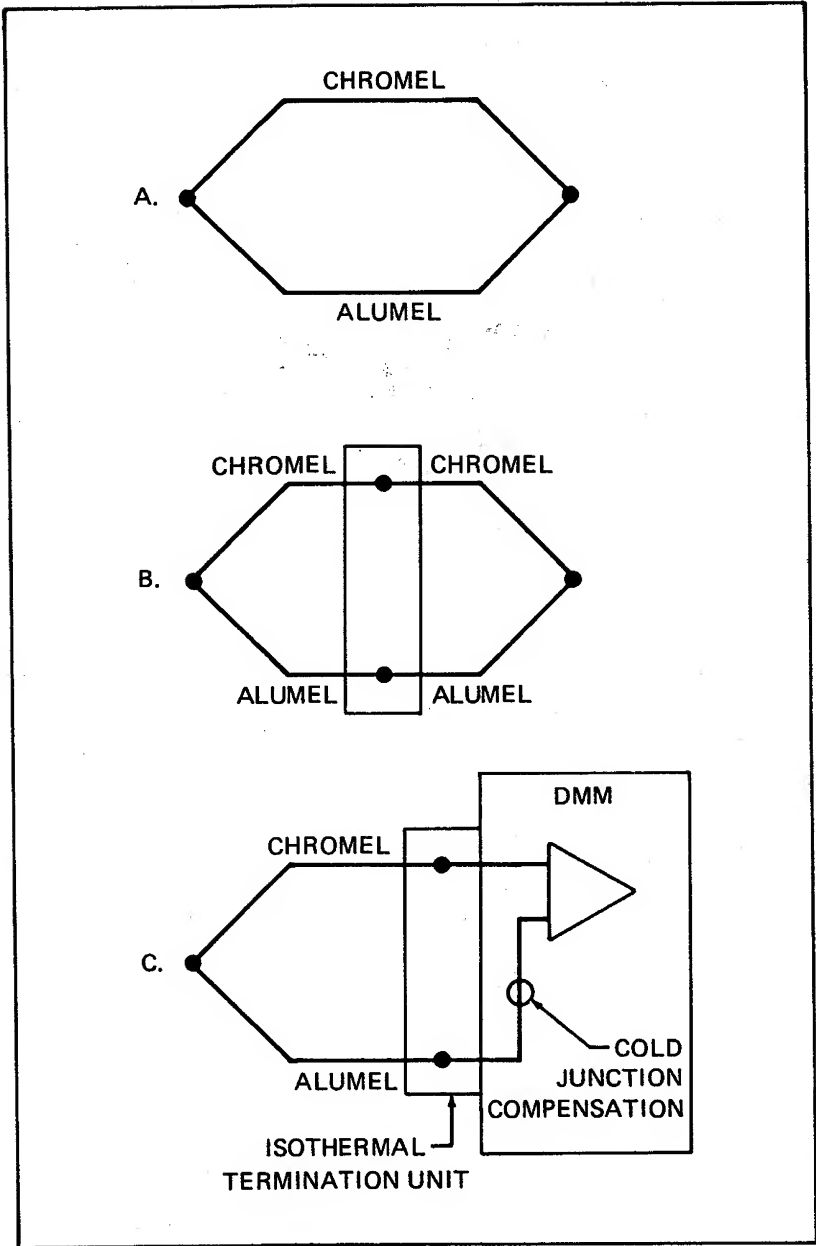


Figure 2-18. Thermocouples

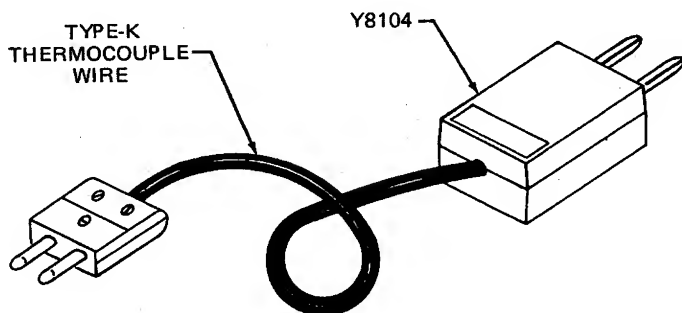


Figure 2-19. Thermocouple Termination Unit

NOTE

Under high humidity conditions (>80%) conductance measurements may be in error. To ensure accurate measurement, connect clean test leads to the 8024A and (with the leads open) read the residual leakage in nanosiemens. Correct subsequent measurements by subtracting the residual from the readings. (Fingerprints or other contamination on the pcb may also cause residual conductance readings.)

2-78. DIODES

2-79. Diode leakage (I_R) tests require that the diode junction be reverse biased when being measured. This is accomplished by connecting the diode's anode to the COMMON input terminal and its cathode to the V/k Ω /nS input terminal. Leakage can then be read in terms of conductance. In the event of an overrange, select the resistance range that provides on-scale reading.

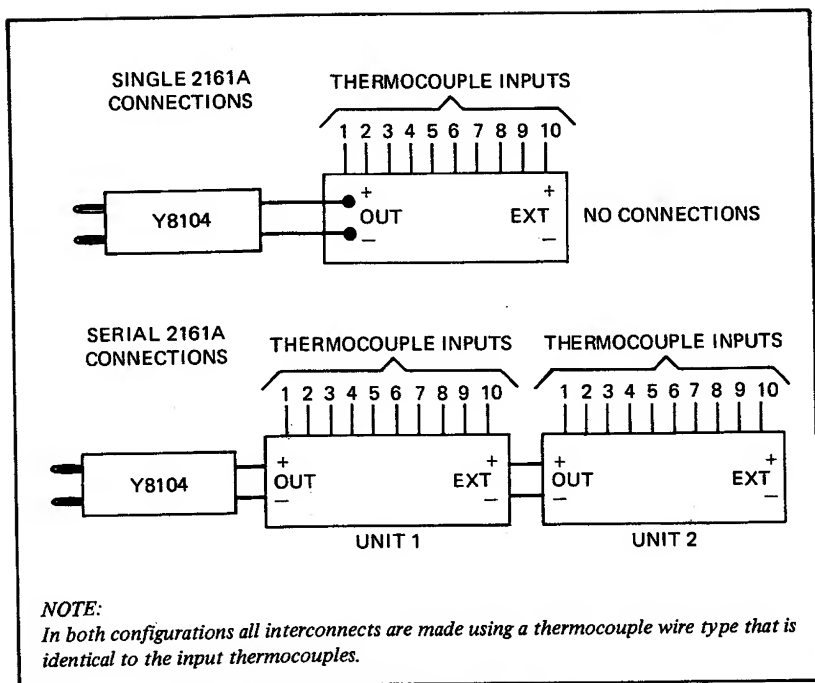


Figure 2-20. Multipoint Selection

Section 3**Theory of Operation****3-1. INTRODUCTION**

3-2. This section of the manual describes the theory of operation of your 8024A. The main features of your 8024A are presented first at an overall functional level. Then the operation of the a/d converter and each function of your 8024A is described in more detail. A detailed schematic of your 8024A can be found in Section 7.

3-3. OVERALL FUNCTIONAL DESCRIPTION

3-4. Figure 3-1 shows the major circuits of your 8024A arranged in a simplified functional block diagram. Input signals are routed by the range and function switches through the appropriate signal conditioners so that a dc analog signal that is proportional to the input signal is applied to the input of the a/d converter if the PEAK HOLD switch is at the OFF position. If the PEAK HOLD switch is at the ON position, the dc analog signal will be stored on a capacitor in the peak hold circuit which will drive the a/d converter with a dc voltage that is the same as the stored charge on the peak hold capacitor until the PEAK HOLD switch is set to the OFF Position. The a/d converter will drive the display to a digital display that is numerically the same as the proportional input signal. Decimal point position is determined by the range switch selected. When the $k\Omega$ function is selected, the input signal is also routed to the level detector circuit. The level detector circuit compares the input signal level to a +0.8V reference (200 $k\Omega$ range). If the signal is more positive than the reference, the level detector circuit will cause the \blacktriangle up arrow to be displayed (over the minus sign position). If the input signal is less positive than the reference, the level detector will cause the down arrow to be displayed (under the minus sign position). If the audible tone is enabled (AC/DC switch at the AC position) the level detector circuit will cause the audible tone to sound when the input signal is less positive than the reference.

3-5. A/D Converter

3-6. The entire analog-to-digital conversion process is accomplished by a single custom a/d converter and display driver IC, U8. The a/d converter employs the dual slope method of a/d conversion, and requires a series of external components to establish the

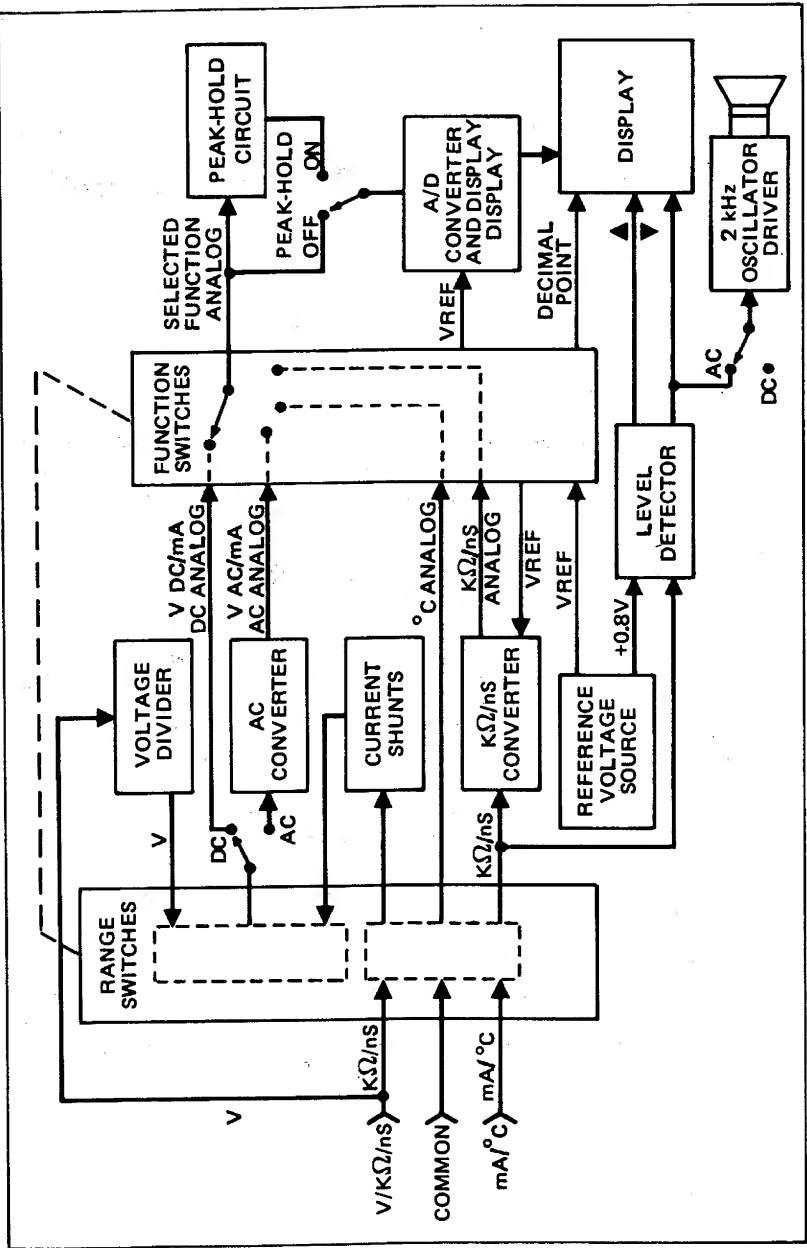


Figure 3-1. 8024A Block Diagram

basic timing and reference levels required for operation. These include an integrating capacitor, an autozero capacitor, and a flying capacitor (for applying a reference level of either polarity). Since the power consumed for display operation is very low, the a/d converter IC also contains the display latches, decoders, and drivers.

3-7. The digital control portion of the a/d converter process is an internal function of U8, and is keyed to the external crystal frequency. As a result, the conversion process is continuously repeated, and the display is updated at the end of every conversion cycle.

3-8. A simplified circuit diagram of the analog portion of the a/d converter is shown in Figure 3-2. Each of the switches shown represent analog gates that are operated by the digital section of the a/d converter. (Sheet 1 of Schematic also illustrates the a/d converter in a block form). Basic timing for switch operation and, therefore, a complete measurement cycle is shown in Figure 3-3.

3-9. Any given measurement cycle performed by the a/d converter can be divided into three consecutive time periods, autozero (AZ), integrate (INTEG), and read. Both autozero and integrate are fixed time periods whose lengths are multiples of the clock frequency. A counter determines the length of both time periods by providing an overflow at the end of every 10,000 clock pulses. The read period is a variable time which is proportional to the unknown input voltage. The value of the voltage is determined by counting the number of clock pulses that occur during the read period.

3-10. During autozero, a ground reference is applied as an input to the a/d converter. Under ideal conditions the output of the comparator would also go to zero. However, input-offset-voltage errors accumulate in the amplifier loop, and appear at the comparator output as an error voltage. This error is impressed across the AZ capacitor where it is stored for the remainder of the measurement cycle. The stored level is used to provide offset voltage correction during the integrate and read periods.

3-11. The integrate period begins at the end of the autozero period. As the period begins, the AZ switch opens and the INTEG switch closes. This applies the unknown input voltage to the input of the a/d converter. The voltage is buffered and passed on to the integrator to determine the charge rate (slope) on the INTEG capacitor. At the end of the fixed integrate period, the capacitor is charged to a level proportional to the unknown input voltage. This voltage is translated to a digital indication by discharging the capacitor at a fixed rate during the read period, and counting the number of clock pulses that occur before it returns to the original autozero level.

3-12. As the read period begins, the INTEG switch opens and the read switch closes. This applies a known reference voltage to the input of the a/d converter. The polarity of this voltage is automatically selected to be opposite that of the unknown input voltage, thus, causing the INTEG capacitor to discharge at a fixed rate (slope). When the charge is equal to the initial starting point (autozero level), the read period is ended. Since the discharge slope is fixed during the read period, the time required for discharge is proportional to the unknown input voltage.

3-13. The autozero period, and thus a new measurement cycle, begins at the end of the read period. At the same time the counter is released for operation by transferring its

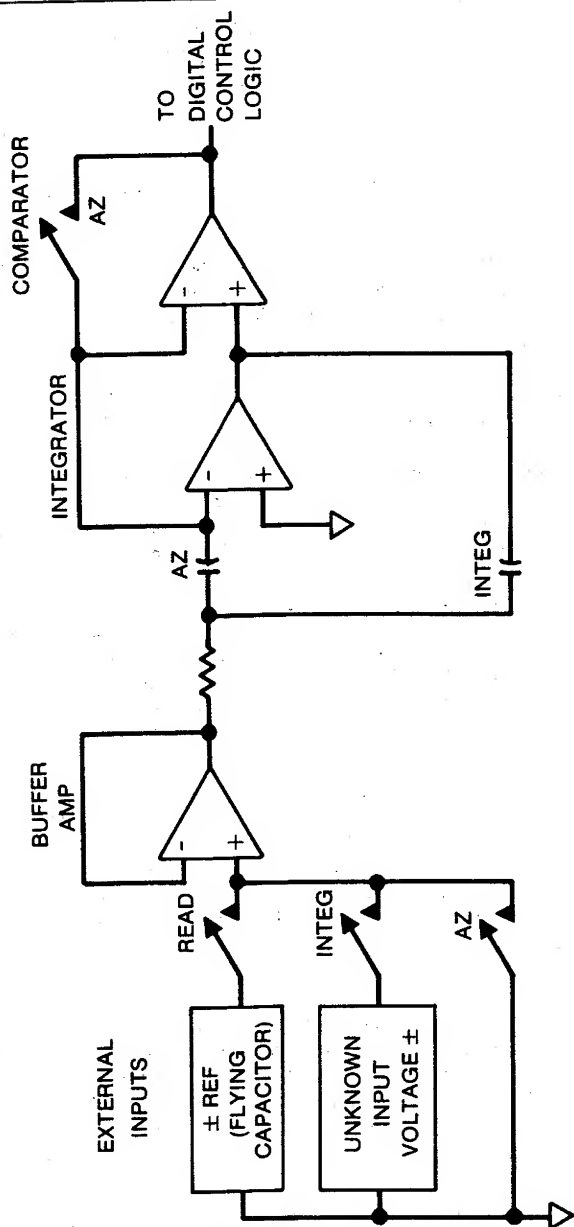


Figure 3-2. A/D Converter Functional Diagram

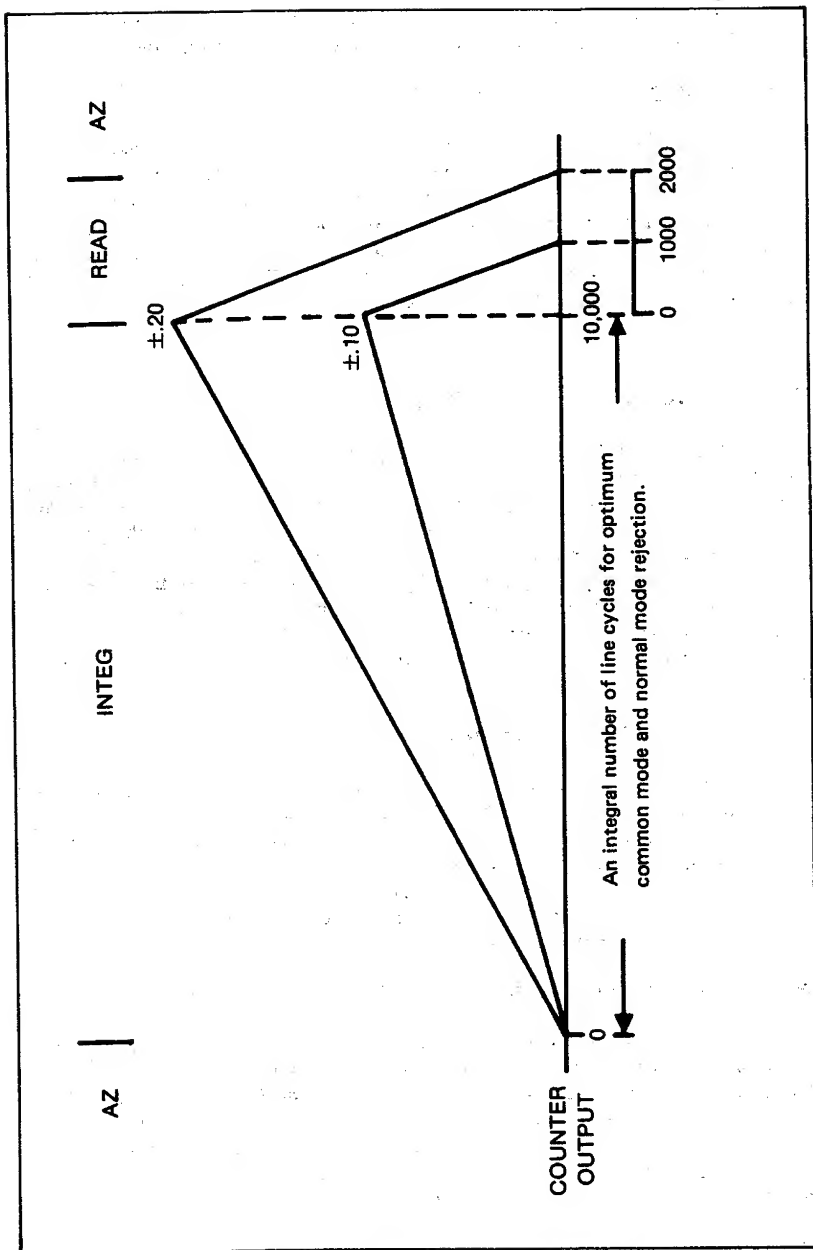


Figure 3-3. Integrate Capacitor Waveform

contents (previous measurement value) to a series of latches. This stored data is then decoded and buffered before being used for driving the liquid crystal display.

3-14. Voltage Measurement Function

3-15. Both ac and dc voltage measurement functions use an overvoltage protected 10 M Ω input divider to scale down the input voltage. Under normal conditions (assuming a dc input signal on the proper range) the divider output is a dc voltage that is directly proportional to the input signal level. If the AC function is selected, the output of the divider is ac coupled to an active full-wave rectifier whose dc output is calibrated to equal the rms level of the ac input (for sine wave inputs). If the PEAK HOLD switch is at the OFF position, the dc voltage from the divider or the ac converter is passed through a filter and applied to the a/d converter as the unknown input (Figure 3-4). Peak Hold operation will be covered later.

3-16. Current Measurement Function

3-17. Current measurements are made using a fuse protected, switchable, current shunt (0.1 Ω , 1 Ω , 10 Ω , or 100 Ω) to perform the current-to-voltage conversion required by the a/d converter (Figure 3-5). The voltage ($I R$) drop produced across the selected shunt may be either ac or dc. If the input current is dc and the DC function is selected, the $I R$ drop is passed through a low-pass filter, and presented as the unknown input to the a/d converter. However, if the input current is ac and the AC function is selected, the $I R$ drop is rectified by the ac converter. If the PEAK HOLD switch is at the OFF position, the dc signal from either the ac converter or the current shunt is routed through a filter to the a/d converter. This unknown input voltage to the a/d converter is proportional to the current passing through the current shunt.

3-18. Temperature ($^{\circ}\text{C}$) Measurement Function

3-19. As Figure 3-6 shows, the input from the thermocouple accessory is applied across the mA and COMMON terminals. If the PEAK HOLD switch is in the OFF position the input will be routed through a filter to the a/d converter unknown input. The COMMON terminal is thermally tied to the collector and base leads of transistor Q3. (This provides reference junction temperature compensation.) Q3 changes with temperature and provides an offset voltage to counter the thermocouple at the input jacks to ensure the integrity of the reading at the measurement end.

3-20. Resistance Measurement Function

3-21. Resistance measurements are made using a ratio technique as shown in Figure 3-7. When the k Ω function is selected, a simple series of circuits are formed by the internal reference voltage, a reference resistor from the voltage divider (selected by range switches), and the external unknown resistor. The ratio of the two resistors is equal to the ratio of their respective voltage drops. Therefore, since the value of one resistor is known, the value of the second can be determined by using the voltage drop across the known resistor as a reference. This determination is made directly by the a/d converter.

3-22. Overall operation of the a/d converter during a resistance measurement is basically as described earlier in this section, with one exception. The reference voltage present

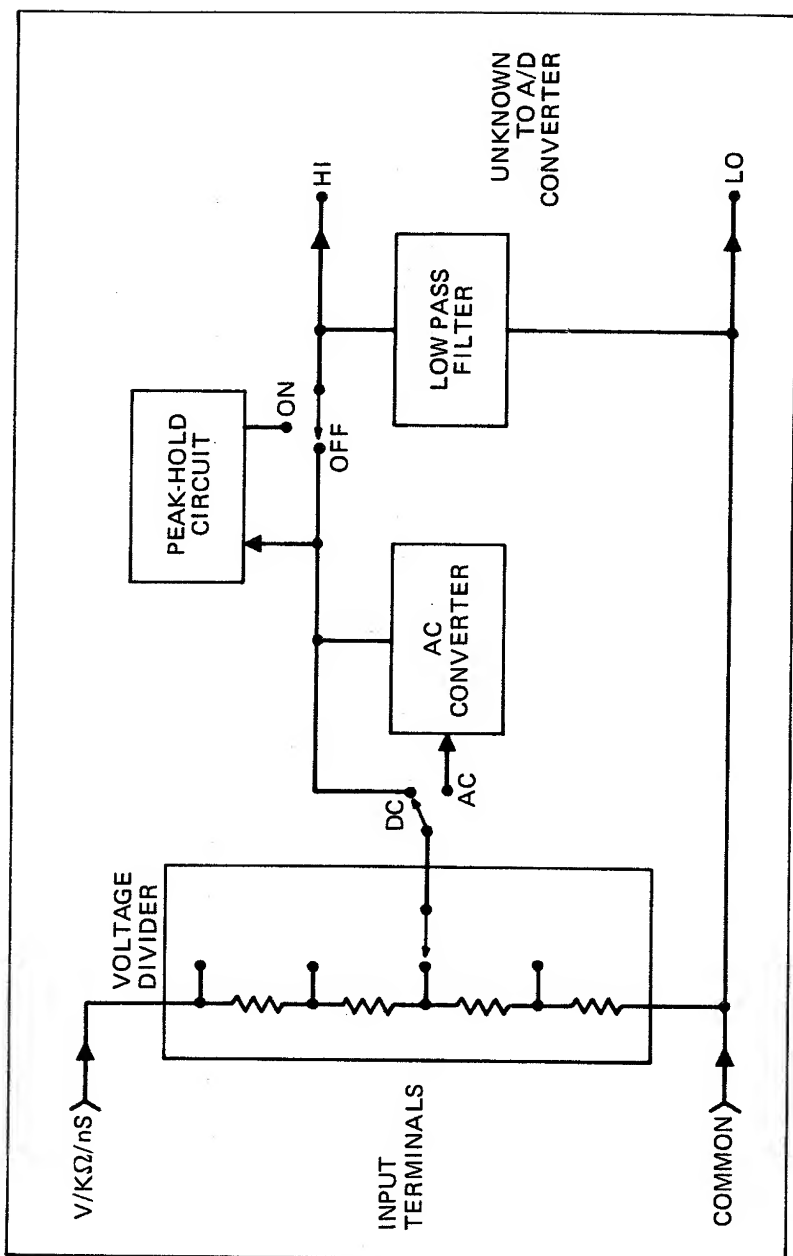


Figure 3-4. Voltage Measurement

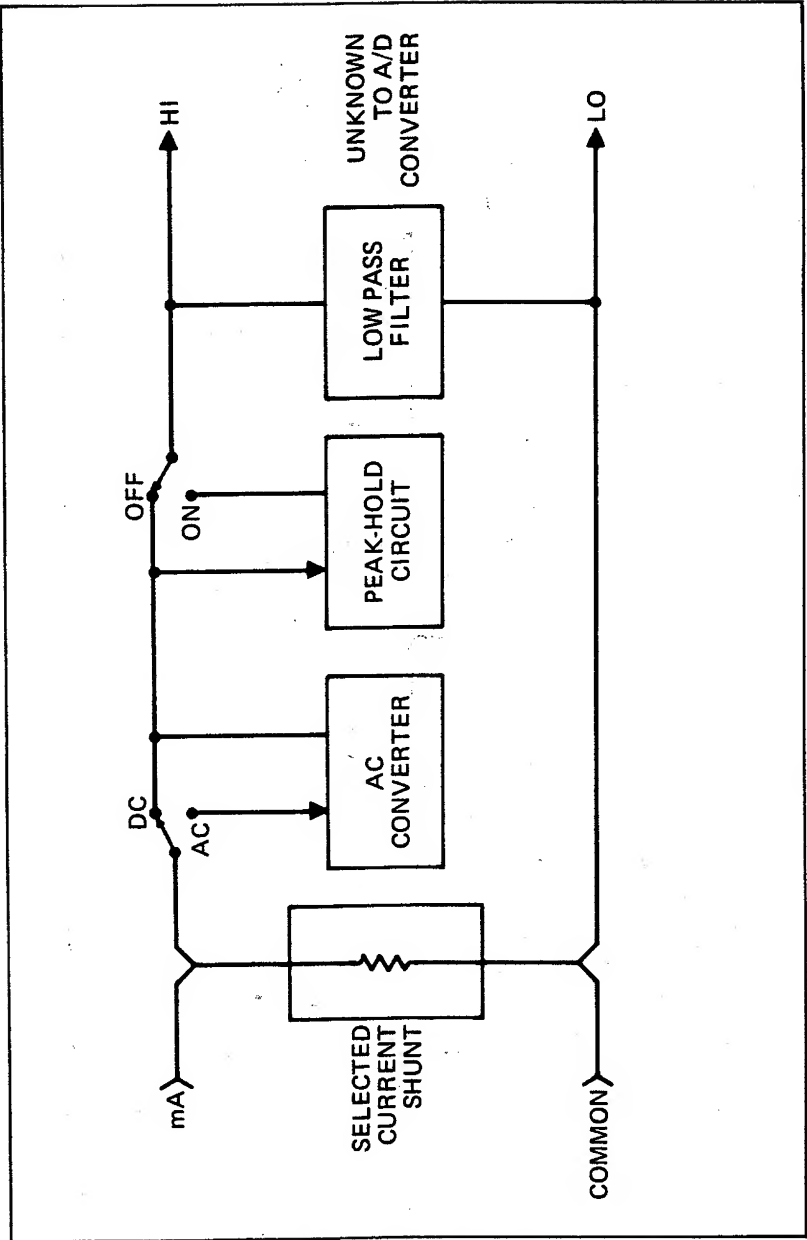


Figure 3-5. Current Measurement

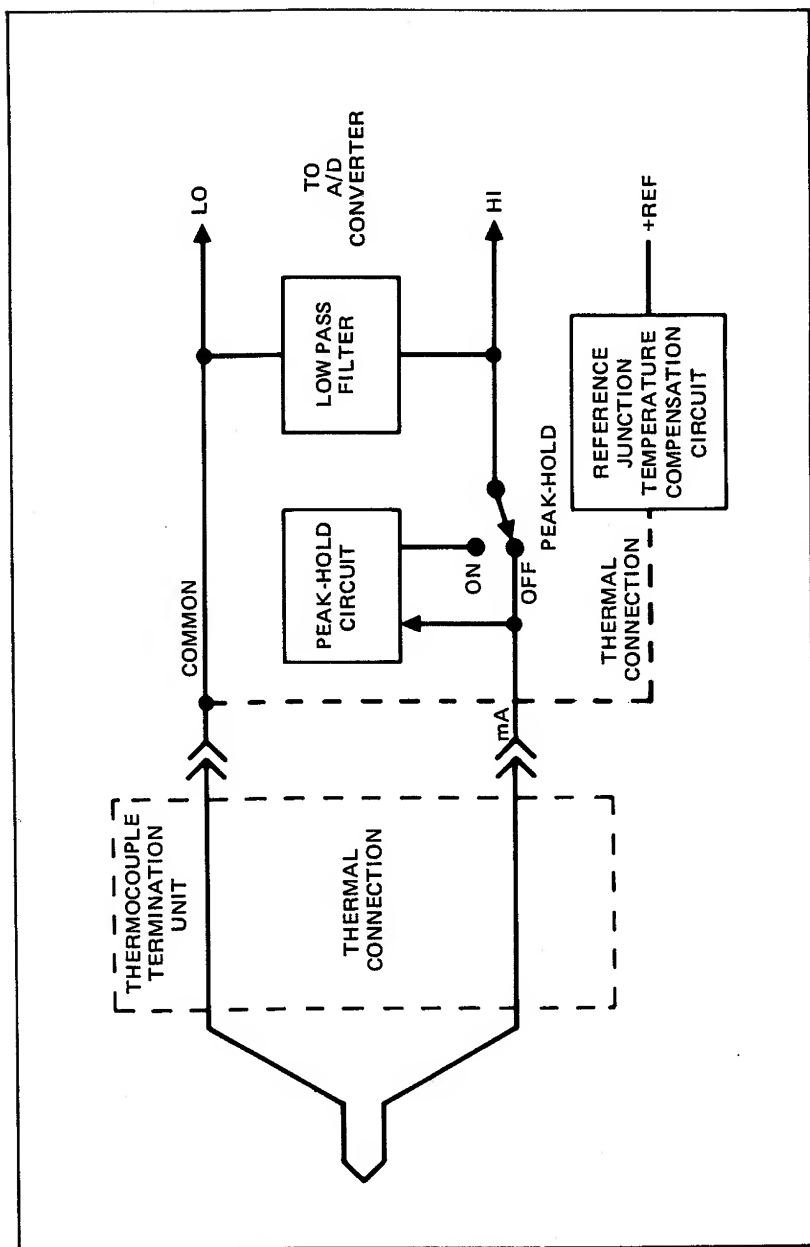


Figure 3-6. Temperature Measurement

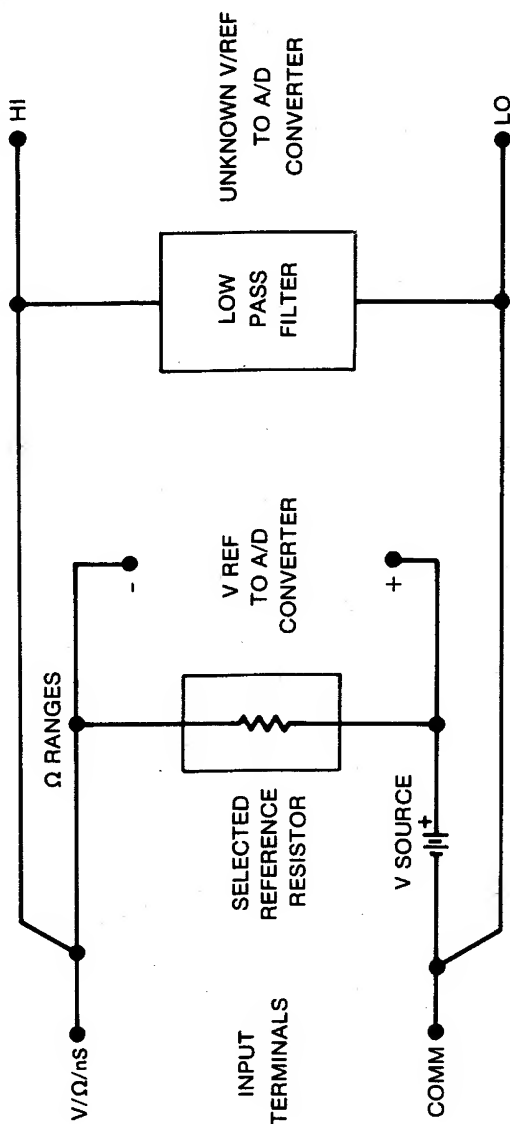


Figure 3-7. Resistance/Conductance Measurement

during a voltage measurement is replaced by the voltage drop across the reference resistor. This allows the voltage across the unknown resistor to be read during the integrate period, and compared against the reference resistor during the read period. As before, the length of the read period is a direct indication of the value of the unknown. The PEAK HOLD switch should always be in the OFF position when making resistance measurements.

3-23. Conductance Measurement Function

3-24. Conductance measurements are made using a ratio technique similar to that used in making resistance measurements (Figure 3-7). The main differences are: only one range is provided (200 nS), and the function of the range resistor and the unknown resistor in the measurement cycle is reversed. That is, the voltage drop across the range resistor is used as the unknown input during the integrate period, and the voltage across the unknown resistor is used for the reference input during the read period. As a result, the display provides a reading that is the reciprocal ($1/\Omega$) of the unknown input resistance; i.e., the higher the input resistance, the lower the display reading. The PEAK HOLD switch should always be in the OFF position when making conductance measurements.

3-25. Peak Hold Circuit Level

3-26. As Figure 3-8 shows, the peak hold circuit consists of an operational amplifier (U19) and a capacitor (C19) which is across the a/d converter (U8) input. When the PEAK HOLD switch is set to the ON position, switch action removes the normal input to the a/d converter and routes the output of the signal conditioners to U19. The operational amplifier charges C19 to the peak positive input signal to the DMM. The charge on C19 is the unknown value that the a/d converter reads to determine the displayed value. As the charge on C19 bleeds off through U19, U14, and Q10, the display value will decay. Peak-Hold AC will give the peak rms value of a sine wave since the signal is routed through the AC Converter. Peak-Hold DC should give the positive peak of any input waveform.

3-27. Level Detector Circuit

3-28. As Figure 3-9 shows, when the k Ω or nS functions are selected, the DMM input is routed both to the resistance/conductance signal conditioner and to the comparator of the level detector circuit. The other input to the comparator is a +0.8V reference level (200 k Ω range). When the DMM input is open circuited or greater than the reference, the level detector circuit causes the ▲ up arrow to appear in the display. If the DMM input is less than the reference level, the level detector circuit causes the ▼ down arrow to appear in the display and the audible tone to sound if the AC/DC switch is at the AC position.

NOTE

The Peak-Hold switch should be in the OFF position when using the Level Detector Circuit.

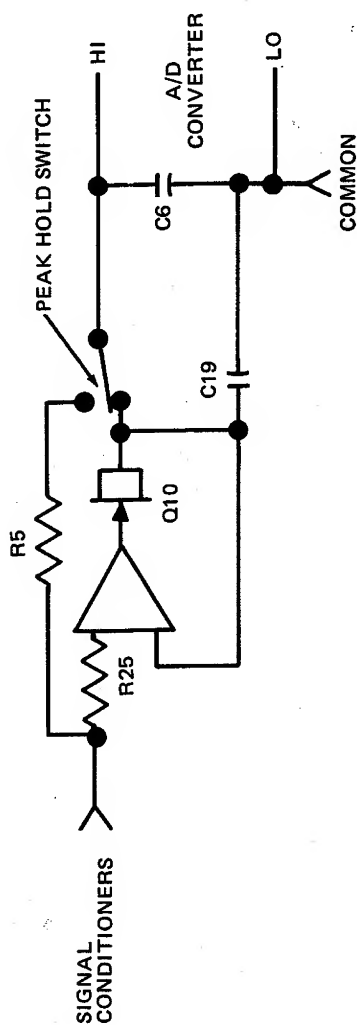


Figure 3-8. Simplified Peak Hold Circuit

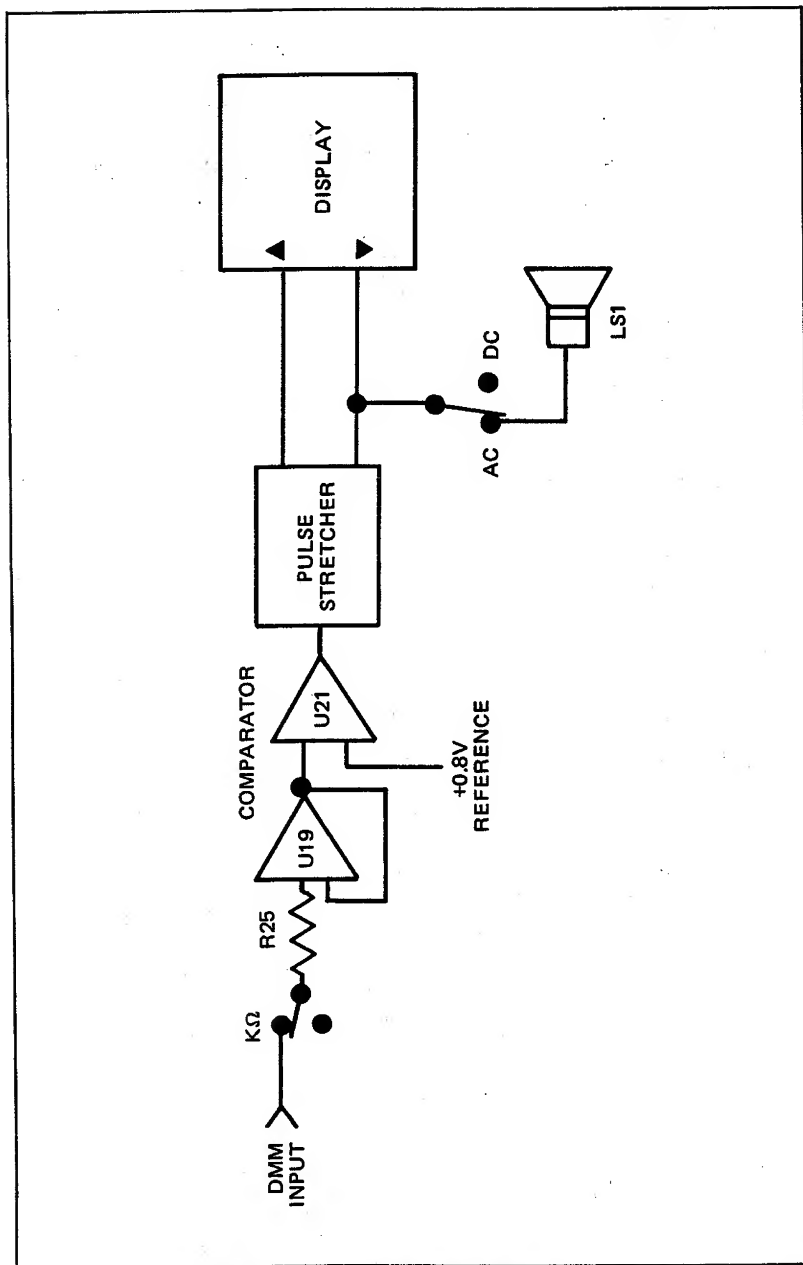



Figure 3-9. Simplified Level Detector Circuit



static awareness



A Message From
John Fluke Mfg. Co., Inc.

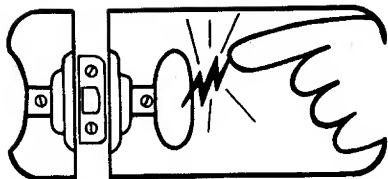


Some semiconductors and custom IC's can be damaged by electrostatic discharge during handling. This notice explains how you can minimize the chances of destroying such devices by:


1. Knowing that there is a problem.
2. Learning the guidelines for handling them.
3. Using the procedures, and packaging and bench techniques that are recommended.

The Static Sensitive (S.S.) devices are identified in the Fluke technical manual parts list with the symbol "ⓧ"


The following practices should be followed to minimize damage to S.S. devices.

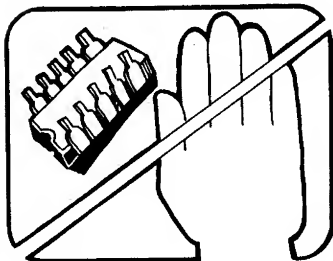


1. MINIMIZE HANDLING

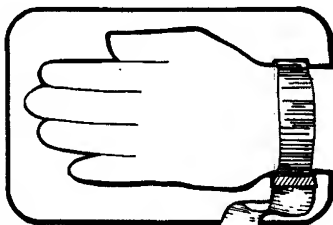


3. DISCHARGE PERSONAL STATIC BEFORE HANDLING DEVICES

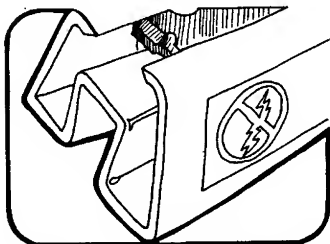


2. KEEP PARTS IN ORIGINAL CONTAINERS UNTIL READY FOR USE.

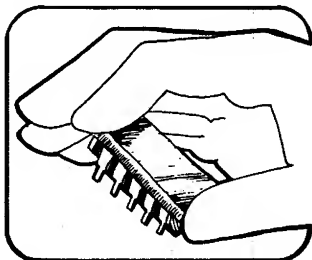


4. HANDLE S.S. DEVICES BY THE BODY

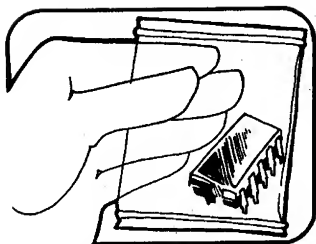


5. USE ANTI-STATIC CONTAINERS FOR HANDLING AND TRANSPORT

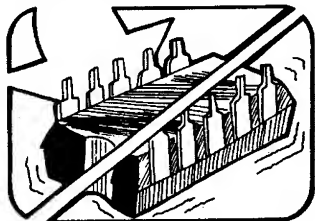

6. DO NOT SLIDE S.S. DEVICES OVER ANY SURFACE

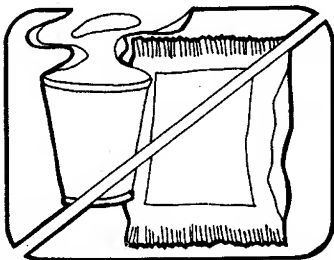

7. AVOID PLASTIC, VINYL AND STYROFOAM IN WORK AREA

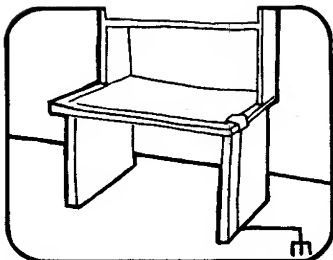

8. HANDLE S.S. DEVICES ONLY AT A STATIC-FREE WORK STATION
9. ONLY ANTI-STATIC TYPE SOLDER-SUCKERS SHOULD BE USED.
10. ONLY GROUNDED TIP SOLDERING IRONS SHOULD BE USED.

Anti-static bags, for storing S.S. devices or pcbs with these devices on them, can be ordered from the John Fluke Mfg. Co., Inc.. See section 5 in any Fluke technical manual for ordering instructions. Use the following part numbers when ordering these special bags.

John Fluke Part No.	Bag Size
453522	6" x 8"
453530	8" x 12"
453548	16" x 24"
454025	12" x 15"

Section 4

Maintenance

WARNING

THESE SERVICING INSTRUCTIONS ARE FOR USE BY QUALIFIED PERSONNEL ONLY. TO AVOID ELECTRIC SHOCK, DO NOT PERFORM ANY SERVICING OTHER THAN THAT CONTAINED IN THE OPERATING INSTRUCTIONS UNLESS YOU ARE QUALIFIED TO DO SO.

4-1. INTRODUCTION

4-2. This section of the manual contains maintenance information for the Model 8024A. This includes service information, general maintenance, performance test, calibration, adjustments, and troubleshooting. The performance test is recommended as an acceptance test when the unit is first received, and later as a preventive maintenance tool to verify proper instrument operation. A 1-year calibration cycle is recommended to maintain the specifications given in Section 1 of this manual. The test equipment required for both the performance test and calibration adjustments is listed in Table 4-1. If the recommended equipment is not available, instruments having equivalent specifications may be used.

4-3. SERVICE INFORMATION

4-4. The 8024A is warranted for a period of 1-year upon delivery to the original purchaser. Conditions of the warranty are given at the end of this manual.

4-5. Malfunctions that occur within the limits of the warranty will be corrected at no charge. Simply mail the instrument (postpaid) to your nearest authorized (in-warranty) Fluke Technical Service Center. A complete list of service centers is provided at the end of this manual. Dated proof-of-purchase will be required for all in-warranty repairs.

4-6. Factory authorized centers are also available for calibration and/or repair of instruments that are beyond their warranty period. Contact your nearest Fluke Technical Service Center for a cost quotation. Ship the instrument and remittance in accordance with instructions received.

Table 4-1. Test Equipment Required

INSTRUMENT TYPE	REQUIRED CHARACTERISTICS	RECOMMENDED EQUIPMENT
DMM CALIBRATOR	<p>AC VOLTS: Voltage Range: 0V to 200V to 750V Accuracy Required: $\pm 1\%$, $\pm 0.35\%$, $\pm 0.1\%$ Frequency: 5 kHz to 2 kHz to 1 kHz to 100 Hz, $\pm 0.25\%$</p> <p>DC VOLTS: Voltage Range: 0 to 1000V Accuracy: $\pm 0.025\%$</p> <p>AC CURRENT: Current Range: 0 to 1900 mA Frequency Range: 100 Hz to 1 kHz Accuracy: $\pm 0.1\%$</p> <p>DC CURRENT: Current Range: 0 to 1900 mA Accuracy: $\pm 0.1\%$</p> <p>RESISTANCE: Value: 100Ω Accuracy: $\pm 0.05\%$ Value: 1 kΩ, 10 kΩ, 100 kΩ, 1000 kΩ Accuracy: $\pm 0.025\%$ Value: 10 MΩ Accuracy: $\pm 0.5\%$</p>	John Fluke Model 5100B
DMM TEMPERATURE REFERENCE MONITOR THERMOCOUPLE ACCESSORY VACUUM INSUL- ATED BOTTLE 2 HOLE CORK PULSE GENERATOR	<p>0 to 12V dc $\pm 1\%$</p> <p>0.4°C resolution at 0°C</p> <p>8024A compatible</p> <p>1 quart capacity minimum</p> <p>To fit mouth of Vacuum Insulated Bottle</p> <p>Can generate 25 μsec pulses at 5V p-p</p>	<p>John Fluke Model 8020A</p> <p>PRINCO ASTM 56C</p> <p>John Fluke Model Y8102 or Y8103</p> <p>Thermos</p> <p>Hewlett Packard Model 8003A</p>

4-7. GENERAL INFORMATION

4-8. Access Information

NOTE

To avoid contaminating the pcb with oil from the fingers, handle it by the edges or wear gloves. If the pcb does become contaminated, refer to the cleaning procedure given later in this section.

4-9. BACKUP FUSE (F2) AND CALIBRATION ADJUSTMENTS

4-10. Use the following procedure to access F2 and the 8024A calibration adjustments:

1. Set the power switch to OFF.
2. Disconnect test leads and battery eliminator, if attached.
3. Remove the three phillips-head screws from the bottom of the case.
4. Turn the instrument face-up and grasp the top cover at both sides of the input connectors. Then, pull the top cover from the unit.
5. The backup fuse and all adjustments necessary to complete the calibration procedure are now accessible (see Figure 4-1).

4-11. PCB

4-12. There are two PCB assemblies, Main and Switch. Use the following procedure to remove the Main PCB Assembly from the case:

1. Complete the Calibration Adjustments access procedure.
2. Remove the screw from the shield covering the assembly.
3. Using your index finger, lift up the lower right-hand corner of the pcb until it is free. Then pull the pcb to the right until it clears the shelf under the buttons.
4. Reassemble in the logical reverse order.

NOTE

When installing the pcb, route battery-clip wires behind the post on the left-hand side of the bottom case. Also make sure that the removable plastic lip located beneath the range switch pushbuttons is properly installed in the bottom case and that the green power-switch cap is mounted on the power switch.

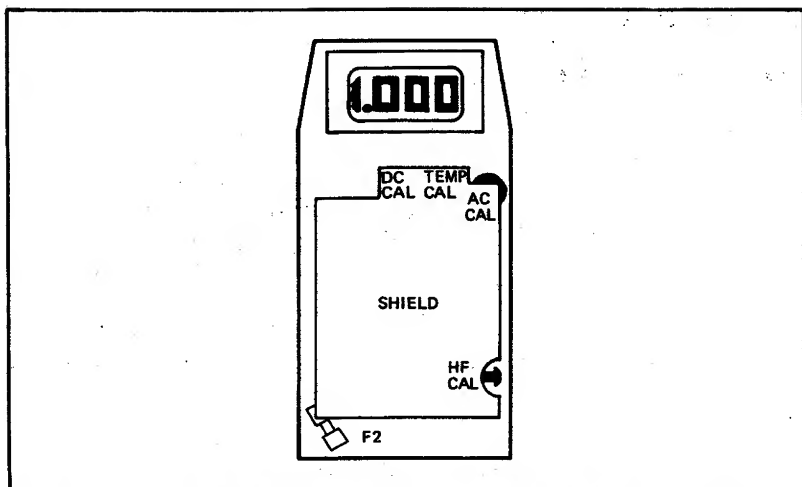


Figure 4-1. Calibration Adjustments Location

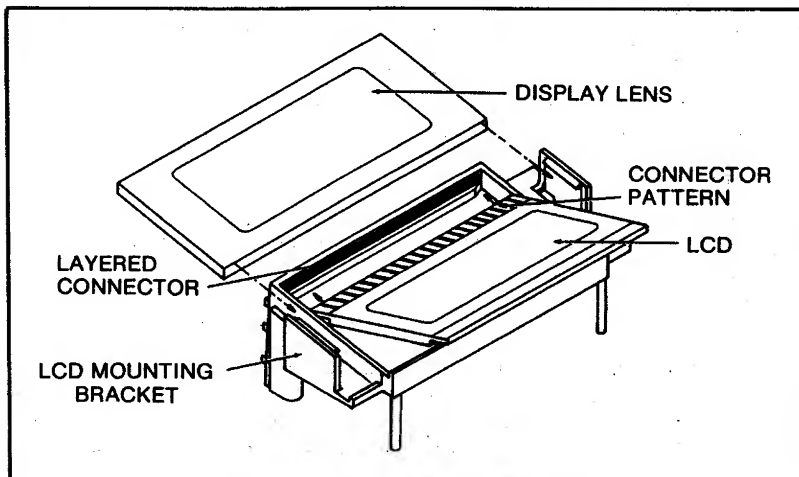


Figure 4-2. LCD Display Assembly

4-13. DISPLAY ACCESS

4-14. Refer to Figure 4-2 and the following procedure to remove/replace the LCD assembly.

1. Remove the Main PCB assembly using the PCB access procedure.
2. Place your thumbs on either side of the display lens and carefully push the lens out of the LCD bracket.

3. Turning LCD bracket upside down gently tap into your palm, LCD should fall out.

NOTE

When installing the LCD make certain that its flat surface is facing out and its connector pattern is on top of and makes contact with, the flexible layered connector.

4-15. LSI (U8) ACCESS

- 4-16. Use the following procedure to remove/replace the a/d converter and display driver IC, U8:

1. Remove the pcb assembly using the PCB access procedure.
2. On the bottom of the Main pcb locate and remove the two phillips-head screws from the display assembly.
3. Lift the display assembly from the pcb to expose U8.

CAUTION

U8 is a MOS device and is subject to damage by static discharge. Observe the precautions given later in this section under Troubleshooting before attempting to remove or replace U8.

4. Use a screwdriver or a reasonable substitute to rock (by prying up on each end of the IC) the IC out of its socket.
5. When installing U8 make sure all pins are lined up in the socket, and then press U8 carefully into place.

4-17. Cleaning

CAUTION

Do not use aromatic hydrocarbons or chlorinated solvents for cleaning. These solutions will react with the plastic materials used in the instrument.

CAUTION

Do not allow the liquid crystal display to come in contact with moisture. Remove the Display Assembly before washing the pcb and do not install it until the pcb has been fully dried.

- 4-18. Clean the front panel and case with a mild solution of detergent and water. Clean dust from the circuit board with low pressure (<20 psi) dry air. Contaminants can be removed from the circuit board with demineralized water and a soft brush (remove the

Display Assembly before washing, and avoid getting excessive amounts of water on the switches). Dry with clean, dry air at low pressure, and then bake at 50 to 60°C (124 - 140°F) for 24 hours.

4-19. Battery/Backup Fuse Replacement

WARNING

BATTERY/FUSE REPLACEMENT SHOULD ONLY BE PERFORMED AFTER THE TEST LEADS HAVE BEEN REMOVED FROM THE INPUT JACKS, AND THE POWER SWITCH IS SET TO OFF. BACKUP FUSE REPLACEMENT PROCEDURE TO BE PERFORMED BY QUALIFIED SERVICE PERSONNEL ONLY. USE ONLY THE RECOMMENDED REPLACEMENT TYPE.

4-20. Refer to Section 2 of this manual for battery and main fuse (F1) replacement procedure. Use the following procedure to replace the backup fuse (F2).

1. Complete the "Backup Fuse and Calibration Access Procedure" located earlier in this section.
2. Using a pointed tool such as a probe tip, pry the backup fuse from its holder.
3. Replace the defective backup fuse with a 3A, 600V type BBS-3 only.

4-21. PERFORMANCE TEST

4-22. The performance tests are used to compare the 8024A performance with the list of specifications given in Section 1 of this manual. It is recommended for incoming inspection, periodic maintenance, and to verify specifications. If the instrument fails any test, calibration adjustment and/or repair is indicated. The 8024A being tested will be referred to as the UUT (Unit Under Test).

4-23. Initial Procedure

4-24. Each of the performance tests assume that the following conditions exist:

1. The unit has been allowed to stabilize and will be tested at an ambient temperature of $23 \pm 5^\circ\text{C}$ ($73 \pm 9^\circ\text{F}$).
2. The fuse and battery have been checked and, if necessary, replaced.
3. Set the UUT switches to the following positions:

POWER	ON
PEAK HOLD	OFF
All other switches	out

4-25. Display Test

4-26. Use the following procedure to verify the proper operation of all LCD indications except BT.

1. Select the $k\Omega$ function and connect a short between the COMMON input terminal and the V/ $k\Omega$ / nS input terminal. Then for each step in Table 4-2, select the range indicated and verify that the corresponding decimal point position and digit display in the table and the LCD are the same.
2. Select the DC V function, 2.0V range on the UUT.
3. Connect the equipment as shown in Figure 4-3.
4. Program the DMM Calibrator for a UUT input of -1.0V dc and verify that the - sign appears in the UUT display.
5. Program the DMM Calibrator for a UUT display of +1.888 and verify that all segments of each digit appear in the LCD.

Table 4-2. Display Test

STEP	SELECT RANGE	UUT DISPLAY
1	200 Ω	00.0*
2	2 $k\Omega$.000
3	20 $k\Omega$	0.00
4	200 $k\Omega$	00.0
5	2000 $k\Omega$	000
6	20 $M\Omega$	0.00
7	200 nS	1

*One or two digits may appear if a test lead is used to connect the two terminals.

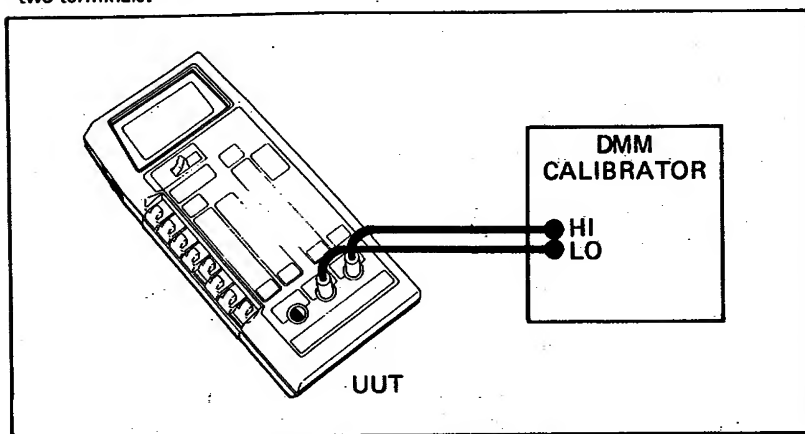


Figure 4-3. General Equipment Connection

6. Program the DMM Calibrator so that each possible number appears in each digit of the display ($3\frac{1}{2}$ digit unit).
7. Program the DMM Calibrator for a UUT input of 0V dc.
8. On the UUT, depress the mA-°C-V/k Ω /nS switch.
9. Verify that the ▼ down arrow appears in the UUT display.
10. Program the DMM Calibrator for a UUT input of +15V dc.
11. Verify that the ▼ down arrow disappears from the UUT display and the ▲ up arrow appears in the UUT display.

4-27. Voltage Test

4-28. Use the following procedure to verify the proper operation of both the AC and DC V measurement functions:

1. Connect the equipment as shown in Figure 4-3 and release the mA-°C-V/k Ω /nS function switch.
2. For each step of Table 4-3 set the AC/DC switch to the indicated position, select the listed range, program the DMM Calibrator for the corresponding UUT input, and verify that the UUT displayed value is within the limits listed.

4-29. Current Test

4-30. Use the following procedure to verify the proper operation of both the AC and DC mA measurement functions:

1. Connect the equipment as shown in Figure 4-4.
2. For each step of Table 4-4 set the AC/DC switch to the indicated position, select the listed range, program the DMM Calibrator for the corresponding UUT input, and verify that the UUT displayed value is within the indicated limits.

4-31. Resistance/Conductance Test

4-32. Use the following procedure to verify the proper operation of both the k Ω and nS measurement functions:

1. On the UUT set the mA-°C-V/k Ω /nS function switch to the in position.
2. Connect the equipment as shown in Figure 4-3.
3. For each step of Table 4-5 set the AC/DC switch to the indicated position, select the listed range, program the DMM Calibrator for the corresponding UUT input, and verify that the UUT displayed value is within the indicated limits.

4-33. Peak Hold Test

4-34. Use the following procedure to verify proper operation of the peak hold function:

1. Select the AC V function, 2V range.
2. Connect the equipment as shown in Figure 4-3.
3. Program the DMM Calibrator for a UUT input of 1.9V ac rms at 100 Hz.

Table 4-3. Voltage Test

STEP	UUT SWITCH POSITION		INPUT		DISPLAY LIMITS
	DC/AC	RANGE	LEVEL	FREQ.	
1	DC	200 mV	+190 mV dc	DC	189.7 to 190.3
2			-190 mV dc		-189.7 to -190.3
3		2V	1.9V dc		1.897 to 1.903
4			0.0V dc		0.001 to -0.001
5		20V	19V dc		18.97 to 19.03
6		200V	190V dc		189.7 to 190.3
7		1000V	1000V dc		998 to 1002
8	AC	200 mV	Short	—	00.0 to 00.2
9			190 mV ac rms	100 Hz	188.4 to 191.6
10				2 kHz	186.8 to 193.2
11				5 kHz	180.0 to 199.9
12		2V	1.9V ac rms	100 Hz	1.884 to 1.916
13				2 kHz	1.868 to 1.932
14				5 kHz	1.800 to 1.999
15		20V	190 mV ac rms	5 kHz	0.175 to 0.205
16				100 Hz	18.84 to 19.16
17				2 kHz	18.68 to 19.32
18				5 kHz	18.00 to 19.99
19		200V	100V ac rms	100 Hz	99.0 to 101.0
20				2 kHz	98.2 to 101.8
21				5 kHz	94.5 to 105.5
22		750V	750V ac rms	100 Hz	740 to 760
23				1 kHz	740 to 760

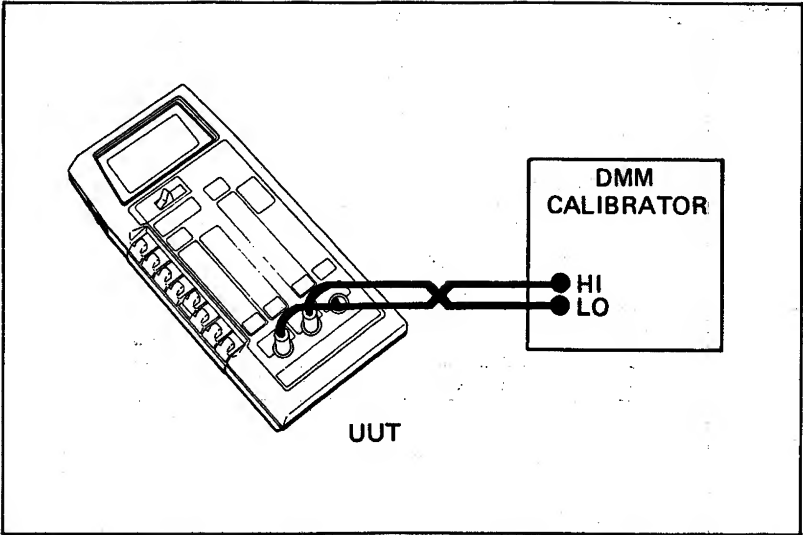


Figure 4-4. General Equipment Connection - Current

Table 4-4. Current Test

STEP	UUT SWITCH POSITION		INPUT		DISPLAY LIMITS
	AC/DC	RANGE	LEVEL	FREQ.	
1	DC	2 mA	+1.9 mA dc		+1.885 to +1.915
2		20 mA	+19 mA dc		+18.85 to +19.15
3		200 mA	+190 mA dc		+188.5 to +191.5
4			-190 mA dc		-188.5 to -191.5
5		2000 mA	+1.9A dc		+1885 to +1915
6	AC	2 mA	Short		0.000 to 0.002
7			1.9 mA ac rms	100 Hz	1.841 to 1.959
8				400 Hz	
9		20 mA	19 mA ac rms	100 Hz	18.69 to 19.31
10				1 kHz	
11		200 mA	190 mA ac rms	100 Hz	186.9 to 193.1
12				1 kHz	
13		2000 mA	1.9A ac rms	100 Hz	1869 to 1931
14				1 kHz	

Table 4-5. Resistance/Conductance Test

STEP	SELECT RANGE	INPUT	DISPLAYED VALUE SHOULD BE	
			NO LESS THAN	NO MORE THAN
1	200 Ω	100 Ω	99.5	100.5
2	2 k Ω	1 k Ω	0.998	1.002
3	20 k Ω	10 k Ω	9.98	10.02
4	200 k Ω	100 k Ω	99.8	100.2
5	2000 k Ω	1 M Ω	997	1003
6	20 M Ω	10 M Ω	9.79	10.21
7	200 nS	10 M Ω	97.0	103.0

4. Push the PEAK HOLD switch to the ON position and verify that the UUT display is between 1.833 and 1.967, \pm (3% of rdg + 10 digits).
5. Program the DMM Calibrator for an output of 0.1 mV ac rms at 100 Hz.
6. Verify that the UUT display changes less than 10 digits in 10 seconds.
7. Push the PEAK HOLD switch to the OFF position.

4-35. Continuity Test

- 4-36. Use the following procedure to verify proper operation of the continuity function:
 1. Select the k Ω function and 2 k Ω range.
 2. Connect the test leads to the COMMON and V/k Ω /nS terminals
 3. When the test leads are open circuited, the \blacktriangle up arrow will be displayed.
 4. Short the test leads together and observe that the \blacktriangle up arrow disappears and the \blacktriangledown down arrow is displayed.
 5. Depress the AC/DC switch to activate the audible tone.
 6. Momentarily short the test leads together and observe that the tone sounds coincident with the \blacktriangledown down arrow. The \blacktriangle up arrow may or may not be displayed, depending on the duration of the short.

4-37. Level Detector Test

- 4-38. Use the following procedure to verify the proper operation of the level detector function:

1. Select the $k\Omega$ function, 200 $k\Omega$ range.
2. Program the pulse generator for a single pulse that is greater than 50 μsec wide and 0 to 3V $\pm 0.5\%$ in amplitude.
3. Connect the pulse generator to the UUT: + to the V/ $k\Omega$ / nS terminal and - to the COMMON terminal.
4. Cause the pulse generator to output single pulses and verify that the \blacktriangle up arrow appears momentarily in the LCD of the UUT for each single pulse.
5. On the UUT depress the AC/DC switch to enable the audible tone. The audible tone should be on continuously.
6. Cause the pulse generator to output 500 ms pulses and verify that the \blacktriangle up arrow appears in the LCD and the audible tone stops for each pulse.
7. Release the AC/DC switch to disable the audible tone. The \blacktriangledown down arrow should appear in the UUT display.

4-39. BT Test

4-40. Complete the following procedure to verify that the BT indicator appears on the LCD at the correct battery level, and that the accuracy of the UUT remains unaffected at this battery voltage level:

1. Connect the equipment as shown in Figure 4-5.

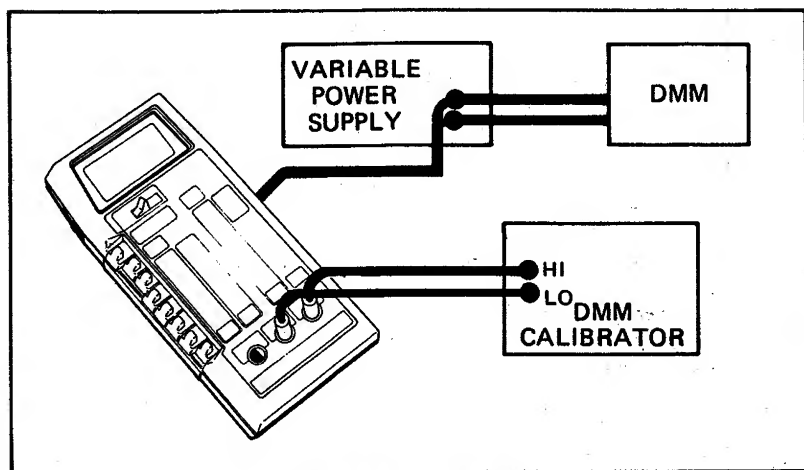


Figure 4-5. BT Test

2. Set the UUT switches to the following positions:

200 mV	in
AC/DC	DC (out)

3. Set the DMM controls to the following positions:

20V	in
AC/DC	DC

4. Program the DMM Calibrator for a UUT input of 190.0 mV dc.
5. Adjust the variable power supply until the BT indicator appears in the UUT display.
6. Verify that the DMM display is between +6.5 and +7.5V dc.
7. Decrease the output of the variable supply until the DMM displays +6.0V.
8. Verify that the UUT display is between 189.8 and 190.2 mV dc.
9. Program the DMM Calibrator for an input of 0V dc.
10. On the UUT, depress the k Ω /nS function switch and the 2 k Ω switch.
11. Adjust the variable power supply until the DMM displays +10.0V dc.
12. Program the DMM Calibrator for a UUT input of 1 k Ω .
13. Verify that the UUT display is between 0.998 and 1.002.
14. Adjust the variable power supply until the DMM displays +6V dc.
15. Verify that the UUT display is between 0.998 and 1.002.

4-41. Temperature Test

WARNING

DO NOT PERFORM THIS PROCEDURE IF THE TIP OF THE THERMOCOUPLE ACCESSORY HAS BEEN EXPOSED TO TOXIC MATERIALS. INSTEAD USE THE ALTERNATE PROCEDURE DESCRIBED IN THE FOLLOWING CALIBRATION ADJUSTMENTS PROCEDURE.

4-42. The following procedure takes advantage of the inherent stability of human body temperature to verify proper operation of the °C temperature function. If there is any doubt about this procedure, if the thermocouple tip has been exposed to toxic materials, or if extreme accuracy of measurement is desired, use (as a reference) the lag bath described in the °C Adjustment procedure in the following Calibration portion of this section.

1. Depress the TEMP °C range switch and release the kΩ/nS switch on the UUT.
2. Connect the John Fluke thermocouple accessory to the UUT.
3. Wipe the tip of the thermocouple accessory clean and place the tip between your thumb and index finger until the UUT display readings stabilize.

NOTE

Normal body temperature of humans is 37° C (98.6° F).

4. Verify that the UUT display is between 34 and 39°C.

4-43. CALIBRATION ADJUSTMENTS

4-44. Under normal operating conditions the 8024A should be calibrated once a year to maintain the specifications given in Section 1 of this manual. If your 8024A has been repaired or if your 8024A has failed any of the Performance Tests, immediate calibration is indicated. Test equipment needed for the calibration adjustment is listed in Table 4-1. If the test equipment is not available, your nearest John Fluke Service Center will be glad to help. A list of these centers is given in Section 5 of this manual. For verification, complete the Performance Tests after the calibration adjustments are made. The 8024A being calibrated will be referred to as the UUT (Unit Under Test).

4-45. Use the following procedure to perform the calibration adjustments:

1. Allow the UUT to stabilize for at least 30 minutes at an ambient temperature of 21°C to 25°C (70°F to 77°F).
2. Complete the calibration access procedure presented earlier in this section.
3. Select the DC V function, 200 mV range on the UUT.
4. Connect the equipment as shown in Figure 4-3.
5. Program the DMM Calibrator for a UUT input of +190.0 mV dc.
6. Adjust the DC CAL (R6) for a UUT display of exactly 190.0.
7. Connect a jumper across Q10.
8. Push the PEAK HOLD switch to the ON position.

9. Adjust R17 (Peak Hold offset) for a UUT display of exactly 190.0.
10. Remove the jumper from across Q10.
11. Push the PEAK HOLD switch to the OFF position.
12. Connect the equipment as shown in Figure 4-3.
13. On the UUT, depress the AC/DC switch.
14. Program the DMM Calibrator for a UUT input of 190.0 mV ac rms at 100 Hz.
15. Adjust the AC CAL (R4) for a UUT display of exactly 190.0.
16. On the UUT, depress the 2V range.
17. Program the DMM Calibrator for a UUT input of 1.9V ac rms at 5 kHz.
18. Adjust the HF CAL (C1) for a UUT display between 1.805 and 1.995.
19. Establish a lag bath (ice point environment) as shown in Figure 4-6 and allow the lag bath to sit for 30 minutes to reach thermal equilibrium.
20. Connect the Thermocouple Accessory to the UUT.
21. Adjust the TEMP CAL (R10) for a UUT display the same as the Temperature Reference Monitor reading.

4-46. TROUBLESHOOTING

CAUTION

Static discharge can damage MOS components contained in the 8024A. Avoid instrument damage by complying with the precautions on the Static Awareness sheet when troubleshooting or repairing the 8024A.

4-47. Never remove, install, or otherwise connect or disconnect components without first turning the 8024A POWER switch to OFF. Table 4-6 is a troubleshooting guide for the 8024A. To properly use the guide, complete the performance tests given earlier in this section and note any discrepancies. Then locate the heading of the procedure in question in the Test and Symptom column (Table 4-6). Under that heading isolate the symptom that approximates the observed malfunction. Possible causes are listed to the right of the selected symptom. Details necessary to isolate a particular cause can be derived from the Theory of Operation in Section 3 and the schematic diagrams in Section 7.

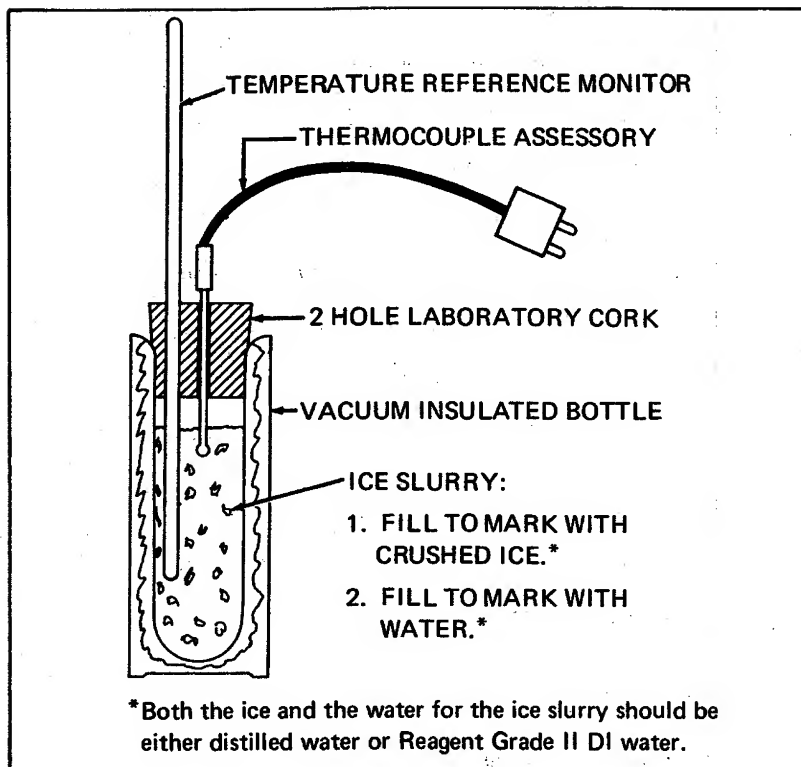


Figure 4-6. Lag Bath

Table 4-6. Troubleshooting Guide

TEST AND SYMPTOM	POSSIBLE CAUSE
INITIAL PROCEDURE BT is displayed when unit is turned on (see BT procedure also). Note, BT will normally be displayed for some line voltages when the A81 line eliminator accessory is used. Display blank	Low battery voltage, U18C, U7, U8 Dead battery, POWER switch (S9), VR2 shorted, U8
DISPLAY TEST One or more segments will not light through entire test Decade inoperative or one or more segments always lit	Display interconnection, Display (U9) U8 U8

Table 4-6. Troubleshooting Guide (cont)

TEST AND SYMPTOM	POSSIBLE CAUSE
<p>DISPLAY TEST (cont)</p> <p>Improper decimal point indication.</p> <p>Minus sign improperly displayed</p> <p>Display lit but does not respond to changes in input</p>	<p>Check signals at U7. Are they OK? YES: Display (U9). NO: Range switches or interconnect. U8</p> <p>PEAK HOLD switch is at the ON position (if you pushed toward the left to set the PEAK HOLD switch to the OFF position, the switch is still at the ON position), VR1, U8, Y1, C6 shorted, or interconnect.</p>
<p>VOLTAGE TEST</p> <p>DC: Display reading is out of tolerance on 200 mV range.</p> <p>Display readings out of tolerance on all ranges except 200 mV.</p> <p>AC: Display reading out-of-tolerance on the 2V range with 1.9V ac rms, 5 kHz, input.</p> <p>Display readings out of tolerance on all ranges except the 200 mV range.</p>	<p>DC CAL (R6) out of calibration, VR1 U5, U8, S8 U1, U2, U3</p> <p>AC CAL (R4) out of calibration, AC Converter U1</p>
<p>PEAK HOLD TEST</p> <p>Value does not appear in the display.</p> <p>Value decays too fast</p>	<p>U19, (U14, Q10), C5, C6</p> <p>U19, C19, U14, Q10</p>
<p>LEVEL DETECTOR TEST</p> <p>UP arrow doesn't appear and audible tone doesn't sound when the input is low.</p> <p>Down arrow doesn't appear and audible tone doesn't sound when the input is low.</p> <p>Down arrow appears, but tone doesn't sound when input is low.</p>	<p>U21, U17, U16, U10, U9, or interconnect</p> <p>kΩ switch (S1E), U21, U17, U16 S8B, or interconnect, U10, U9, LS1 U18 Q8</p> <p>AC/DC switch (S8B), U10, Q8, U18A, LS1</p>

Table 4-6. Troubleshooting Guide (cont)

TEST AND SYMPTOM	POSSIBLE CAUSE
<p>CURRENT TEST Input does not affect display Displayed reading is out of tolerance on one or more ranges.</p> <p>°C TEST Display reading out of tolerance</p>	<p>F1, CR1, CR2 If 2000 mA and 200 mA ranges are OK, U2 is defective. Otherwise, U3 is defective.</p> <p>TEMP COMPENSATION (R10) out of calibration. Room temp should be displayed if °C input and common are shorted together. Check also fuse and battery connector.</p>

Section 5

List of Replaceable Parts

5-1. INTRODUCTION

5-2. This section contains an illustrated parts breakdown of the instrument. A similar parts listing for each of the Options will be found in Section 6. Components are listed alphanumerically by assembly. Both electrical and mechanical components are listed by reference designation. Each listed part is shown in an accompanying illustration.

5-3. Parts lists include the following information:

1. Reference Designation.
2. Description of each part.
3. FLUKE Stock Number.
4. Federal Supply Code for Manufacturers. (See Table 5-6 for Code-to-Name list.)
5. Manufacturer's Part Number.
6. Total Quantity of components per assembly.
7. Recommended Quantity: This entry indicates the recommended number of spare parts necessary to support one to five instruments for a period of 2 years. This list presumes an availability of common electronic parts at the maintenance site. For maintenance for 1 year or more at an isolated site, it is recommended that at least one of each assembly in the instrument be stocked (see paragraph 5-7). In the case of optional subassemblies, plug-ins, etc., that are not always part of the instrument, or are deviations from the basic instrument model, the REC QTY column lists the recommended spares quantity for the items in that particular assembly.

5-4. HOW TO OBTAIN PARTS

5-5. Components may be ordered directly from the manufacturer by using the manufacturer's part number, or from the John Fluke Mfg. Co., Inc. or its authorized representative by using the **FLUKE STOCK NUMBER**. In the event the part you order has been replaced by a new or improved part, the replacement will be accompanied by an explanatory note and installation instruction, if necessary.

5-6. To ensure prompt and efficient handling of your order, include the following information.

1. Quantity.
2. **FLUKE** Stock Number.
3. Description.
4. Reference Designation.
5. Printed Circuit Board Part Number and Revision Letter.
6. Instrument Model and Serial Number.

5-7. A Recommended Spare Parts Kit for your basic instrument is available from the factory. This kit contains those items listed in the **REC QTY** column of the parts list in the quantities recommended.

5-8. Parts price information is available from the John Fluke Mfg. Co., Inc. or its representative. Prices are also available in a Fluke Replacement Parts Catalog, which is available on request.

CAUTION



Indicated devices are subject to damage by static discharge.

Table 5-1. 8024A Multimeter

REF DES	DESCRIPTION	FLUKE STOCK NO.	MFG SPLY CODE	MFG PART NO.	TOT QTY	REC QTY	N O T E
8024A MULTIMETER FIGURE 5-1 (8024A-T&B)							
A1	CASE ASSEMBLY	515080	89536	515080	1		
BT1	BATTERY, PRIMARY TYPE 1604, 9V	446823	89536	446823	1		
H1	SCREW, PHP, 4-40 X 3/16	129882	89536	129882	1		
H2	SCREW, PHP, 3/8 HI-LO THD/FORM	448456	89536	448456	2		
H3	SCREW, PHP, 3/4 HI LO, THD/FORM	447953	89536	447953	3		
MP1	BRACKET, LCD MOUNTING	531657	89536	531657	1		
MP2	CONNECTOR, LAYERED	520858	89536	520858	1		
MP3	DISPLAY, LENS	450759	89536	450759	1		
MP4	PLATE, LCD MOUNTING BRACKET	531665	89536	531665	1		
MP5	DISPLAY, INTERCONNECT	453746	89536	453746	1		
MP6	TEST LEAD/PROBE ASSY.	516666	89536	Y8132	1		
MP7	BUTTON (POWER SWITCH)	456491	89536	456491	1		
TM1	INSTRUCTION MANUAL (8024A)	609099	89536	609099	1	1	
TM2	CARD, OPERATORS GUIDE (8024A)	521484	89536	521484	1	1	
U9	IC, LIQUID CRYSTAL DISPLAY	504324	89536	504324	1		
KIT	RECOMMENDED SPARE PARTS KIT (8024A)	537852	89536	537852	AR	1	



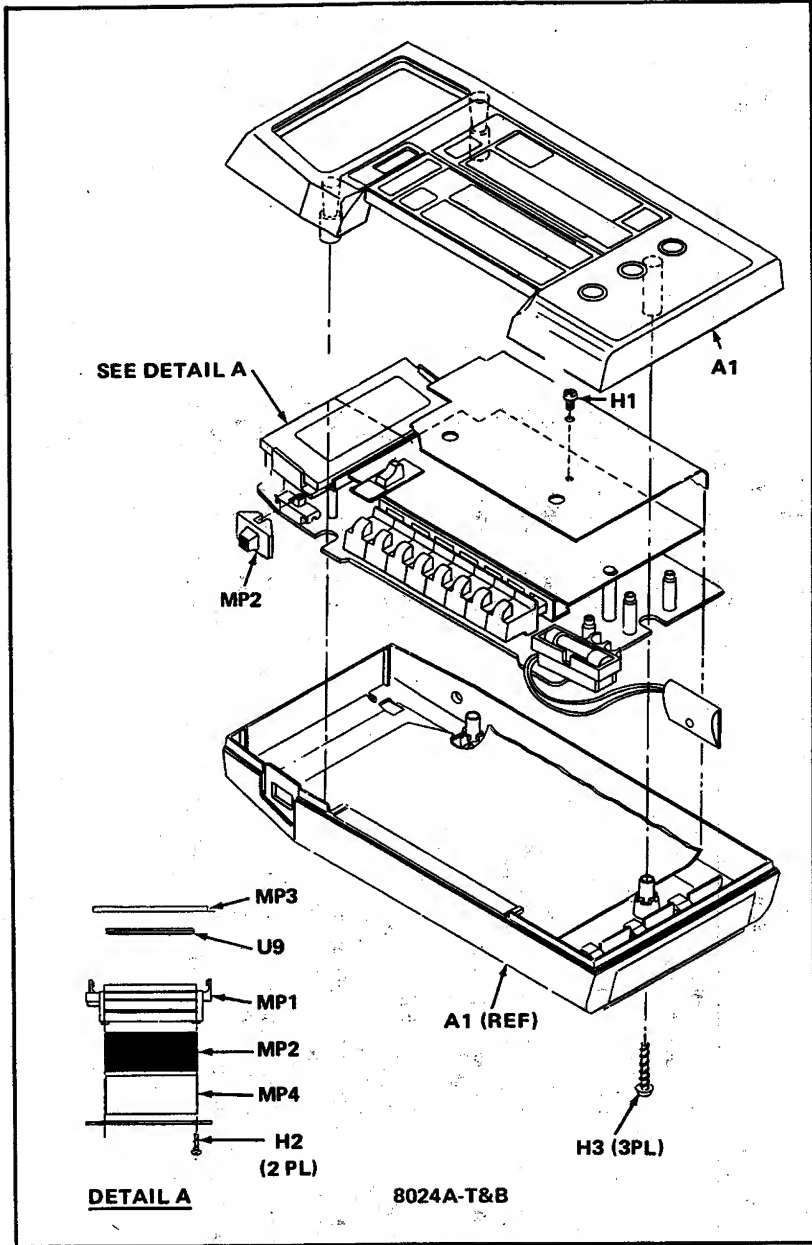


Figure 5-1. 8024A Multimeter

Table 5-2. 8024A Final Assembly (Interior)

REF DES	DESCRIPTION	FLUKE STOCK NO.	MFG SPLY CODE	MFG PART NO.	TOT QTY	REC QTY	N O T E
	② FINAL ASSEMBLY (INTERIOR) FIGURE 5-2 (8024A-4201)						
A2	② MAIN PCB ASSEMBLY	578690	89536	578690	1		
A3	SWITCH ASSEMBLY	578682	89536	578682	1		
F1	FUSE	ORDER	FOR	APPROPRIATE SOURCE	1	5	
	FUSE, 2A, 250V 1/4" X 1" TYPE AGX2 (US)	376582	71400	AGX2			
	FUSE, 5 X 20 MM, 2A 250V (EUROPEAN)	460972	75915	212002			
F2	FUSE, 3A/600V TYPE BBS-3	475004	71400	BBS-3	1	1	
H1	SCREW, PHP, 4-40 X 3/16	129882	89536	129882	4		
MP1	BUTTON (PEAK/HOLD)	514927	89536	514927	1		
MP2	DECAL (PEAK/HOLD)	535104	89536	535104	1		
MP3	INSERT, SILICONE	525089	89536	525089	2		
MP4	INTERCONNECT	508127	89536	508127	1		
MP5	RETAINER	514935	89536	514935	2		

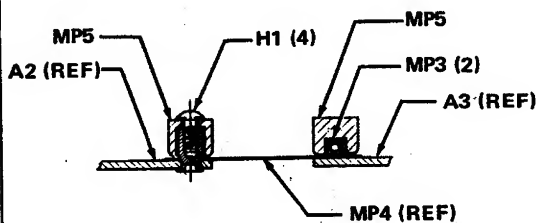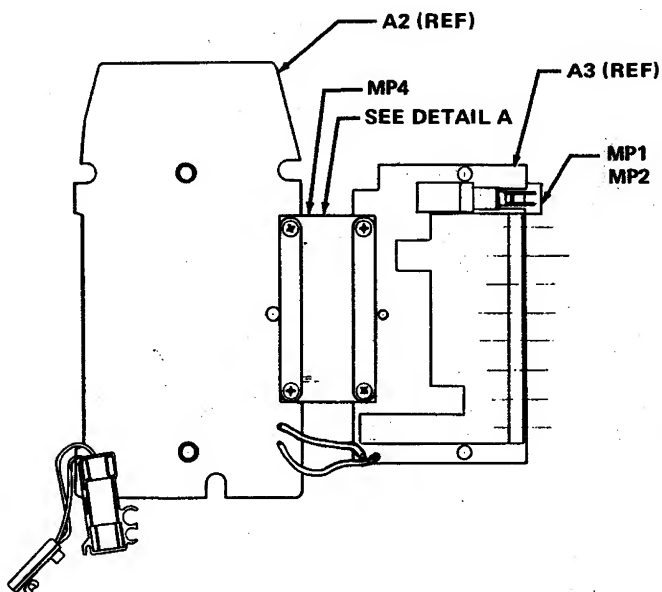


DETAIL A

8024-4201

Figure 5-2. 8024A Final Assembly (Interior)

Table 5-3. A1 Case Assembly

REF DES	DESCRIPTION	FLUKE STOCK NO.	MFG SPLY CODE	MFG PART NO.	TOT QTY	REC QTY	N O T E
A1	CASE ASSEMBLY FIGURE 5-3 (8024A-4224)	515080	89536	515080	1		
MP1	BAIL, PLASTIC	496596	89536	496596	1		
MP2	CASE, BOTTOM	450700	89536	450700	1		
MP3	CASE, TOP	514943	89536	514943	1		
MP4	DECAL (FRONT PANEL)	508093	89536	508093	1		
MP5	DECAL, WARNING	428938	89536	428938	1		
MP6	COVER, BATTERY	450718	89536	450718	1		
MP7	FLANGE, SWITCH	455881	89536	455881	1		
MP8	SHIELD	508101	89536	508101	1		
MP9	SHOCK ABSORBER	428441	89536	428441	1		
MP10	SPACER (CASE)	458588	89536	458588	2		

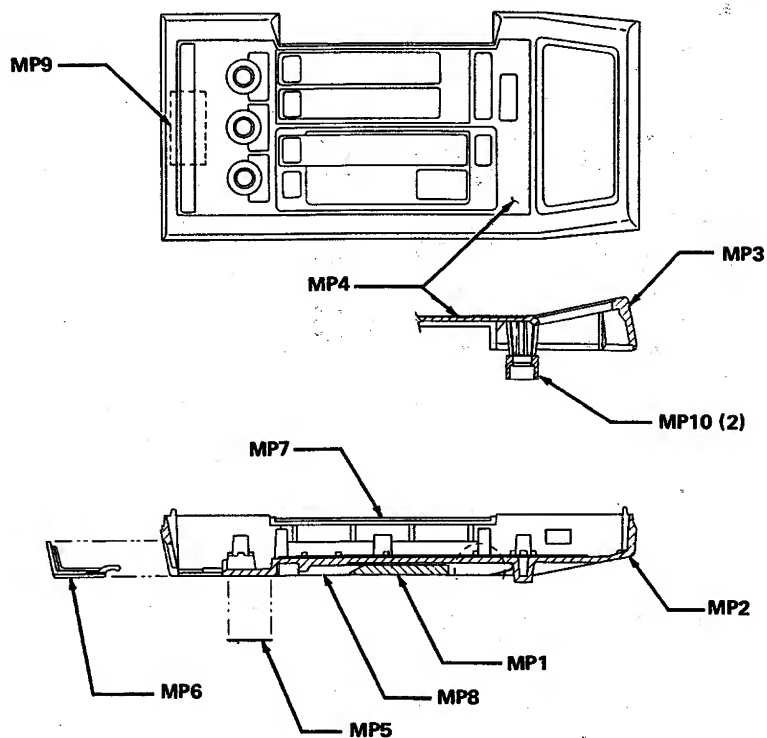

8024-4224

Figure 5-3. A1 Case Assembly

Table 5-4. A2 Main PCB Assembly

REF DES	DESCRIPTION	FLUKE STOCK NO.	MFG SPLY CODE	MFG PART NO.	TOT QTY	REC QTY	N O T E
A2	⊗ MAIN PCB ASSEMBLY FIGURE 5-4 (8024A-4011/4011S)						1
C5	CAP, MYLAR, 0.22 UF +/-10%, 100V	519157	89536	519157	1		
C6	CAP, POLYPROP, .047 UF +/-10%, 100V	446773	89536	446773	2		
C7	CAP, CER, 500 PF +/-110%, 1KV	105692	71590	2DDH60N501K	2		
C8	CAP, POLYPROP, .047 UF +/-10%, 100V	446773	89536	446773	REF		
C9	CAP, POLYPROP, .10 UF +/-10%, 100V	446781	89536	446781	1		
C10	CAP, TA, 10UF +/-20%, 15V	193623	56289	196D106X0015A1	2		
C11	CAP, MYLAR, 0.22 UF +/-10%, 100V	436113	73445	C280MAH/A220K	1		
C12	CAP, CER, 500 PF +/-110%, 1KV	105692	71590	2DDH60N501K	REF		
C13	CAP, MICA, 150 PF +/-5%, 500V	148478	72136	CM15F151J	1		
C14	CAP, MTL, .022 UF +/-10%, 400V	369165	73445	C281A/A22K	2		
C15	CAP, MTL, .022 UF +/-10%, 400V	369165	73445	C281A/A22K	REF		
C16	CAP, TA, 10 UF +/-20%, 15V	193623	56289	196D106X0015A1	REF		
C19	CAP, POLYCARB, 1 UF +/-10%, 50V	271619	84411	X463UW1029.50W	1		
C20	CAP, CER, 0.01 UF +/-20%, 100V	407361	72982	8121-A100-W5R-103M	2		
C21	CAP, CER, 0.01 UF +/-20%, 100V	407361	72982	8121-A100-W5R-103M	REF		
CR1	DIODE, SI	347559	14099	1N5400	2	1	
CR2	DIODE, SI	347559	14099	1N5400	REF		
CR8	DIODE, HI-SPEED SWITCHING	203323	07910	1N4448	1	1	
J4	JACK, DC POWER, PC MOUNT	423897	89536	423897	1		
J5	CONTACT ASSEMBLY	535278	89536	535278	1		
J6	WIRE ASSEMBLY (RED)	516088	89536	516088	1		
J7	WIRE ASSEMBLY (BLK)	516070	89536	516070	1		

Table 5-4. A2 Main PCB Assembly (cont)

REF DES	DESCRIPTION	FLUKE STOCK NO.	MFG SPLY CODE	MFG PART NO.	TOT QTY	REC QTY	N O T E
LS1	TRANSDUCER	513101	89536	513101	1		
MP7	FUSE CLIP	534925	89536	534925	1		
MP8	FUSE SPRING (NOT SHOWN)	535211	89536	535211	1		
MP9	FUSE CLIP	535203	89536	535203	1		
O3	XSTR, SI, NPN	168716	07263	S19254	1	1	
O8	XSTR, SI, PNP	195974	04713	2N3906	1	1	
Q10	XSTR, J-FET	357905	89536	357905	1	1	
R1	RES, COMP, 100K +/-10%, 1W	109397	01121	GB1041	1		
R2*	RES, WW, 1000 +/-10%, 2W	474080	89536	474080	1		
R5	RES, DEP, CAR, 1M +/-5%, 1/4W	348987	80031	CR251-4-5P1M	3		
R6	RES, VAR, 500 +/-10%, 0.5W	447730	89536	447730	1		
R8	RES, DEP, CAR, 220K +/-5%, 1/4W	348953	80031	CR251-4-5P220K	2		
R10	RES, VAR, 5K +/-10%, 0.5W	478883	89536	478883	1		
R13	RES, COMP, 10M +/-5%, 1/4W	194944	01121	CB1065	3		
R14	RES, COMP, 10M +/-5%, 1/4W	194944	01121	CB1065	REF		
R16	RES, DEP, CAR, 220K +/-5%, 1/4W	348953	80031	CR251-4-5P220K	REF		
R17	RES, VAR, 1M +/-10%, 0.5W	461343	89536	461343	1		
R20	RES, DEP, CAR, 30K +/-5%, 1/4W	368753	80031	CR251-4-5P30K	1		
R21	RES, DEP, CAR, 2K +/-5%, 1/4W	441469	80031	CR251-4-5P2K	1		
R22	RES, DEP, CAR, 10K +/-5%, 1/4W	348839	80031	CR251-4-5P10K	1		
R24	RES, COMP, 10M +/-5%, 1/4	194944	01121	CB1065	REF		
R25	RES, DEP, CAR, 100K +/-5%, 1/4W	348920	80031	CR251-4-5P100K	1		
R28	RES, DEP, CAR, 1K +/-5%, 1/4W	343426	89536	343426			
R29	RES, DEP, CAR, 1M +/-5%, 1/4W	348987	80031	CR251-4-5P1M	REF		
R30	RES, DEP, CAR, 1M +/-5%, 1/4W	348987	80031	CR251-4-5P1M	REF		

Table 5-4. A2 Main PCB Assembly (cont)

REF DES	DESCRIPTION	FLUKE STOCK NO.	MFG SPLY CODE	MFG PART NO.	TOT QTY	REC QTY	N O T E
RV1	VARIATOR, 100 PF +/-10%, 430V	447672	09214	V43MA7B	4	1	
RV2	VARIATOR, 100 PF +/-10%, 430V	447672	09214	V43MA7B	REF		
RV3	VARIATOR, 100 PF +/-10%, 430V	447672	09214	V43MA7B	REF		
RV4	VARIATOR, 100 PF +/-10%, 430V	447672	09214	V43MA7B	REF		
S9	SWITCH, SLIDE	453365	79727	G1-116-0005,G-20-32	1		
U5	RESISTOR NETWORK	513044	89536	513044	1	1	
U6	RESISTOR NETWORK	513002	89536	513002	1		
U7	⊗ IC, C-MOS, QUAD, EXCLUSIVE OR GATES	355222	02735	CD4030AE	2	1	
U8	⊗ IC, C-MOS, LSI, LCD INTERFACING (40-PIN)	429100	89536	429100	1	1	
U10	⊗ IC, C-MOS, QUAD, EXCLUSIVE OR GATES	355222	02735	CD4030AE	REF		
U12	RESISTOR NETWORK	513051	89536	513051	1		
U14	⊗ IC, C-MOS (SELECTED)	539437	89536	539437	1	1	
U15	RESISTOR NETWORK	513036	89536	513036	1		
U16	⊗ IC, C-MOS, NAND GATE QUAD 2-INPUT	453241	02735	CD4011BE	1	1	
U17	⊗ IC, C-MOS, RE-TRIG/RESET MULTIVIBRATOR	393512	02735	CD4098AE	1	1	
U18	IC, LINEAR, 5-XSTR ARRAY	248906	12040	LM3046N	1	1	
U19	⊗ IC, C-MOS (SELECTED)	526608	89536	526608	1	1	
U21	IC, LINEAR, OP AMP	539643	01295	TL061	1	1	
VR1	IC, LINEAR, LO-VOLT REF (SELECTED)	508259	89536	508259	1		
VR2	DIODE, ZENER, 12V	113456	04713	1N963A	1	1	
XF2	FUSE CASE	540716	89536	540716	1	1	
XU8	SOCKET, IC, DIL, 40-PIN	429282	09922	DILB40P-108	1		
Y1	CRYSTAL, 3.2 MHZ	513937	89536	513937	1		

*R2 IS A FUSIBLE RESISTOR. USE EXACT REPLACEMENT TO INSURE SAFETY.
NOTE 1. ASSEMBLY IS NOT PROCURABLE AT THIS LEVEL.

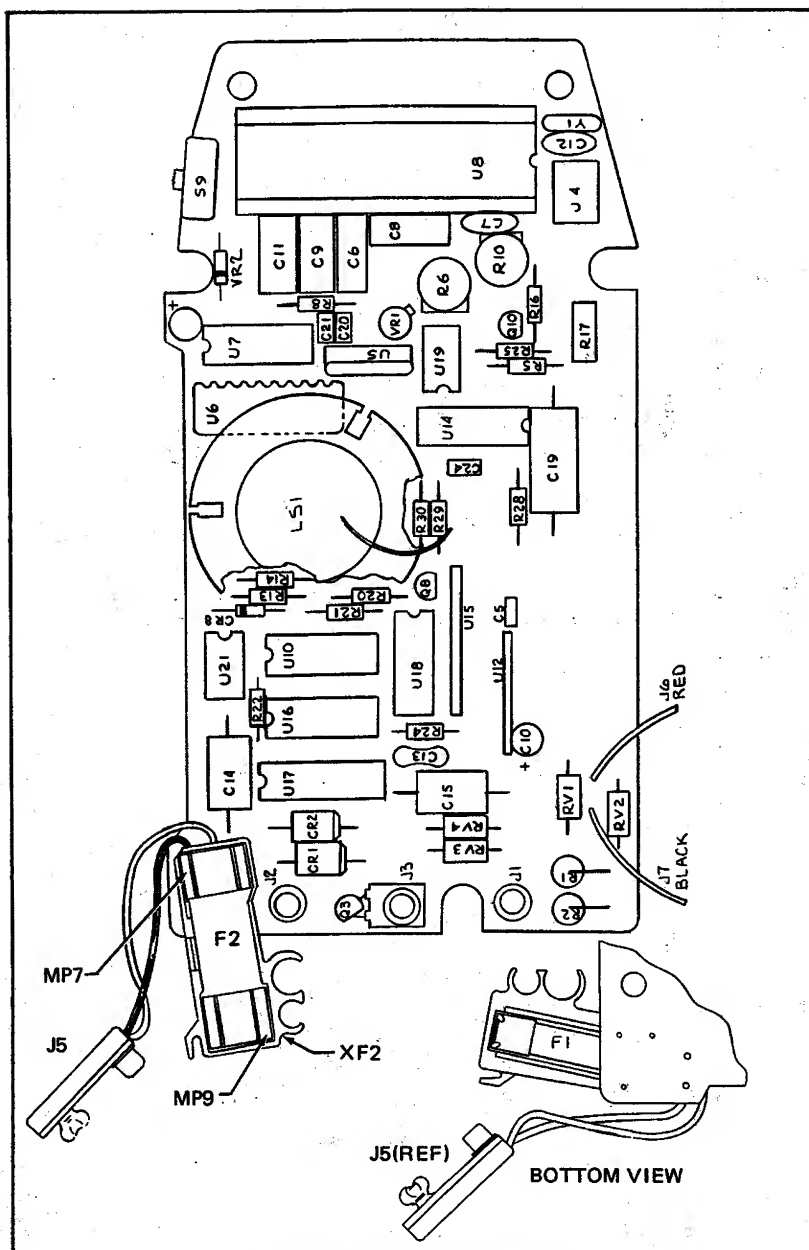


Figure 5-4. A2 Main PCB Assembly

Table 5-5. A3 Switch Assembly

REF DES	DESCRIPTION	FLUKE STOCK NO.	MFG SPLY CODE	MFG PART NO.	TOT QTY	REC QTY	N O T E
A3	SWITCH ASSEMBLY (INCLUDES SWITCH PCB ASSEMBLY)	578682	89536	578682	REF		
	FIGURE 5-5 (8024A-4021/4021S)						
C1	CAP, VAR, TRIMMER, 1.5/0.25 PF, 2000VDC	435016	72982	530-006	1		
C2	CAP, FILM, .022 UF +/-10%, 1000VDC	448183	52763	MKT-1822-322/10+10%	1		
C3	CAP, TA, 10 UF +/-20%, 15V	193623	56289	196D106X0015A1	1		
C4	CAP, CER, 33 PF +/-2%, 100V	354852	72982	8121-A100-C0G-330G	1		
C17	CAP, CER, 0.047 UF +/-20%, 40V	460733	89536	460733	1		
C18	CAP, CER, 0.22 UF +/-20%, 50V	519157	89536	519157	2		
C22	CAP, CER, .01 UF +/-20%, 100V	407361	89536	407361	1		
C23	CAP, CER, 0.22 UF +/-20%, 50V	519157	89536	519157	REF		
CR3	DIODE, SI, HI-SPEED SWITCHING	203323	07910	1N4448	4	1	
CR4	DIODE, SI, HI-SPEED SWITCHING	203323	07910	1N4448	REF		
CR5	DIODE, SI, HI-SPEED SWITCHING	203323	07910	1N4448	REF		
CR6	DIODE, SI, HI-SPEED SWITCHING	203323	07910	1N4448	REF		
Q1	XSTR, SI, NPN	218396	04713	2N3904	3	1	
Q7	XSTR, SI, NPN	218396	04713	2N3904	REF		
Q9	XSTR, SI, NPN	218396	04713	2N3904	REF		

Table 5-5. A3 Switch Assembly (cont)

REF DES	DESCRIPTION	FLUKE STOCK NO.	MFG SPLY CODE	MFG PART NO.	TOT QTY	REC QTY	N O T E
R3	RES. COMP. 2.2M \pm 5%, 1/4W	198390	01121	CB2275	1		
R4	RES. VAR. CERM. 300 \pm 10%, 250VDC/RMS	513424	89536	513424	1		
R9	RES. COMP. 10K \pm 5%, 1/4W	148106	01121	CB1035	1		
R18	RES. DEP. CAR. 240K \pm 5%, 1/4W	442459	89536	442459	1		
R26	RES. DEP. CAR. 10K \pm 5%, 1/4W	348839	80031	CR251-4-5P10K	1		
R27	RES. DEP. CAR. 51K \pm 5%, 1/4W	376434	80031	CR251-4-5P51K	1		
R31	RES. DEP. CAR. 390K \pm 5%, 1/4W	442475	89536	442475	1		
R32	RES. DEP. CAR. 200K \pm 5%, 1/4W	441485	89536	441485	1		
RT1	RES. CURRENT LIMITING, 1K \pm 40%, 2W	446849	89536	446849	1		
S1-S8	SWITCH ASSEMBLY	508119	89536	508119	1		
S1/S8	BUTTON, SWITCH (FUNCTION)	459057	89536	459057	2		
S2-S7	BUTTON, SWITCH (RANGE)	459040	89536	459040	6		
S10	SWITCH	525121	89536	525121	1		
U1	NETWORK, 5 RESISTOR	519983	19647	1776-171	1		
U2	NETWORK, RESISTOR	447706	89536	447706	1		
U3	RESISTOR SHUNT	435727	89536	435727	1		
U4	NETWORK, RESISTOR	513028	89536	513028	1		
U20	IC, LINEAR, LO-POW J-FET, OF AMP	418566	89536	418566	1	1	

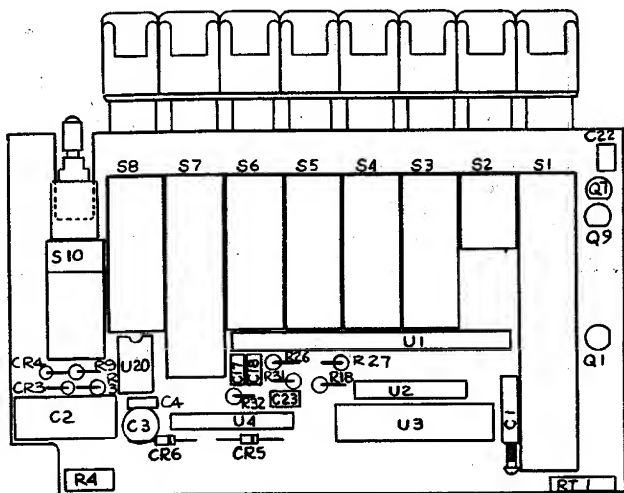


Figure 5-5. A3 Switch Assembly

Table 5-6 Federal Supply Codes for Manufacturers

00779	09214	73445
AMP Inc.	G.E. Semi-Conductor	Amperex Electronic Corp.
Harrisberg, Pennsylvania	Products Dept.	Hicksville, New York
01121	Auburn, New York	75915
Allen-Bradley Co.	12040	Littlefuse, Inc.
Milwaukee, Wisconsin	National Semiconductor Corp.	DesPlaines, Illinois
01295	Danbury, Connecticut	79727
Texas Instruments, Inc.	14099	C-W Industries
Dallas, Texas	Semtech Corp.	Warminster, Pennsylvania
02735	Newbury Park, California	80031
RCA Corp.	19647	Mecco
Somerville, New Jersey	Caddock Electronics, Inc.	Morristown, New Jersey
04713	Riverside, California	84411
Motorola Semiconductor	56289	TRW
Products, Inc.	Sprague Electric Co.	Ogallala, Nebraska
Phoenix, Arizona	North Adams, Massachusetts	89536
05277	71400	Fluke, John Mfg. Co., Inc.
Westinghouse Electric Corp.	Bussmann Mfg.	Seattle, Washington
Youngwood, Pennsylvania	Saint Louis, Missouri	
07263	71590	
Fairchild Semiconductor	Centralab	
Mountain View, California	Milwaukee, Wisconsin	
07910	72982	
Teledyne Corp.	Erie Tech. Products, Inc.	
Hawthorne, California	Erie, Pennsylvania	

Table 5-7. Fluke Technical Service Centers-U.S. and Canada

UNITED STATES**CA, Burbank**

Fluke Technical Center
2020 N. Lincoln Street
Burbank, CA 91504
(213) 849-4641

CA, Santa Clara

Fluke Technical Center
2300 Walsh Avenue
Santa Clara, CA 95050
(408) 985-1200

CO, Denver

Fluke Technical Center
1980 S. Quebec Street, Unit 4
Denver, CO 80231
(303) 750-1228

FL, Orlando

Fluke Technical Center
940 N. Fern Creek Avenue
Orlando, FL 32803
(305) 896-2296

IL, Rolling Meadows

Fluke Technical Center
1400 Hicks Road
Rolling Meadows, IL 60008
(312) 398-5800

MA, Waltham

Fluke Technical Center
244 Second Avenue
Waltham, MA 02154
(617) 890-1604

MD, Rockville

Fluke Technical Center
5640 Fishers Lane
Rockville, MD 20852
(301) 770-1576

MN, Apple Valley

Fluke Technical Center
7373 West 147th Street, Suite 196
Apple Valley, MN 55124
(612) 432-9400

NC, Greensboro

Fluke Technical Center
1310 Beaman Place
Greensboro, NC 27408
(919) 273-1918

NJ, Paramus

Fluke Technical Center
West 75th Century Road
Paramus, NJ 07652
(210) 262-9550

TX, Dallas

Fluke Technical Center
14400 Midway Road
Dallas, TX 75240
(214) 233-9945

WA, Mountlake Terrace

John Fluke Mfg. Co., Inc.
21707 66th Avenue W., Suite 1
Mountlake Terrace, WA 98043
(206) 774-2206

CANADA**ALB, Calgary**

Allan Crawford Assoc., Ltd.
1935 30th Avenue N.E. #14
Calgary, ALB T2E 6Z5
(403) 230-1341

ONT, Mississauga

Allan Crawford Assoc., Ltd.
6503 Northam Drive
Mississauga, ONT L4V 1J5
(416) 678-1500

QUE, St. Laurent

Allan Crawford Assoc., Ltd.
7018 Cote de Liesse
St. Laurent, QUE H4T 1E7
(514) 731-8564

Table 5-8. Fluke Technical Service Centers-International**ARGENTINA**

Fluke Latin American
Service Headquarters
Virrey del Pino 4071
Buenos Aires, Argentina
Tel: 523185

AUSTRALIA

Elmeasco Instrument Pty Ltd.
P.O. Box 30
Concord, N.S.W.
Australia 2137
Tel: (02) 736-2888

AUSTRIA

Walter Rekirsch
Elektronische Geräte GmbH & Co.
Vertriebs-KG.
Liechtensteinstrasse 97/6
A-1090 Vienna, Austria
Tel: 09-43-222-347646

BELGIUM

Fluke (Belgium) S.A./N.V.
6, Rue de Geneve
1140 Brussels, Belgium
Tel: 09-32-2-2164090

BRAZIL

Arotec S.A.
Industria e Comercio
Av. Pacaembu 811
01234 Sao Paulo S.P., Brazil
Tel: 826-2266

CHILE

Intronica Chile Ltda.
Casilla 16228
Santiago 9, Chile
Tel: 44940

COLOMBIA

Coasin Ltda.
Carrera 13, # 37-37, Of. 407
Ap. Aero 29583
Bogota DE, Colombia
Tel: 285-0230

DENMARK

Tage Olsen A/S
Ballerup Byvej 222
DK-2750 Ballerup
Denmark
Tel: (01) 2-65 81 11

ECUADOR

Proteco Coasin Cia., Ltda.
Edificio "Jerico"
Ave. 12 de Octubre #2285y
Ave. Orellana (Planta Baja)
Quito, Ecuador
Tel: 526759

EGYPT

Lotus Engineering Organisation
P.O. Box 1252
Cairo, Egypt
Tel: 71617

FINLAND

Oy Findip AB
Teollisuustie 7
02700 Kauniainen
Finland
Tel: 09-358-0-502255

FRANCE

M.B. Electronique S.A.
Rue Fourny
ZAC de BUC
B.P. #31
78530 BUC, France
Tel: 09-33-1-9568131

GREECE

Hellenic Scientific
Representations Ltd.
11, Vrassida Street
Athens 615, Greece
Tel: 09-30-1-711140

HONG KONG

Gilman Industrial Bldg., 9F
107-109 Wai Yip Street
Kwun Tong
Kowloon, Hong Kong
Tel: 3-427144

INDIA

Hinditron Services Pvt. Ltd.
"Hinditron House"
412 Raj Mahal Vilas Extension
Bangalore 560 006, India
Tel: 33139

Hinditron Services Pvt. Ltd.
69 A.L. Jagmohandas Marg
Bombay 400 006, India
Tel: 365344

Table 5-8. Fluke Technical Service Centers-International (cont)

INDONESIA

P.T. Dwi Tunggal Jaya Sakti
Sangga Buana Bldg., 1st Floor
J1. Senen Raya 44, P.O. Box 4435
Jakarta, Indonesia
Tel: 376608

IRAN

Irantronics Company Ltd.
20 Salm Road
Roosevelt Avenue
Tehran, Iran
Tel: 828294/831564

ISRAEL

R.D.T. Electronics Engineering Ltd.
P.O. Box 75
46, Sokolov Street
Ramat Hasharon 47235
Israel
Tel: 09-972-3-483211

ITALY

Sistrel S.p.A.
Via Timavo 66
20099 Sesto S. Giovanni (Milan)
Italy
Tel: 09-39-2-2476693

Sistrel S.P.A.
Via Guiseppe Armellini #37
00143 Rome, Italy
Tel: 09-39-6-5915551

JAPAN

John Fluke Mfg. Co., Inc.
Japan Branch
1 Higashikata-machi
Midori-ku
Yokohama 226, Japan
Tel: (045) 473-5425

KOREA

Electro-Science Korea Co.
C.P.O. Box 8446
Room 1201 Bowon Bldg.
490 Chongro - 5 Ka
Chongro-ku
Seoul, Korea
Tel: 261-7702

MALASIA

O'Connor's (Malaysia) SDN. BHD.
P.O. Box 91
Petaling Jaya, Selangor
West Malaysia
Tel: 51563

MEXICO

C.J. Christensen S.A. De C.V.
Melchor Ocampo 150-8
Mexico 4 D.F., Mexico
Tel: (905) 535-2258

NETHERLANDS

Fluke (Nederland) B.V.
P.O. Box 5053
5004 EB Tilburg
The Netherlands
Tel: (013) 673973

NEW ZEALAND

W & K McLean Ltd.
P.O. Box 18065
Glen Innes
Auchland, New Zealand
Tel: 587-037

NORWAY

Morgenstjerne & Co. A/A
Konghellegate 3
P.O. Box 6688, Rodelokka
Oslo 5, Norway
Tel: 09-47-2-356110

PAKISTAN

Pak International Operations
505 Mohammadi House
1.1. Chundrigar Road
Katrachi-2 Pakistan
Tel: 221127/239052

PERU

Importaciones Y Representaciones
Electronicas S.A.
Avda. Franklin D. Roosevelt 105
Lima 1, Peru
Tel: 288650

PORTUGAL

Equipamentos de Laboratorio, Ltda
P.O. Box 1100
Lisbon 1002, Portugal
Tel: 09-351-1-578936/547512

Table 5-8. Fluke Technical Service Centers-International (cont)**REPUBLIC OF SINGAPORE**

Rank O'Connor's (PTE) Ltd.
98 Pasir Panjang Road
Singapore 0511
Republic of Singapore
Tel: 637944

REPUBLIC OF SOUTH AFRICA

Fluke S.A. (Pty) Ltd.
P.O. Box 39797
Bramley 2018
Republic of South Africa
Tel: (011) 786-3170

SPAIN

Hispano Electronica S.A.
Apartado de Correos 48
Alcorcon (Madrid)
Spain
Tel: 09-3416194108

SWEDEN

Teleinstrument AB
P.O. Box 490
S-162 Vallingby 4
Sweden
Tel: 09-46-8-380370

SWITZERLAND

Traco Electronic AG
Jenatschstrasse 1
8002 Zurich
Switzerland
Tel: 09-41-1-2010711

TAIWAN

CCT Associates, Inc.
P.O. Box 24209
Taipei, Taiwan
Republic of China
Tel: (02) 391-6894/393-5760

THAILAND

Dynamic Supply Engineering R.O.P.
56 Ekamai, Sukhumvit 63
Bangkok-11, Thailand
Tel: 914434/928532

TURKEY

Erkman Elektronik Aletler
Ticaret Anonim Sirketi
Necatiby Cad 92/3
Karakoy, Istanbul, Turkey
Tel: 09-44-1-5461

UNITED KINGDOM

Fluke International Corp. - UK
Colonial Way
Watford, Herts. WD24TT
United Kingdom
Tel: 09-4492340511

URUGUAY

Coasin Uruguay S.R.L.
Edificio Ciudadela
Sarandi 690 D. Esc. 109
Casilla de Correos 1400
Correo Central
Montevideo, Uruguay
Tel: 917978

VENEZUELA

Coasin C.A.
Apdo. Postal 50939
Sabana Grande # 1
Caracas 105, Venezuela
Tel: 782-9109

WEST GERMANY

Fluke (Deutschland) GmbH
Krausstrasse 32
8045 Ismaning
West Germany
Tel: (089) 96251

Customers in the following countries: Bulgaria, Czechoslovakia, Hungary, Poland, Romania, U.S.S.R., and Yugoslavia, contact: Amtest Associates Ltd., P.O. Box 55, Addlestone, Surrey, KT 15 1DU, England, Tel. (0932) 52121

Section 6

Accessory Information

6-1. INTRODUCTION

6-2. This section of the manual contains information concerning the accessories available for use with the Model 8024A Digital Multimeter (there are no options available at this time). The accessories, some of which are shown in Figure 6-1, are described in general terms under a separate major heading containing the accessory model number. The depth of detail is intended to give the prospective user an adequate first acquaintance with the features and capabilities of each accessory. Additional information, when necessary, is supplied with the accessory.

6-3. DELUXE CARRYING CASE (C90)

6-4. The C90 Deluxe Carrying Case is a pliable, vinyl, zipper-closed pouch that provides in-field-transport protection for your DMM, as well as convenient storage locations for test leads, operator's guide, and other small accessories. A finger- or belt-loop is included on the case as a carrying convenience.

6-5. RUGGED CARRYING CASE (Y8105)

6-6. Your Y8105 is a rigid plastic case that provides protection from dirty, damp, abusive environments. The rugged case is large enough to hold your DMM, test leads, operator's guide card, a temperature measuring accessory, an ac current measuring accessory, a spare battery, and a spare fuse.

6-7. TYPE K SHEATHED THERMOCOUPLE (Y8102)

6-8. Introduction

6-9. Your Y8102 can be used for almost any application, but is best suited for use as a liquid immersion type probe. In most liquids, the grounded measuring junction of your Y8102 provides fast response time. The special isothermal termination unit that plugs into your DMM eliminates temperature gradient problems by keeping the two DMM junctions at the same temperature. See Section 2 of this manual for applications.

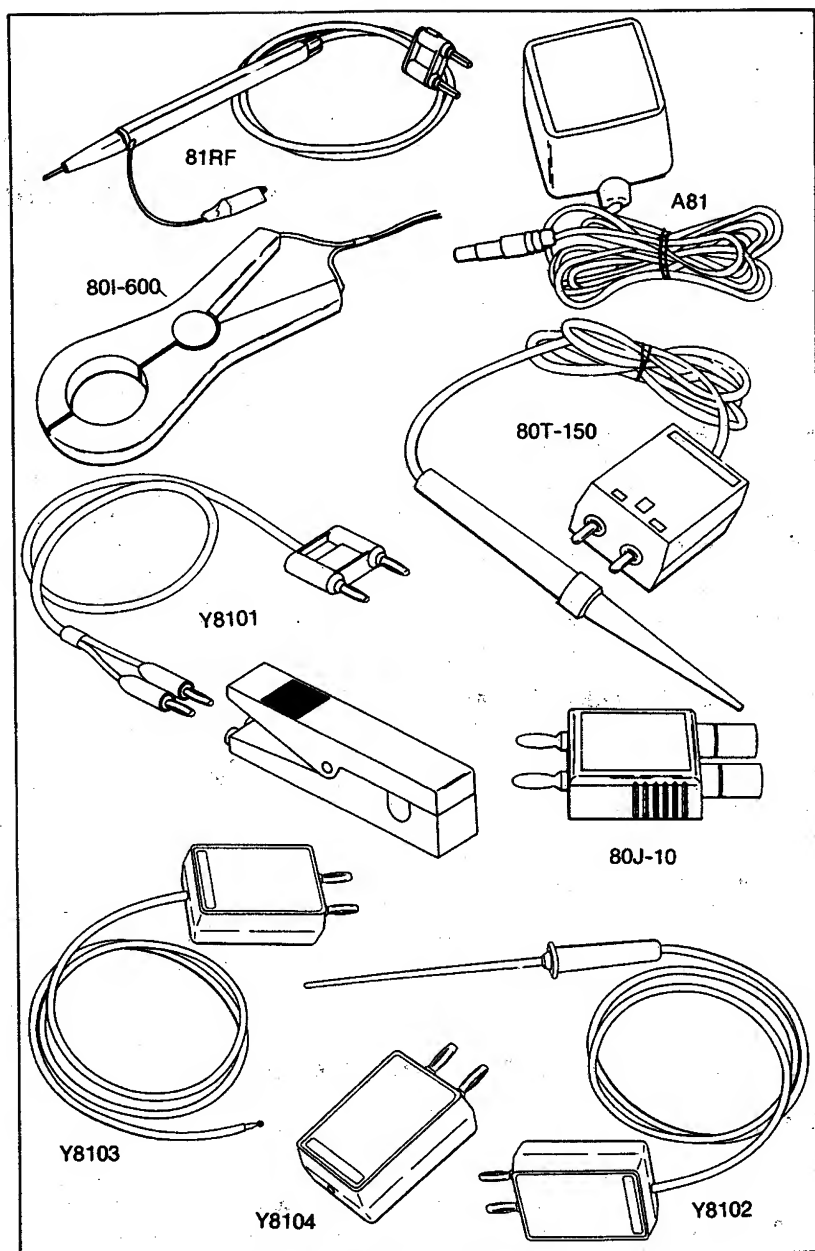


Figure 6-1. 8024A Accessories

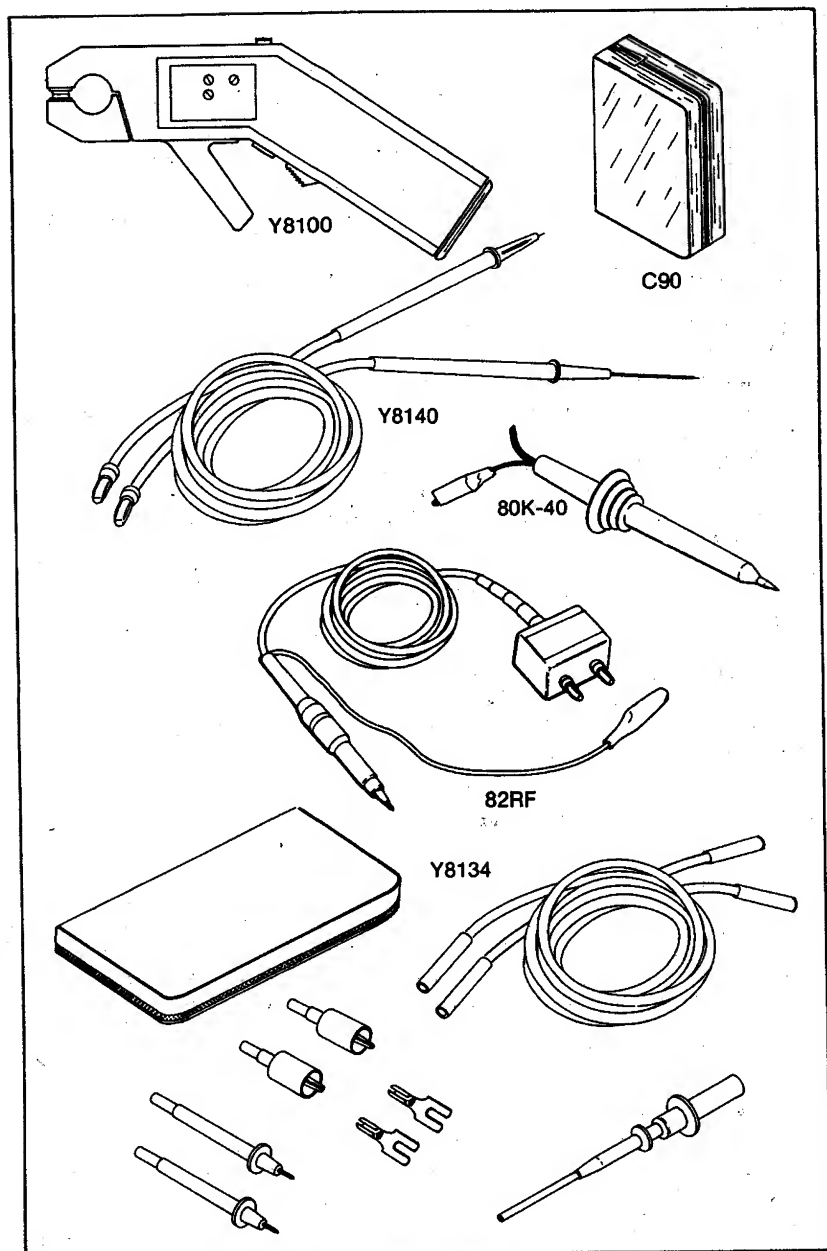


Figure 6-1. 8024A Accessories (cont)

6-10. Specifications

Type: K (Chromel vs Alumel).

Accuracy (with respect to NBS tables): $\pm 2.2^{\circ}\text{C}$ (4°F) over the range of 0°C to 276.7°C (32°F to 530°F).

$\pm 3/4\%$ of temperature over the range of 276.7°C to 926.7°C (530°F to 1700°F).

(Above accuracy and range specifications apply to thermocouple accessory only. Use 8024A Temperature function specifications when using the Y8102 accessory with the 8024A multimeter.)

Time Constant: 10 seconds (for air at room temperature and on atmosphere of pressure moving at 65 ft/sec).

Sampling Tip:

Maximum Temperature Rating: 927°C (1700°F).

Sheath Material: Inconel.

Dimensions: 3.175 mm (1/8 inch) in diameter, 15.24 cm (6 inches) in length

Junction:

Type: K (Chromel vs Alumel).

Grounding: Junction grounded to sheath.

Handle Maximum Temperature Rating: 204.4°C (400°F) continuous.

Conductors:

Type: K.

Size: AWG #24 stranded (7 strands of #32).

Length: 48 inches nominal

Insulation:

Voltage Rating: 1000V (between wire and outside of both layers of insulation).

Maximum Temperature Rating: 105°C (220°F) continuous.

Connector: Dual Banana Isothermal Termination (3/4 inch spacing)

Protection Class 3: Relates solely to insulation or grounding properties defined in IEC 348.

6-11. TYPE K BEAD THERMOCOUPLE (Y8103)

6-12. Introduction

6-13. Your Y8103 can be used for any measuring application (in Teflon compatible environments) except penetration. The exposed tip means extremely fast response time. The special isothermal termination unit that plugs into your DMM eliminates thermal gradient problems by keeping the two DMM junctions at the same temperature. See Section 2 of this manual for applications.

6-14. Specifications

Type: K (Chromel vs Alumel).

Range: -150°C to 260°C (-238°F to 500°F) continuous.

Accuracy (with respect to NBS tables): 2.2°C (4°F) over the range of -17.8°C to 260°C (0°F to 500°F).

(Above accuracy and range specifications apply to thermocouple accessory only. Use 8024A Temperature function specifications when using the Y8103 accessory with the 8024A multimeter.)

Time Constant: 2 seconds (for air at room temperature and one atmosphere of pressure moving with a velocity of 65 ft/sec).

Conductors:

Size: AWG #24 solid.

Insulation:

Type: Teflon Fused Tape

Maximum Temperature Rating: 260° C (500° F) continuous.

Voltage Rating: 1 kV (between wire and outside of both layers of insulation).

6-15. THERMOCOUPLE TERMINATION (Y8104)

6-16. Introduction

6-17. The Y8104 is a special isothermal termination kit that is designed to provide a junction between a dual male banana plug and thermocouple wire. The termination unit eliminates thermal gradient errors by keeping the two DMM terminals at the same temperature.

6-18. Specifications

Maximum Thermocouple Wire Size: #14, .064 inches (.16 cm) diameter

Dual Banana Spacing: .75 inches (1.9 cm)

6-19. TEMPERATURE PROBES (80T-150C and 80T-150F)

6-20. Introduction

6-21. The 80T-150 Temperature Probe converts the instrument into a direct-reading (1 mV dc/°) °C or °F thermometer. It is ideally suited for surface, ambient and liquid measurement, and lends itself easily to a wide range of design, troubleshooting, and evaluation applications. A rugged, fast-responding probe-tip with a 350V dc standoff makes the 80T-150 one of the most versatile and easy-to-use temperature probes available.

6-22. Specifications

Range: -50° C to +150° C (80T-150C); -58° F to +302° F (80T-150F)

Accuracy: ±1° C (1.8° F) from 0° C to 100° C, decreasing linearly to +3° C (5.4° F) at -50° C and +150°.

Resolution: 0.1° on 200 mV range.

Voltage Standoff: 350V dc or peak ac.

Power: Internal disposable battery; 1,000 hours of continuous use.

6-23. HIGH VOLTAGE PROBE (80K-40)

6-24. Introduction

6-25. The Model 80K-40 extends the voltage measurement capability of the instrument up to 40 kV. Internally, the probe contains a special 1000:1 resistive divider. Metal-film resistor with matched temperature coefficients comprise the divider, and provide the probe with its excellent accuracy and stability characteristics. Also, an unusually high input impedance (1000 M Ω) minimizes circuit loading, and thereby contributes to measurement accuracy.

6-26. Specifications

Voltage Range: 1 kV to 40 kV dc or peak ac, 28 kV rms ac.

Input Resistance: 1000 M Ω .

Division Ratio: 1000:1.

Accuracy DC (Overall): 20 kV to 30 kV $\pm 2\%$ (calibrated at 25 kV).

Upper Limit: Changes linearly from 2% at 30 kV to 4% at 40 kV.

Lower Limit: Changes linearly from 2% at 20 kV to 4% at 1 kV.

Accuracy AC (Overall): $\pm 5\%$ at 60 Hz.

6-27. HIGH FREQUENCY PROBE (81RF)

6-28. Introduction

6-29. The 81RF Probe extends the frequency range of the instrument voltage measurement capability to include 100 kHz to 100 MHz input from 0.25 to 30V rms. It operates in conjunction with the instrument's dc voltage ranges, and provides a dc output that is calibrated to be equivalent to the rms value of a sine wave input.

6-30. Specifications

Frequency Response: ± 1 dB from 100 kHz to 100 MHz (relative to ac/dc transfer ratio).

AC-to-DC Transfer Ratio (23 $\pm 5^\circ$ C):

RMS Input (100 kHz)	DC Output
0.25 - 0.5V	0.25 - 0.5V ± 1.5 dB
0.5 - 2.0V	0.5 - 2.0V ± 0.5 dB
2.0 - 30V	2.0 - 30V ± 1.0 dB

Extended Frequency Response: Useful for relative readings from 20 kHz to 250 MHz.

Response: Responds to peak value of input; calibrated to read rms value of a sine wave.

Voltage Range: 0.25 to 30V rms.

Maximum DC Input: 350V dc.

Temperature Coefficient (0 to 18 $^\circ$ C, 28 to 50 $^\circ$ F): ± 0.1 of ac-to-dc transfer ratio specifications per $^\circ$ C.

Input Impedance: 12 M Ω shunted by 15 pF.

6-31. HIGH FREQUENCY PROBE (82RF)

6-32. Introduction

6-33. The Model 82RF High Frequency Probe allows measurements over a frequency range of 100 kHz to 500 MHz from 0.25 to 30V rms. It is designed to be used with voltmeters having an input impedance of 10 megohms $\pm 10\%$. It may be used with a voltmeter having an input impedance higher than 10 megohms provided the input is externally shunted to make the equivalent input impedance equal to 10 megohms.

6-34. Circuitry within the 82RF consists of a capacitor-coupled rectifier circuit which responds to the peak value of the input waveform. The output is positive polarity dc which is calibrated to be equivalent to the rms value of a sine wave.

6-35. Specifications

Frequency Response* (Relative to AC-to-DC Transfer Ratio):

RMS Input (10 MHz)	DC Output
0.25 to 0.5V	0.25 to 0.5V ± 1.5 dB
0.5 to 2.0V	0.5 to 2.0V ± 0.5 dB
2.0 to 5.0V	2.0 to 5.0V ± 1.0 dB
5.0 to 30V	5.0 to 30V ± 1.5 dB

*Frequency response and ac-to-dc transfer ratio specifications assume the use of the probe's BNC adapter and a probe output termination of 10 M Ω $\pm 10\%$ shunted by less than 200 pF.

Extended Frequency Response: Useful for relative readings from 20 kHz to 700 MHz.

Response: Responds to peak value of input, and is calibrated to an rms value of a sine wave.

Voltage Range: 0.25 to 30V rms.

Maximum Input Voltage: 30V rms, 200V dc.

Input Impedance: 2 M Ω shunted by <10 pF.

Temperature Coefficient: ≤ 0.1 of ac-to-dc transfer ratio specification per $^{\circ}\text{C}$.

Output Connector: Fits standard 0.75 inch spaced dual banana connectors.

Accessory Connector: Slip-on BNC adapter is provided with probe.

6-36. CURRENT TRANSFORMER (801-600)

6-37. Introduction

6-38. The Model 801-600 extends the ac current measuring capability of the instrument up to a maximum of 600 amps. A clamp-on transformer designed into the probe allows measurements to be made without breaking the circuit under test. In use, the current carrying conductor being measured serves as the transformer's primary, while the 801-600 serves as the secondary. Because of a high efficiency, quadrature-type of winding, wire size and location of the conductor within the transformer jaws do not affect accuracy of the current measurement.

6-39. Specifications**Range:** 1 to 600A ac.**Accuracy:** $\pm 3\%$.**Frequency Response:** 30 Hz to 1 kHz (10 kHz typical).**Division Ratio:** 1000:1.**Working Voltage:** 750V rms maximum.**Insulation Dielectric Withstand Voltage:** 5 kV.**Maximum Conductor Size:** 2-inch diameter.**6-40. CURRENT SHUNT (80J-10)****6-41. Introduction**

6-42. The Model 80J-10 Current Shunt extends the current measuring capability of your meter to 10 amps continuous (20 amps for periods not exceeding 1 minute) DC to 10 kHz at an accuracy of $\pm 0.25\%$ in excess of the voltmeter accuracy.

6-43. Specifications**Shunt:** 10 amps at 100 mV.**Accuracy (18°C to 28°C):****DC to 10 kHz:** $\pm 0.25\%$.**10 kHz - 100 kHz:** Rising to 1 dB at 100 kHz typical.**Temperature Coefficient:** $0.005\%/^{\circ}\text{C}$.**Inductance:** 8.3 nH in series w/0.01 Ω shunt.**Overload:** Up to 1 minute at 20A with a 1/4 duty cycle for recovery after currents between 10A and 20A.**Connects to:** 3/4 inch center banana jacks.**Connectors:** 5-way binding posts (red and black).**6-44. BATTERY ELIMINATOR (A81)****WARNING**

DO NOT SUBSTITUTE A CALCULATOR TYPE BATTERY ELIMINATOR FOR THE A81. THESE UNITS DO NOT PROVIDE THE PROTECTION NECESSARY FOR COMMON MODE MEASUREMENTS UP TO 500V DC. ALWAYS USE THE MODEL A81 FOR AC-LINE OPERATION.

6-45. The A81 Battery Eliminator replaces the output of the DMM battery to allow ac-line operation of the DMM. Select the correct A81 configuration according to the list below:

NOTE

The "BT" indicator may come on when using the A81. This does not adversely affect the operation of the 8024A.

1. For 100V ac $\pm 10\%$, 48 to 62 Hz operation, use A81-100.
2. For 115V ac $\pm 10\%$, 48 to 62 Hz operation, use A81-115.
3. For 230V ac $\pm 10\%$, 48 to 62 Hz (U.S. type plug) operation, use A81-230-1.
4. For 230V ac $\pm 10\%$, 48 to 62 Hz (European type plug) operation, use A81-230.

6-46. AC/DC CURRENT PROBE (Y8100)

6-47. Introduction

6-48. The Fluke Y8100 DC/AC Current Probe is a clamp-on probe that is used with a voltmeter, multimeter, or oscilloscope to read dc, ac, or composite (ac on dc) current measurements. The jaws on the Y8100 are designed to clamp around conductors up to 3/4 inch in diameter. The pistol shape allows safe, easy, one-hand operation when making current measurement. The Model Y8100 probe is battery powered with size AA cells. It measures current to 200A dc or ac rms using most any voltmeter. Two ranges, 20A and 200A, produce a 2V output at full-range current.

6-49. Specifications

Ranges: 20A ac or dc, 200A ac or dc.

Rated Output: 2V at full range.

Accuracy:

DC to 200 Hz: $\pm 2\%$ of range.

200 Hz to 1 kHz: <100A add +3% reading, >100A add $\pm 6\%$ reading.

Calibration Cycle: 1 year.

Frequency Response: dc to 1.0 kHz.

Recommended Load: $\geq 3.0 \text{ k}\Omega$.

Temperature Range: $+15^\circ \text{C}$ to $+35^\circ \text{C}$; for specified accuracy -10°C to $+50^\circ \text{C}$; storage and operation at reduced accuracy.

Working Voltage Rating: Core to output; 600V dc or 480V ac Max output to ground; 42V dc or 30V ac Max.

Aperture Size: 3/4" (19 mm) diameter.

Size - Overall: 9" x 4-1/2" x 1-7/16" (230 mm x 115 mm x 37 mm).

Weight: 14 ounces (0.4 kg), with batteries.

Power: 4; "AA" cells.

Battery Life: Alkaline - 20 hours continuous.

6-50. AC CURRENT TRANSFORMER (Y8101)

6-51. Introduction

6-52. The Model Y8101 (Figure 6-1) is a small clamp-on current transformer designed to extend the current measuring capability of an ac current meter up to 150 amperes. A clamp-on coil designed into the probe allows measurements to be made without breaking the circuit under test. This coil serves as the secondary of a 1:1000 transformer. The current-carrying conductor being measured serves as the primary.

6-53. Specifications

Current Range: 2A to 150A.

Accuracy, (48 Hz to 10 kHz): $\pm 2\%$, 10A to 150A; $\pm 8\%$, 2A to 10A.

Division Ratio: 1000:1.

Working Voltage: 300V ac rms max.

Insulation Dielectric Withstand Voltage: 3 kV rms.

Maximum Conductor Size: 7/16" (1.11 cm).

6-54. SAFETY DESIGNED TEST LEAD SET (Y8132)

6-55. This test lead set is equivalent to the set originally supplied with the 8024A multimeter. The set includes one red and one black test lead. Each probe has an anti-slip shoulder near the test tip and is connected to the multimeter via a safety-designed shrouded banana connector. This set will fit John Fluke instruments with Safety-designed input jacks.

6-56. DELUXE TEST LEAD SET (Y8134)

6-57. Introduction

6-58. The Y8134 is a deluxe test lead set. The attachments provided allow interconnection with a wide variety of leads and electronic components. Included in the kit are:

1. Two test leads (one red and one black). The Y8134 leads have shrouded banana connectors on each end.
2. Two test probes.
3. Two insulated alligator clips.
4. Two spade lugs.
5. One squeeze hook.
6. One test lead pouch.
7. One instruction sheet.

6-59. SLIM FLEX TEST LEAD SET (Y8140)

6-60. Introduction


6-61. The Y8140 Test Lead Set (Figure 6-1) consists of one red and one black 60-inch (1.52 meter) test lead, each with a standard banana plug on one end and an extendable tip probe on the other end. This flexible metallic tip conductor may be extended up to 2-1/2 inches, and is insulated to within 1/10 of an inch of its tip. This insulation reduces the chance of creating an inadvertent short circuit while using the probes in their extended configuration. Intended primarily for measuring voltages, the Y8140 leads may also be used for measuring modest currents.

Section 7

Schematic Diagrams

TABLE OF CONTENTS

FIGURE	TITLE	PAGE
7-1.	8024A Schematic	7-3

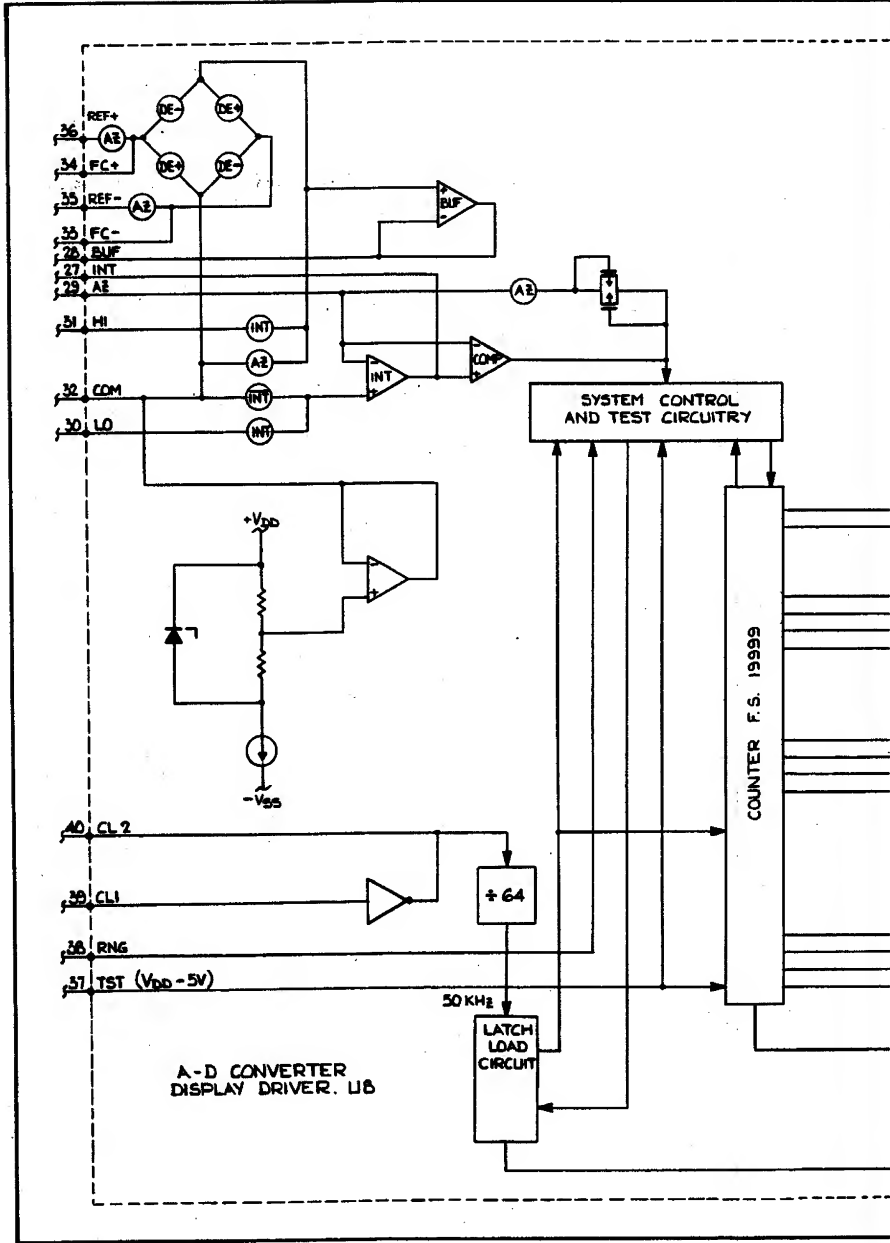

NOTES: (UNLESS SPECIFIED OTHERWISE).

1. ALL RESISTOR VALUES ARE IN OHMS.
2. ALL CAPACITOR VALUES ARE IN MICROFARADS.
3. LAST DESIGNATORS USED ARE: U21, CR8, R17, F1, C21, VR2, S10, J7, Q10, W2, BT1, RT1, RV4.
4. DESIGNATORS NOT USED ARE: R7, 11, 12, 13, 13; Q2, 4, 5, 6; ARI; U11; U13; CR7.


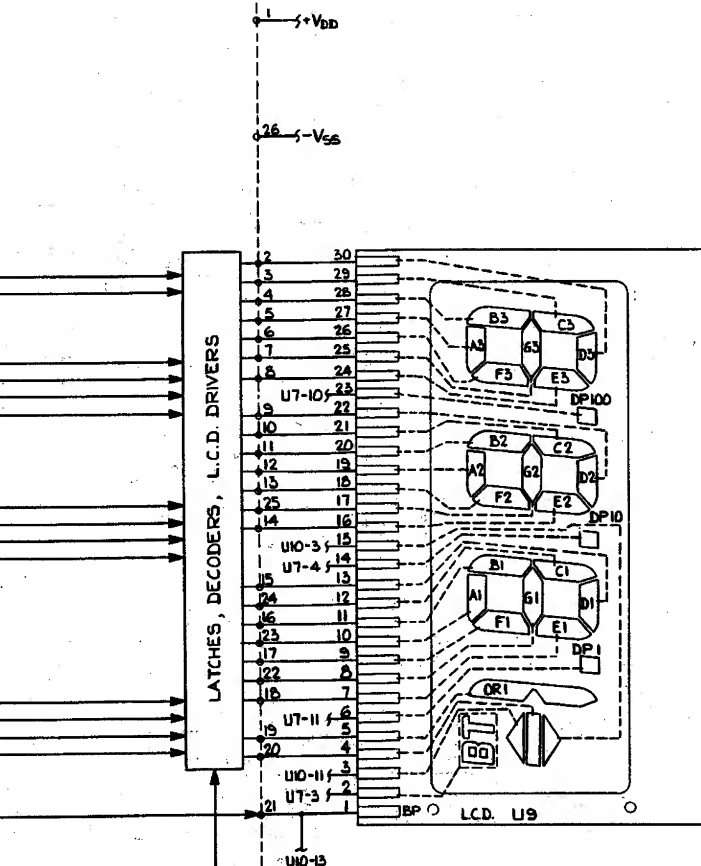


Figure 7-1. 8024A Schematic Diagram

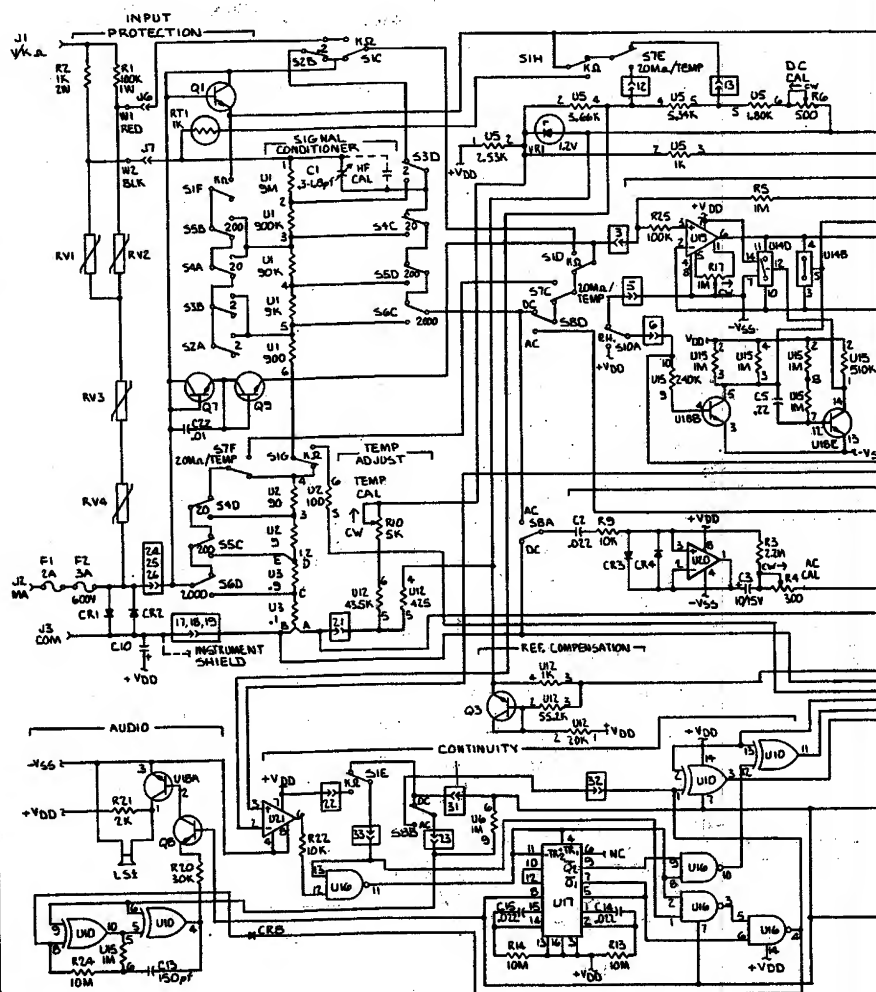

Appendix A

Manual Change and Backdating Information

INTRODUCTION

This appendix contains information necessary to backdate the manual to conform with earlier pcb configurations. To identify the configuration of the pcb's used in your instrument, refer to the revision letter (marked in ink) on the component side of each pcb assembly. Table A-1 defines the assembly revision levels documented in this manual.

NEWER INSTRUMENTS

As changes and improvements are made to the instrument, they are identified by incrementing the revision letter marked on the affected pcb assembly. These changes are documented on a supplemental change/errata sheet which, when applicable, is inserted at the front of the manual.

OLDER INSTRUMENTS

To backdate this manual to conform with earlier assembly revision levels, perform the changes indicated in Table A-1.

CHANGES

There are no backdating changes at this printing. All pcb assemblies are documented at their original revision level.

NOTE

This manual is identified as part number 609099. (First printing December 1980.) Parts list and schematics in this manual document instruments built after December 1980 with serial numbers beginning 2600000. For instruments with earlier serial numbers order instruction manual part no. 521476.

Table A-1. Manual Status and Backdating Information

Ref Or Option No.	Assembly Name	Fluke Part No.	* To adapt manual to earlier rev configurations perform changes in descending order (by no.), ending with change under desired rev letter													
			-	A	B	C	D	E	F	G	H	J	K	L	M	N
A1	Main PCB Assembly	578890	X													
A2	Switch PCB Assembly	578882	X													
* X = The PCB revision levels documented in this manual. ● = These revision letters were never used in the instrument. -- = No revision letter on the PCB.																

WARRANTY

Notwithstanding any provision of any agreement the following warranty is exclusive:

The JOHN FLUKE MFG. CO., INC., warrants each instrument it manufactures to be free from defects in material and workmanship under normal use and service for the period of 1-year from date of purchase. This warranty extends only to the original purchaser. This warranty shall not apply to fuses, disposable batteries (rechargeable type batteries are warranted for 90-days), or any product or parts which have been subject to misuse, neglect, accident, or abnormal conditions of operations.

In the event of failure of a product covered by this warranty, John Fluke Mfg. Co., Inc., will repair and calibrate an instrument returned to an authorized Service Facility within 1 year of the original purchase; provided the warrantor's examination discloses to its satisfaction that the product was defective. The warrantor may, at its option, replace the product in lieu of repair. With regard to any instrument returned within 1 year of the original purchase, said repairs or replacement will be made without charge. If the failure has been caused by misuse, neglect, accident, or abnormal conditions of operations, repairs will be billed at a nominal cost. In such case, an estimate will be submitted before work is started, if requested.

THE FOREGOING WARRANTY IS IN LIEU OF ALL OTHER WARRANTIES, EXPRESS OR IMPLIED, INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTY OF MERCHANTABILITY, FITNESS, OR ADEQUACY FOR ANY PARTICULAR PURPOSE OR USE. JOHN FLUKE MFG. CO., INC., SHALL NOT BE LIABLE FOR ANY SPECIAL, INCIDENTAL, OR CONSEQUENTIAL DAMAGES, WHETHER IN CONTRACT, TORT, OR OTHERWISE.

If any failure occurs, the following steps should be taken:

1. Notify the JOHN FLUKE MFG. CO., INC., or nearest Service facility, giving full details of the difficulty, and include the model number, type number, and serial number. On receipt of this information, service data, or shipping instructions will be forwarded to you.
2. On receipt of the shipping instructions, forward the instrument, transportation prepaid. Repairs will be made at the Service Facility and the instrument returned, transportation prepaid.

SHIPPING TO MANUFACTURER FOR REPAIR OR ADJUSTMENT

All shipments of JOHN FLUKE MFG. CO., INC., instruments should be made via United Parcel Service or "Best Way" prepaid. The instrument should be shipped in the original packing carton; or if it is not available, use any suitable container that is rigid and of adequate size. If a substitute container is used, the instrument should be wrapped in paper and surrounded with at least four inches of excelsior or similar shock-absorbing material.

CLAIM FOR DAMAGE IN SHIPMENT TO ORIGINAL PURCHASER

The instrument should be thoroughly inspected immediately upon original delivery to purchaser. All material in the container should be checked against the enclosed packing list. The manufacturer will not be responsible for shortages against the packing sheet unless notified immediately. If the instrument is damaged in any way, a claim should be filed with the carrier immediately. (To obtain a quotation to repair shipment damage, contact the nearest Fluke Technical Center.) Final claim and negotiations with the carrier must be completed by the customer.

The JOHN FLUKE MFG. CO., INC., will be happy to answer all applications or use questions, which will enhance your use of this instrument. Please address your requests or correspondence to: JOHN FLUKE MFG. CO., INC., P.O. BOX 43210, MOUNTLAKE TERRACE, WASHINGTON 98043, ATTN: Sales Dept. For European Customers: Fluke (Holland) B.V., P.O. Box 5053, 5004 EB, Tilburg, The Netherlands.

*For European customers, Air Freight prepaid.

John Fluke Mfg. Co., Inc., P.O. Box 43210, Mountlake Terrace, Washington 98043

Rev. 8/80